

### ASBESTOS - Present

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	EN02842	<b>Room / Area</b>	Consumable storage area
<b>Floor</b>	1st Floor	<b>Building</b>	Travis Perkins main building
<b>Description</b>	Insulating Boards - Void above Kitchen		



### MANAGEMENT SUMMARY

<b>Action</b>	Manage	<b>Material Assessment</b> Priority	6	<b>Combined Risk Score</b>	11
<b>Comments:</b>	Reverse side of store 2 visible from above kitchen ceiling only, the kitchen wall is overclad with timber sheets and kitchen and the sink unit are fitted up to it ceramic tiles to wall inbetween units.				
<b>Recommendations:</b>	.				

### SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	C05374
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Number</b>	B6
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Present

### MATERIAL ASSESSMENT (SCORE = 6)

<b>Product Type</b>	Insulating Board	2	<b>Surface Treatment</b>	Enclosed or encapsulated AIB	1
<b>Extent of Damage / Deterioration</b>	Low damage	1	<b>Asbestos Type</b>	Amosite	2
<b>Quantity</b>	= 9 Sq m				

### MANAGEMENT ASSESSMENT (SCORE = 5)

<b>Normal Occupancy/Activity</b>	Low disturbance activity (e.g. office type activity)	1	<b>Human Exposure Potential/Number of Occupants</b>	None	0
			<b>Frequency of Use</b>	Daily	3
<b>Location</b>	Rooms up to 100 square metres	2	<b>Average Time in Use</b>	< 1 hour	0
			<b>Maintenance Activity</b>	Low disturbance (e.g. changing light bulbs in asbestos insulating board ceiling)	1
<b>Accessibility</b>	Easily disturbed	2			

<b>Amount</b>	<= 10 square metres or <= 10 metres pipe run	<b>Maintenance Frequency</b>	<= 1 per year	<u>1</u>
---------------	--	------------------------------	---------------	----------

### ASBESTOS - Strongly presumed

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	Loc6317	<b>Room / Area</b>	Consumable storage area
<b>Floor</b>	1st Floor	<b>Building</b>	Travis Perkins main building
<b>Description</b>	Insulating Board - Store Wall to Kitchen		



### MANAGEMENT SUMMARY

<b>Action</b>	Manage & Label	<b>Material Assessment</b> Priority Assessment	6 4	<b>Combined Risk Score</b>	10
<b>Comments:</b>	.				
<b>Recommendations:</b>	.				

### SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Reference</b>	Strongly presumed
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Strongly presumed

### MATERIAL ASSESSMENT (SCORE = 6)

<b>Product Type</b>	Insulating Board	2	<b>Surface Treatment</b>	Enclosed or encapsulated AIB	1
<b>Extent of Damage / Deterioration</b>	Low damage	1	<b>Asbestos Type</b>	Strongly Presumed Amosite	2
<b>Quantity</b>	= 9 Sq m				

### MANAGEMENT ASSESSMENT (SCORE = 4)

<b>Normal Occupancy/Activity</b>	Low disturbance activity (e.g. office type activity)	1	<b>Human Exposure Potential/Number of Occupants</b>	1 to 3	1
<b>Secondary Activities in Area</b>			<b>Frequency of Use</b>	Daily	3
<b>Location</b>	Rooms up to 100 square metres	2	<b>Average Time in Use</b>	< 1 hour	0
<b>Accessibility</b>	Usually inaccessible	0	<b>Maintenance Activity</b>	Low disturbance (e.g. changing light bulbs in asbestos insulating board ceiling)	1

<b>Amount</b>	<= 10 square metres or <= 10 metres pipe run	<b>Maintenance Frequency</b>	<= 1 per year	<u>1</u>
---------------	--	------------------------------	---------------	----------

## ASBESTOS - Presumed

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	Loc6320	<b>Room / Area</b>	Boxing
<b>Floor</b>	All Areas	<b>Building</b>	Travis Perkins main building
<b>Description</b>	No access to boxing		



## MANAGEMENT SUMMARY

Action	N/A	Material Assessment Priority Assessment	0	Combined Risk Score
<b>Comments:</b>	No access to boxing, Presumed asbestos until proven otherwise.			
<b>Recommendations:</b>	.			

## SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Reference</b>	No access
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Presumed

## MATERIAL ASSESSMENT (SCORE = 0)

<b>Product Type</b>	No access	0	<b>Surface Treatment</b>	No access	0
<b>Extent of Damage / Deterioration</b>	No access	0	<b>Asbestos Type</b>	No access	0
<b>Quantity</b>	= 2 N/A				

## MANAGEMENT ASSESSMENT

<b>Normal Occupancy/Activity</b>	<b>Human Exposure Potential/Number of Occupants</b>
<b>Secondary Activities in Area</b>	<b>Frequency of Use</b>
<b>Location</b>	<b>Average Time in Use</b>
<b>Accessibility</b>	<b>Maintenance Activity</b>
<b>Amount</b>	<b>Maintenance Frequency</b>

## ASBESTOS - Presumed

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	Loc6321	<b>Room / Area</b>	Timber cladding to walls
<b>Floor</b>	All Areas	<b>Building</b>	Travis Perkins main building
<b>Description</b>	No access to timber cladding to walls		



## MANAGEMENT SUMMARY

Action	N/A	Material Assessment Priority Assessment	0	Combined Risk Score
<b>Comments:</b>	No access to timber cladding to walls, Presumed asbestos until proven otherwise.			
<b>Recommendations:</b>	.			

## SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Reference</b>	No access
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Presumed

## MATERIAL ASSESSMENT (SCORE = 0)

<b>Product Type</b>	No access	<u>0</u>	<b>Surface Treatment</b>	No access	<u>0</u>
<b>Extent of Damage / Deterioration</b>	No access	<u>0</u>	<b>Asbestos Type</b>	No access	<u>0</u>
<b>Quantity</b>	= 1 N/A				

## MANAGEMENT ASSESSMENT

<b>Normal Occupancy/Activity</b>		<b>Human Exposure Potential/Number of Occupants</b>	
<b>Secondary Activities in Area</b>		<b>Frequency of Use</b>	
<b>Location</b>		<b>Average Time in Use</b>	
<b>Accessibility</b>		<b>Maintenance Activity</b>	
<b>Amount</b>		<b>Maintenance Frequency</b>	

## ASBESTOS - Presumed

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	Loc6319	<b>Room / Area</b>	Electrics
<b>Floor</b>	Ground Floor	<b>Building</b>	Travis Perkins main building
<b>Description</b>	No access to electrics		



## MANAGEMENT SUMMARY

<b>Action</b>	N/A	<b>Material Assessment</b>	0	<b>Combined Risk Score</b>		
		<b>Priority Assessment</b>				
<b>Comments:</b>	No access to electrics as live, Presumed asbestos until proven otherwise.					
<b>Recommendations:</b>	.					

## SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Reference</b>	No access
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Presumed

## MATERIAL ASSESSMENT (SCORE = 0)

<b>Product Type</b>	No access	<u>0</u>	<b>Surface Treatment</b>	No access	<u>0</u>
<b>Extent of Damage / Deterioration</b>	No access	<u>0</u>	<b>Asbestos Type</b>	No access	<u>0</u>
<b>Quantity</b>	= 1 N/A				

## MANAGEMENT ASSESSMENT

<b>Normal Occupancy/Activity</b>		<b>Human Exposure Potential/Number of Occupants</b>	
<b>Secondary Activities in Area</b>		<b>Frequency of Use</b>	
<b>Location</b>		<b>Average Time in Use</b>	
<b>Accessibility</b>		<b>Maintenance Activity</b>	
<b>Amount</b>		<b>Maintenance Frequency</b>	

## ASBESTOS - Presumed

<b>Address</b>	READING WOODLEY TP, WOODLEY GREEN, CHURCH ROAD, RG5 4QP		
<b>Site ID</b>	3278	<b>Site Name</b>	READING WOODLEY TP
<b>Location ID</b>	Loc6322	<b>Room / Area</b>	Roofs
<b>Floor</b>	Roof access	<b>Building</b>	Travis Perkins main building
<b>Description</b>	No access to roofs TP		



## MANAGEMENT SUMMARY

Action	N/A	Material Assessment Priority Assessment	0	Combined Risk Score
<b>Comments:</b>	No access to roofs, Presumed asbestos until proven otherwise.			
<b>Recommendations:</b>	.			

## SURVEY INFORMATION

<b>Surveyed</b>	YES	<b>Source of Information</b>	Mark Murgatroyd (Tersus)
<b>Last Inspection Date</b>	08/10/2020	<b>Lab Reference</b>	
<b>Next Inspection Date</b>	08/10/2021	<b>Sample Reference</b>	No access
<b>Survey Type</b>	Reinspection	<b>Asbestos Identification</b>	Presumed

## MATERIAL ASSESSMENT (SCORE = 0)

<b>Product Type</b>	No access	0	<b>Surface Treatment</b>	No access	0
<b>Extent of Damage / Deterioration</b>	No access	0	<b>Asbestos Type</b>	No access	0
<b>Quantity</b>	= 2 Units				

## MANAGEMENT ASSESSMENT

<b>Normal Occupancy/Activity</b>		<b>Human Exposure Potential/Number of Occupants</b>	
<b>Secondary Activities in Area</b>		<b>Frequency of Use</b>	
<b>Location</b>		<b>Average Time in Use</b>	
<b>Accessibility</b>		<b>Maintenance Activity</b>	
<b>Amount</b>		<b>Maintenance Frequency</b>	