



- NOTES
1. THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECT'S AND M&E DRAWINGS TOGETHER WITH THE SPECIFICATION.
 2. THIS DRAWING TO BE READ IN COLOUR.
 3. ELEVATION GEOMETRY IS APPROXIMATE ONLY AND NOT BASED ON DETAILED MEASURED SURVEY.

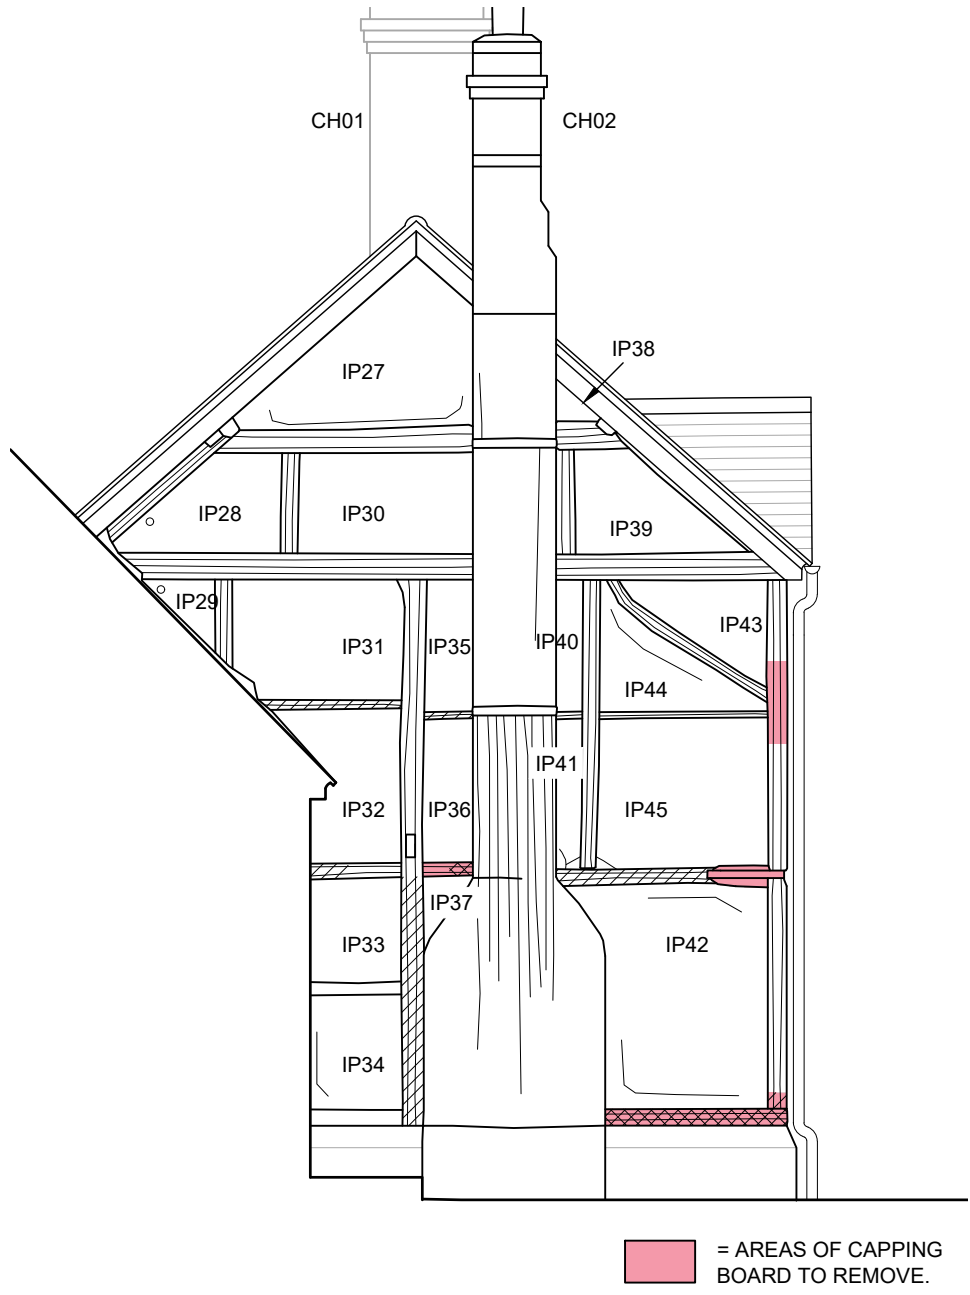


STEP 1

- CAREFULLY REMOVE EXISTING TIMBER CAPPING BOARDS. THESE ARE CURRENTLY NAILED ON.

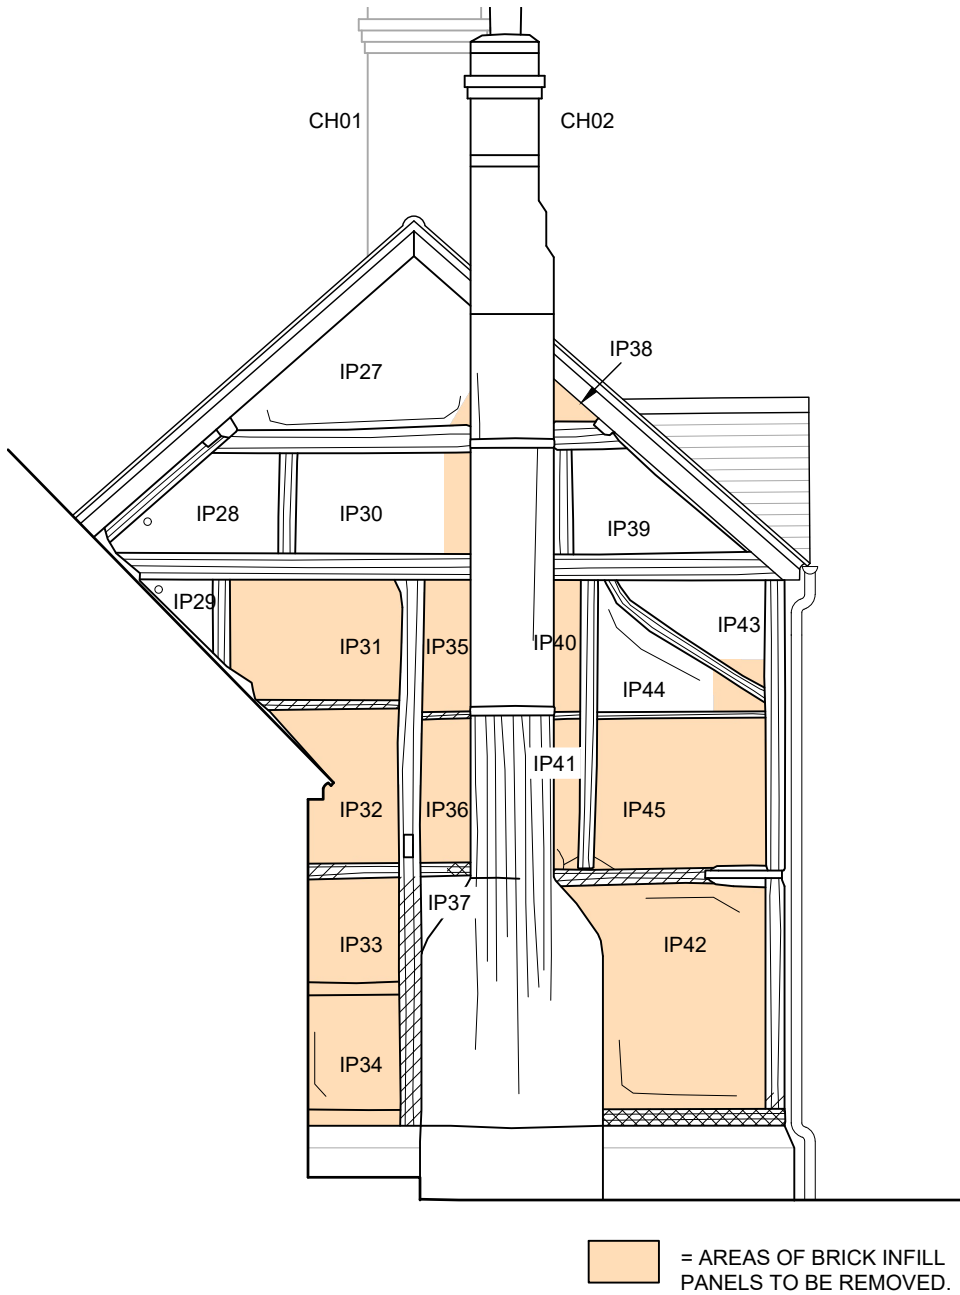


STEP 2

- CAREFULLY REMOVE BRICK INFILL PANELS TO ENABLE THE TIMBERS TO BE ACCESSED AND REPAIRED.
- ALLOW FOR TEMPORARY PROPPING TO PANELS ABOVE THOSE REMOVED.

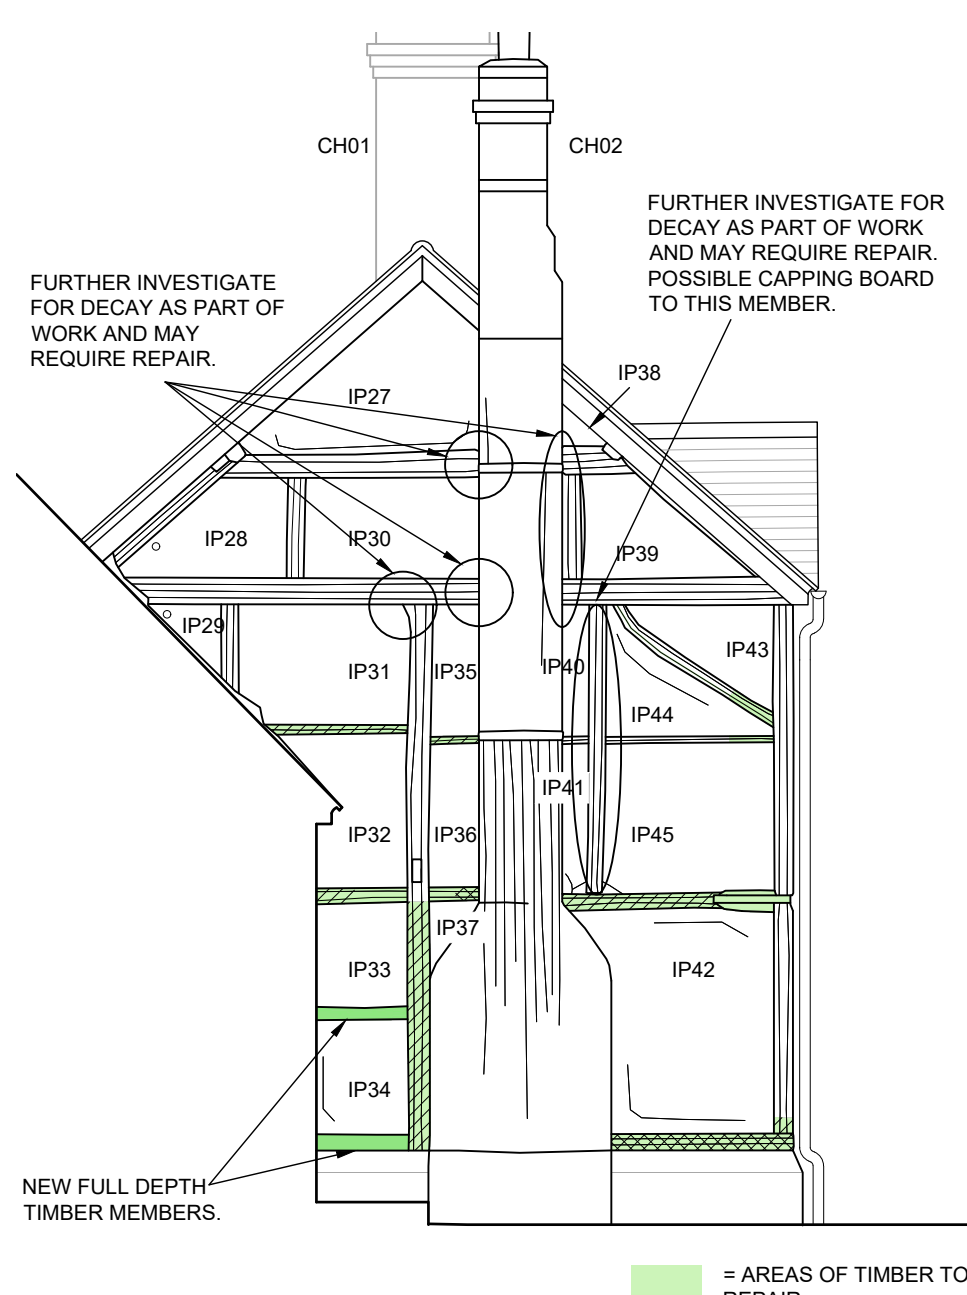


STEP 3

- CARRY OUT TIMBER REPAIRS.
- REFER TO SFK DRAWING 23093-0102 FOR REPAIR DETAILS.

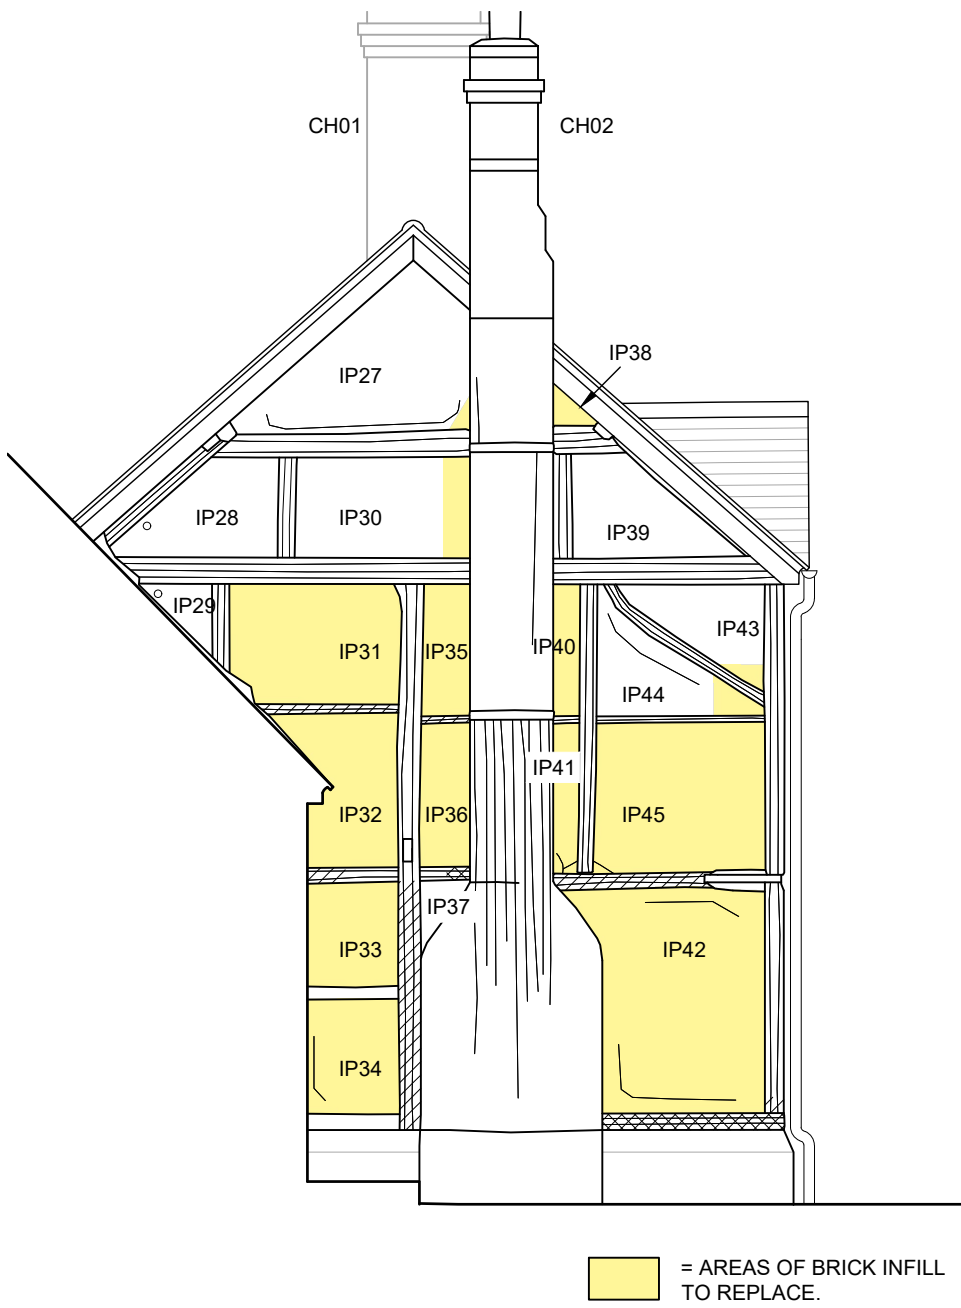

STEP 4

- REPLACE BRICK INFILL PANELS AND RENDER TO ARCHITECT'S RECOMMENDATIONS.

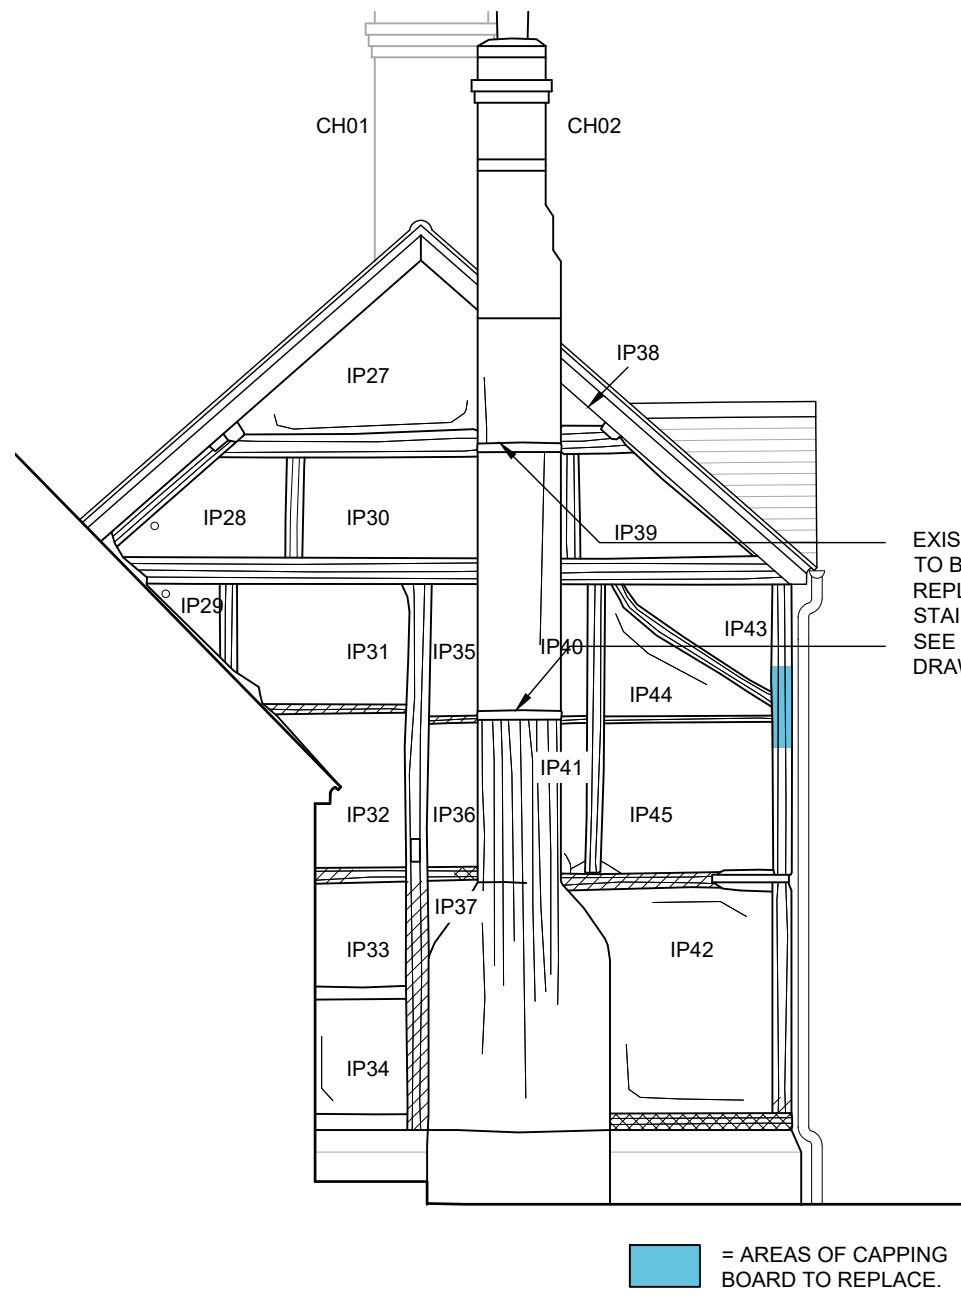

STEP 5

- REPLACE CAPPING BOARDS. REFER TO DETAILS ON SFK DRAWING 23093-0102.

Scale Bar - 1:50 0 0.5 1.0 1.5 2.0m

CLIENT:

MR & MRS WINTERS

PROJECT:

1 RADSTOCK COTTAGE, READING

DRAWING TITLE:

PART NORTH WEST ELEVATION
TIMBER FRAME REPAIRS AND
WORK SEQUENCE

SFKconsulting
2nd Floor, Trinity House,
123 Winchester Road
Chandler's Ford
Eastleigh SO53 2DR
Tel: 023 8251 6969

REV	Drawn	Chkd	Appd	date	description
P1	ML	NW		02/04/24	ISSUED FOR PLANNING / LBC
SCALE:					1:50 @ A1
DRAWING NUMBER:					23093-SFK-RAD-XX-DR-S-0101
SFK REF:					23093 - 0101
					P1