

**Arboricultural Implications
Assessment
for a proposed development
at
145 Nash Grove Lane
Finchampstead
RG40 4HE
Rev C**

**Client: Chris Evans Consultancy Ltd
145 Nash Grove Lane
Finchampstead
RG40 4HE**

Prepared by
Simon Hawkins Dip Arb L6 (ABC) N.D Arbor M. Arbor. A.

Date
07/08/2025



Merewood.
Gregory Road, Hedgerley, Bucks. SL2 3XW
M. 07784 915944 T. 01753 647236
E. simon.hawkins@hotmail.co.uk
VAT No: 990 9313 9

1.	Introduction	
1.1.	Instruction.....	2
1.2.	The Site.....	2
1.3.	Survey Date.....	2
1.4.	Scope and Purpose of the Report.....	2
1.5.	Documents referred to.....	3
2.	The Trees	
2.1.	Results summary.....	3
3.	Arboricultural Impact Assessment	
3.1.	Overview.....	3
3.2.	Proposed tree works.....	4
3.3.	Changes to soil levels.....	4
3.4.	The Impact of movement around the site.....	4
3.5.	The Impact of demolition.....	4
3.6.	The Impact of excavations.....	4
3.7.	The Impact of construction site activities.....	5
3.8.	Issues to be addressed by the method statement.....	5
3.9.	Summary.....	5
4.	Appendix 1	
	Tree survey methodology.....	6
5.	Appendix 2	
	Schedule of tree constraints	8
6.	Appendix 3	
	Plan of tree constraints.....	10
7.	Appendix 4	
	Impact Assessment Plan.....	11
8.	Appendix 5	
	Qualifications and Experience.....	12

1.0 Introduction

1.1 Instruction

- 1.1.1 I am instructed by Chris Evans Consultancy Ltd to undertake an Arboricultural Survey at 145 Nash Grove Lane, Finchampstead. I am also instructed to assess the likely impact of development proposals and produce an Arboricultural Method Statement detailing how trees shall be protected from the proposed construction activity.
- 1.1.2 The proposals are for the demolition of the existing and the erection of a new detached dwelling and garage with associated parking and landscaping

1.2 The Site

- 1.2.1 145 Nash Grove Lane is a detached house positioned to the west side of Nash Grove Lane served by a dual entrance driveway. The property has a large front garden and a rear garden. The plot is rectangular in shape.
- 1.2.2 Nash Grove Lane is a mainly residential road running roughly south to north connecting with the village centre to the south. Finchampstead itself is a small village to the south west of Wokingham town centre.
- 1.2.3 The topography of the property overall is more or less level.
- 1.2.4 It has been established at the time of the survey that the trees on the site are not covered by a Tree Preservation Order nor are they located within a designated Conservation Area (check conducted on Wokingham District Council website 12/07/24).

1.3 Survey date

- 1.3.1 The trees at 145 Nash Grove Lane, Finchampstead were surveyed on Friday, August 2nd, 2024.

1.4 Scope and Purpose of the report

- 1.4.1 The tree survey and assessment of existing trees has been carried out in accordance with guidance contained within British Standard B.S. 5837:2012 'Trees in relation to design, demolition and construction - Recommendations' (hereafter referred to as B.S. 5837). The guidelines set out a structured assessment methodology to assist in determining which trees would be deemed either as being suitable or unsuitable for retention.
- 1.4.2 The purpose of this report therefore is therefore to firstly, present the results of an assessment of the existing trees' arboricultural value, based on their current condition and quality and to secondly, provide an assessment of impact

arising from the development of the site.

- 1.4.3 The report is designed to support a planning application for development proposals at the above site. The survey has therefore focused on any trees present within or bordering the site that may potentially be affected by the future proposals or will pose a constraint to any proposed development

1.5 Documents referred to

- 1.5.1 The tree survey and this report have been prepared with reference to the following documents:

The existing site plan

The proposed site layout plan

The schedule of tree constraints (appendix 2)

The Impact Assessment plan (appendix 3)

The Arboricultural Method Statement (rev C) prepared by MACS (see separate document)

2.0 Results

2.1 Results summary

- 2.1.1 Appendix 1 presents details of the individual trees and groups found during the assessment including heights, stem diameters and rpa's, crown spread (normally measured to cardinal points unless otherwise indicated), an indication of physiological and structural condition, age class, any appropriate management recommendations, estimated life expectancy and a BS5837 category of quality.

- 2.1.2 The survey has revealed that of the 13 trees and 5 groups of trees surveyed, 0 are category 'A', 8 are category 'B'; 2 are category 'C' plus 5 category 'C' groups and 3 are category 'U' trees.

3.0 Arboricultural Impact Assessment

3.1 Overview of typical construction site activity

Development activity	Potential impact	Consequence	Mitigation
Delivery of materials to the site Plant machinery accessing the site	Soil compaction and erosion	Root damage and die back limiting the ability of the tree to take up water and nutrients	Create construction exclusion zones (CEZ's) by the erection of barrier fencing
Storage of materials on the site	Leachate from chemical based products contaminating soil	Roots die back and soil becomes contaminated inhibiting future root recovery	Provide a dedicated area for the storage of materials following delivery away from root protection areas.
Distribution of materials about the site	Damage to branches or bark due to careless handling	Wounding of the bark can lead to infection from wood	Erect barrier fencing that takes account of branch spread as

		decay pathogens	well as roots
Foundation excavation for the walls	Severing of roots	Root damage and die back limiting the ability of the tree to take up water and nutrients. Crown die back Death of the tree	Where excavation is within the root protection areas (RPA's), use a lintel to bridge over roots if possible. Limit incursion as far as possible.
Mixing of cement, plaster, etc.	Leachate from chemical based products contaminating soil	Roots die back and soil becomes contaminated inhibiting future root recovery	Provide a dedicated area for mortar mixing (etc.) with a suitably thick plastic (impermeable) membrane to prevent chemicals leaching. Provide a spare reservoir of water close by to wash away spillages
Contractor parking	Soil compaction and erosion	Root damage and die back limiting the ability of the tree to take up water and nutrients	Provide dedicated area for contractor parking away from RPA's

3.2 Proposed tree works

3.2.1 The proposed development does not require the removal of any trees.

3.2.2 There is no pruning work needed to facilitate the development.

3.3 Changes to soil levels

3.3.1 There are no other changes to soil levels proposed that would affect retained trees.

3.4 The Impact of Movement around the Site

3.4.1 The tree protection plan (see method statement) shows where fencing is to be erected prior to the commencement of works on the site.

The erection of protective fencing barriers and the recommended type of barrier is addressed in the Arboricultural Method Statement – section 3.2.

3.4.2 Following the

3.5 The Impact of Demolition

3.5.1 The removal of the existing house does not involve the removal or pruning of any trees. Machinery needed to undertake the demolition will be able to operate from either the front of the building, or within the footprint of the building thereby avoiding impact on root protection areas.

3.6 The Impact of Excavations

- 3.6.1 The excavations of the proposed foundations for the new house will take place outside the RPA's of any of the retained trees and will therefore have no bearing on the wellbeing of those trees.

3.7 The Impact of Construction Site Activities

- 3.7.1 The site working area will be established to the side of the new house away from the RPA's of the retained trees. There is enough space about the site for this to be possible.
- 3.7.2 Deliveries will be made by means of the existing driveway entrances off Nash Grove Lane. Materials are to be set down at the front of the site where they can remain in situ until needed or moved to a more appropriate area or be brought under cover if necessary.
- 3.7.3 The existing lawn area at the front of the site is to be used for the storage of cement and plaster bags hazardous chemicals and petrochemical products and will also provide a suitable area for mortar mixing in line with COSHH regulations to ensure there is no detrimental effect on trees.

The mixing of cement and cleaning of tools is addressed in the Arboricultural Method Statement – section 3.5.


3.8 Issues to be addressed by the Method Statement

- 3.8.1 The Method Statement will address the following issues

- Installation of protective fencing
- Building site activities
- Cement mixing

3.9 Summary

- 3.9.1 The erection of a new dwelling can be undertaken with no impact to the retained trees. Full provision can be made for the protection of all trees to remain in order to ensure their continued viability following the completion of construction.



Simon Hawkins Dip Arb L6 (ABC), ND Arb, MArborA

Appendix 1 - Tree Survey Methodology

1. The ground level survey of the trees has been carried out in accordance with the criteria set out in Chapter 4 of B.S 5837. The survey has recorded information relating to all those trees within the site and those adjacent to the site which may be of influence on the proposals.
2. The purpose of this report is to modify the recommendation found in the tree constraints schedule for the future use of this site. Where applicable, trees with significant defects have been highlighted and appropriate remedial works have been recommended. However, this report should not be seen as a substitute for a full *Safety Survey* or *Management Plan* which are specifically designed to minimise risk and liability associated with the responsibility for trees. No climbed inspections or specialist decay detection were undertaken.
3. Evaluation of tree condition within the assessment applies to the date of survey and cannot be assumed to remain unchanged. It may be necessary to review these within 12 months in accordance with sound arboricultural practice as recommended by the National Trees Safety Group guidance 'Common Sense Risk Management for Trees'.
4. Trees have been divided into one of four categories based on Table 1 of B.S.5837, 'Cascade chart for tree quality assessment'. For a tree to qualify under any given category it should fall within the scope of that category's definition.

Category U - Red	Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.
Category A - Green	Those trees of the highest quality and value: in such a condition as to be able to make a substantial contribution (a minimum of 40 years is suggested).
Category B - Blue	Trees of moderate to high quality and value: in such a condition as to be able to make a significant contribution (a minimum of 20 years is suggested).
Category C - Grey	Trees of low quality and value: currently in adequate condition to remain until new planting could be established (a minimum of 10 years is suggested), or young trees with a stem diameter of below 150mm
Subcategory 1 concerns mainly arboricultural values, how good a specimen is in terms of form and physiological condition; the value of a tree as a component in a group or in a formal or semi-formal arboricultural feature such as an avenue.	
Subcategory 2 concerns mainly landscape values and considers the importance of a tree or group of trees as an arboricultural or landscape feature. Trees present in larger numbers, such as woodlands for example may attract a higher rating than they would as individuals because of their collective value.	
Subcategory 3 concerns mainly cultural values including conservation, historical, commemorative, or other value such as veteran or wood pasture.	

5. RPA's of single stemmed trees are calculated according to the following formula:
RPA radius = 12 x stem diameter (measured at 1.5m above ground level)
6. Where a tree has more than one stem, the equivalent single stem diameter is usually recorded. This is calculated by adding the squares of the stems and then finding the square root of the total. The radius of the RPA is then calculated by multiplying the equivalent stem diameter by 12 (ref B.S. 5837:2012 para 4.6.1). Where access is restricted an estimate of the stem diameter is provided and this is indicated in the appropriate column.

Appendix 2


Schedule of tree constraints

Tree no	Species	Height	Stem diameter	Crown spread				Physiological condition	Structural condition	Age	Observations/ Management recommendations	Life expectancy	Category
				North	South	East	West						
T1	Ash	13	210 210	5	4	3	5	P	F	M	Twin stemmed tree suffering from Chalara die back of ash	<10	U
T2	Holly	-	-	-	-	-	-	-	-	-	Dead	-	U
T3	Oak	13	500	4	6	6	6	F	F	M		40+	B2
T4	Ash	14	460	5	4	5	6	G	G	M	Not yet showing signs of Chalara die back of ash	40+	B1 + B2
T5	Silver birch	13	180	3	0	2	2	G	G	M		20 - 40	B2
T6	Silver birch	13	270	1	3	3	2	G	G	M		20 - 40	B2
T7	Silver birch	13	330	4	4	2	5	G	G	M		20 - 40	B2
T8	Lawson cypress	13	490	2	2	2	2	F	G	M		20 - 40	C
T9	Ash	14	680 (est)	5	6	5	4	P	F	M	Neighbours' tree suffering from Chalara die back of ash	<10	U
T10	Oak	10	420	2	6	4	5	P	F	M		10 - 20	C
T11	Oak	10	570	7	8	6	7	G	G	M		40+	B1 + B2
T12	Oak	11	430	3	6	3	2	F	G	M		40+	B2

Tree no	Species	Height	Stem diameter	Crown spread				Physiological condition	Structural condition	Age	Observations/ Management recommendations	Life expectancy	Category
				North	South	East	West						
T13	Oak	11	390	4	5	1	4	F	G	M		40+	B2
G1	Hazel	6	12 x 40	3	3	3	3	G	G	M	Multiple stemmed cluster that could be pruned back or coppiced	40+	C
G2	Leyland cypress	16	330 (avg)	3	3	3	3	G	G	M	Overgrown hedge incongruous to the setting	40+	C
G3	Lawson cypress	12	180	1	1	1	1	F	G	M		40+	C
G4	Mixed	6	100	1	1	1	1	P	F	M		10 - 20	C
G5	Goat willow	8	7 x 350	6	7	5	5	G	G	M		20 - 40	C

Appendix 3

Plan of tree constraints

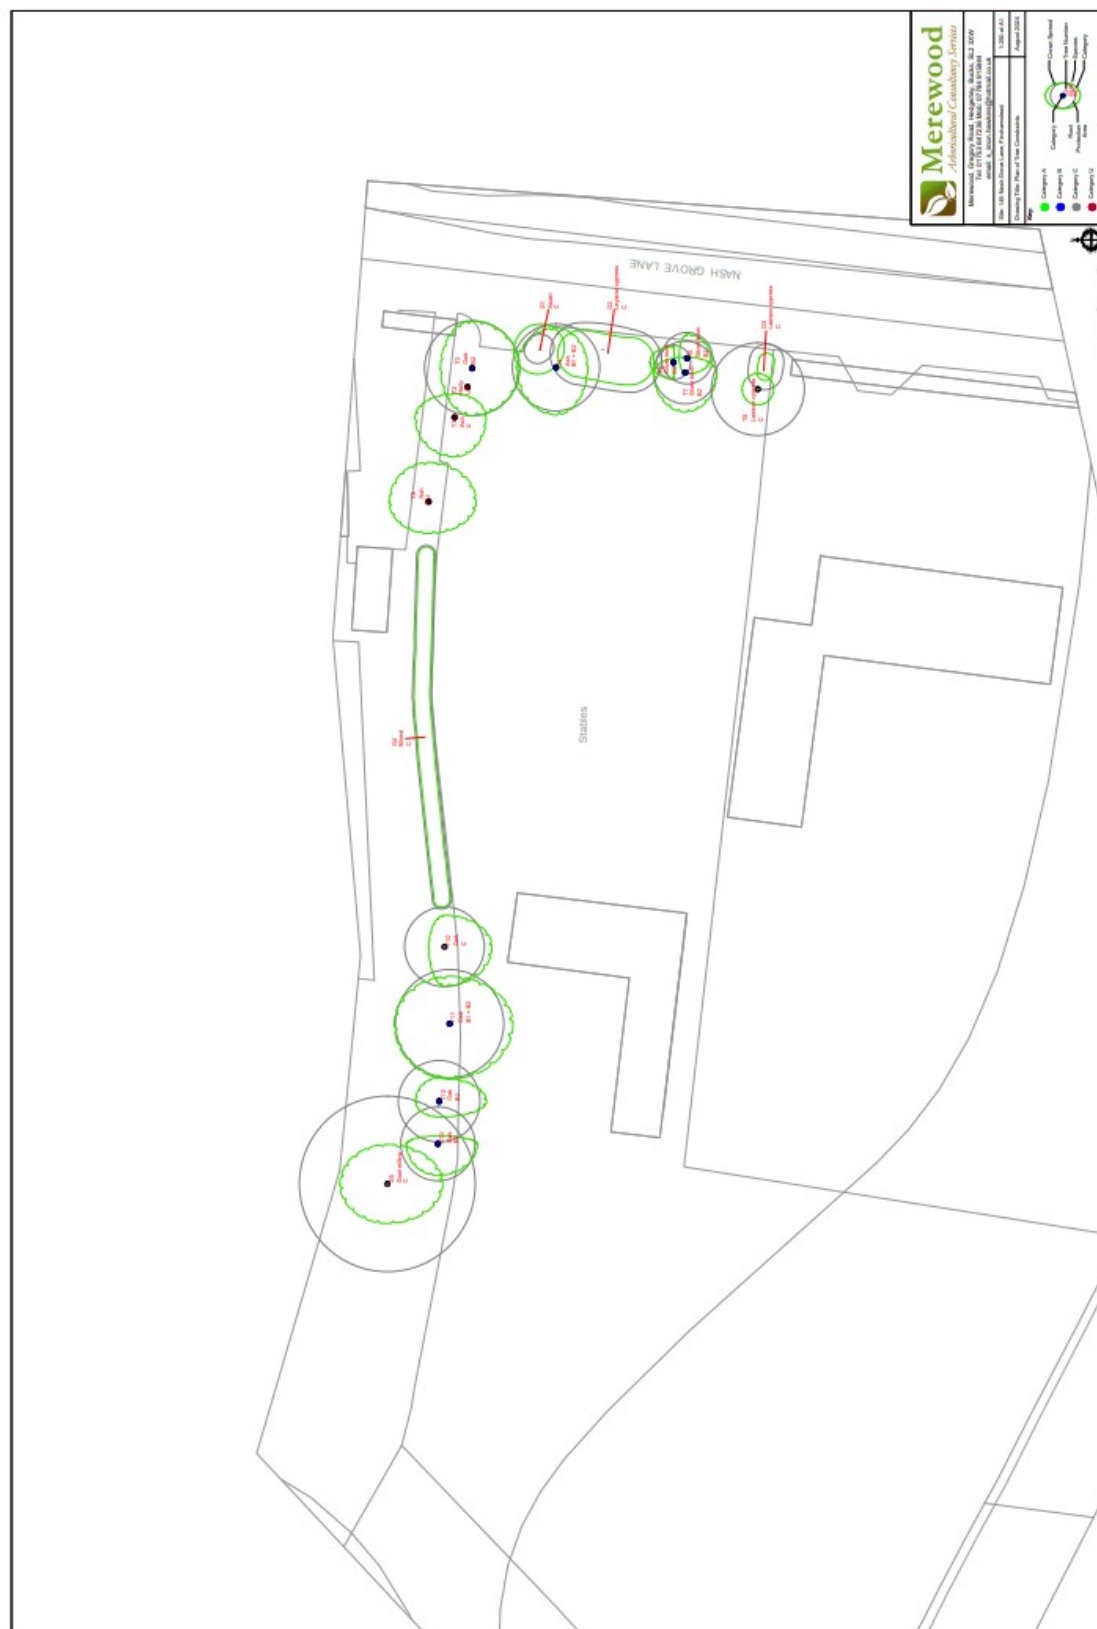

Impact Assessment Plan



Appendix 4

Qualifications and experience

- I am Simon Hawkins, proprietor of Merewood Arboricultural Consultancy Services.
- I hold the Level 6 Professional Diploma in Arboriculture. This is the highest level of award in the industry.
- I hold the National Diploma in Arboriculture which I attained in 1987. I have studied and practised Arboriculture for over 30 years, during which time I have been involved with both the private and public sector.
- I hold the LANTRA award for professional tree inspections
- I hold professional member status of the Arboricultural Association (M. Arbor A.), recognised as a higher vocational level within the industry.
- I have undertaken an intensive course in the principles and application of VTA Visual Tree Assessment. I have been assessed and found to have attained the advanced level of technical competence of a VTA Practitioner with Elite Training.
- I have over 18 years' experience working in the public sector, during which time I have dealt with all aspects of trees and development in the town planning context, within the inner city; in a greater London Borough; and in the Green Belt. Typically, I have worked with planners, developers, architects and other professionals in the construction industry in which I provide advice and assistance in dealing with arboricultural matters.
- I have appeared at numerous appeals, informal hearings and public enquiries to make formal representations. I have also appeared as an expert witness in court with regard to breaches of a Tree Preservations Order.