



Arboricultural impact appraisal and method statement

412a Finchampstead Road, Wokingham, Berkshire RG40 3RA

Chris Alder MSc HNDArb FARborA MICFor RCarborA

Site location and report purpose

Site location



This aerial image is supplied courtesy of Google. The yellow line shows the approximate site boundary and is illustrative only.

Report purpose

This arboricultural impact appraisal report provides sufficient information for the Local Planning Authority (LPA) to consider the effect of the proposed development on local character from a tree perspective. It is fully compliant with the BS 5837 advice relating to the planning application stage of the process and it meets national standard planning application validation requirements.

More specifically, the development proposal is to install minor extensions and undertake refurbishment works at 412a Finchampstead Road, Wokingham RG40 3RA.

This report includes:

- A **Tree protection plan** illustrating tree locations, categories, the location of the proposed development, and the proposed tree protection measures.
- An **Arboricultural impact appraisal** (section 1 of the report) providing an analysis of the tree issues to assist the LPA in assessing the impact on local character.
- An **Arboricultural method statement** (section 2 of the report) describing how retained trees will be protected and managed during the development activity.



Site location and report purpose

- **Appendices** (**Appendix 1** – Background administrative information and data collection; **Appendix 2** – Tree schedule and explanatory notes; and, **Appendix 3** – QR Codes for Site Guidance Notes (SGNs).
- A companion document to supplement the main report titled ***Manual for managing trees on development sites (Version 3.0)***, which provides explanations of how retained trees will be managed on site in the form of SGNs covering the relevant issues.

1 Arboricultural impact assessment

1.1 Table 1: Summary of trees affected and protected by the proposal

From our review of the constraints and the proposed layout, our assessment of the impact on trees, both during and after development, and those that need protection using special precautions, is summarised in Table 1:

	British Standard 5837 Category		
	A (High quality)	B (Moderate quality)	C (Low quality)
Remove	None	None	None
Prune	None	None	None
Protect using special precautions See Notes below	None	T1, T2, T3, T4, T14, T19	None
Post development pressure to fell	None	None	None

T = Tree

Note on types of protection: All retained trees will be protected during development by using fencing and ground protection, and only those requiring special precautions to limit the impact of encroachment are listed in Table 1.

1.2 The impact of tree removals on local character

No trees will be removed because of this development and so there will be no impact on local character for that reason.

1.3 The impact of tree pruning on local character

Other than pruning for normal maintenance, no trees will be pruned because of this development and so there will be no impact on local character for that reason.

1.4 RPA adjustment

Trees T1, T2, T3, T14 and T19

BS 5837 (4.6.2 & 4.6.3) makes provision for adjusting the nominal circular RPA, if justified by pre-existing site conditions or other factors. On this site, we have assessed that this can be reasonably applied to these trees due to the presence of the main highway, and appropriate adjustments are illustrated on the tree protection plan. More specifically, the entirety of the front garden up to the existing house and garage is contiguous RPA for the four trees.

1.5 The impact of works in precautionary areas

Trees T1, T2, T3, T14 and T19

These trees may be affected by the removal of existing driveway surfacing and replacement with new surfacing. I have carefully reviewed the levels in these areas and it would be feasible to install custom designed no-dig specification surfacing without causing any significant disturbance to the RPAs. From our previous experience at installing such surfacing (www.barrelltreecare.co.uk/case-studies/SurfacingNearTrees.pdf), we are confident that this can be implemented without any long term detrimental impact on tree health, with the detail to be agreed as part of a planning condition. This surfacing solution is within the advice set out in BS 5837 (8.6) and would be appropriate in this situation. In summary, if the guidance set out in SGN 9 *Installing/upgrading surfacing in RPAs* is

1 Arboricultural impact assessment

observed, we believe that the proposed works can be implemented without any long-term detrimental impact on tree health, and therefore local character.

Tree T4

A new extension on the western end of the existing building will encroach into the outer extents of its nominal circular RPA. It is proposed to build the extension on piles with the underside of the supported base above the existing ground level, which means that it can be built without any significant excavation into the soil and RPA beneath. This is shown by the yellow highlighting on the plan. This construction solution is within the advice set out in BS 5837 (7.2 and 7.5) and would be appropriate in this situation. It is unlikely that this encroachment will have any significant adverse impact on the trees because it is only a very small proportion of its RPA compared to the area that will remain undisturbed.

In summary, if the guidance set out in SGN 3 *Ground protection*, SGN 7 *Excavating in RPAs*, and SGN 10 *Installing structures in RPAs* is followed, we believe that the proposed works can be implemented without any long-term detrimental impact on the health of this tree, and therefore local character.

1.6 New planting

To supplement retained trees and enhance local character, a new hawthorn hedge is to be planted on the roadside boundary. This is indicated on the tree protection plan, and will comprise of a new hedge of 60-90 cm whips, slit planted by hand using a spade. No rotavation or cultivation of the soil is required. All new planting is open to amendment, as appropriate, in response to a landscaping planning condition.

1.7 Post development considerations

We have considered the matters of overbearing relationships and daylight, and concluded that there are no trees close enough to the house and their associated amenity space that are likely to interfere with their normal use any more than the current situation.

1.8 Unanticipated upgrading of existing services or installation of new services

Retained trees may be adversely affected by the installation of new services and / or the upgrading of existing services if that work encroaches into their RPAs. However, it is often difficult to know the detail of service locations until the construction is in progress, and sometimes encroachment into RPAs is unavoidable. We have shown where the anticipated service routes for foul and mains water are to be located on the plan, and they are not within RPA.

Where possible, the default approach must be to use any existing service runs and keep all new services outside RPAs.

Where existing services within RPAs require upgrading, or new services must be installed in RPAs, great care must be taken to minimise any disturbance. Trenchless installation will be the preferred option, but if that is not feasible, any excavation must be carried out by hand according to the guidelines in SGN 11 *Installing services in RPAs*.



1 Arboricultural impact assessment

1.9 Summary of impact on local character

All of the significant boundary tree cover is being retained, and there will be no trees lost as a result of this proposal. The construction activity has the potential to adversely affect retained trees if proper protective measures are not taken. However, if adequate precautions to protect the retained trees are specified and implemented through the arboricultural method statement included in this report, the development proposal will have no detrimental impact on the contribution of trees to local character.

For these reasons, we conclude that the proposed development would not cause an unacceptable or adverse impact on the character and appearance of the area from a tree perspective.

2 Arboricultural method statement

2.1 Site Guidance Notes (SGNs)

This section of the report identifies which trees on this site will be protected and managed, and by what means. This site-specific summary is supplemented by more detailed explanations and descriptions of specific operations set out in the accompanying *Manual for managing trees on development sites*. That document is a compilation of 12 individual SGNs addressing the following tree protection and management issues that regularly arise in the construction phase of development:

- SGN 1 *Monitoring tree protection* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-1-Monitoring-V3.pdf>)
- SGN 2 *Fencing protected trees* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-2-Fencing-V3.pdf>)
- SGN 3 *Ground protection* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-3-Ground-Protection-V3.pdf>)
- SGN 4 *Pollution control* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-4-Pollution-V3.pdf>)
- SGN 5 *Site cranes & piling rigs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-5-Cranes-Rigs-V3.pdf>)
- SGN 6 *Height restrictions* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-6-Height-V3.pdf>)
- SGN 7 *Excavating in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-7-Excavation-in-RPAs-V3.pdf>)
- SGN 8 *Removing surfacing and structures in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-8-Removing-Surfaces-V3.pdf>)
- SGN 9 *Installing/upgrading surfacing in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-9-Installing-Surfacing-V3.pdf>)
- SGN 10 *Installing structures in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-10-Structures-V3.pdf>)
- SGN 11 *Installing services in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-11-Services-V3.pdf>)
- SGN 12 *Landscaping in RPAs* (<https://www.barrelltreecare.co.uk/assets/Uploads/SGN-12-Landscaping-V3.pdf>)

NOTE: Each individual SGN can be downloaded by using the links above and the QR Code links in Appendix 3.

2.2 Identification of areas to be protected

The tree protection plan shows the areas where protective measures are necessary. The fencing location is shown by the heavy black dashed lines, with the construction exclusion zone behind as the lighter black diagonal hatch. Precautionary areas are shown by a yellow fill and new temporary ground protection is shown by a blue fill.

2.3 Arboricultural supervision

An arboricultural consultant will be appointed to advise on the tree management for the site and to attend:

- a pre-commencement meeting before any work starts;

2 Arboricultural method statement

- regular supervision visits to oversee the agreed tree protection, as agreed at the pre-commencement meeting; and
- further supervision visits, as necessary, to oversee any unexpected works that could affect trees.

The detail of how the arboricultural supervision will be carried out is explained in SGN 1 *Monitoring tree protection* in the accompanying Manual.

2.4 Table 2: Summary of the site operations requiring arboricultural input

For this site, arboricultural input will be needed for the following operations:

Brief operation summary	Trees affected	Location of detailed explanations
Pre-commencement meeting: Meeting on site with all parties to agree protective measures, as described in SGN 1. <u>Will be carried out before any significant site works begin.</u>	All retained trees	SGN 1 <i>Monitoring tree protection</i>
Installing fencing and ground protection: Agreed tree protection measures will be installed and checked, as described in SGN 2 and SGN 3. <u>Will be completed before any significant site works begin.</u>	Fencing all retained trees Ground protection for tree T4, and container next to T2, T3 and T19	Tree protection plan, SGN 2 <i>Fencing protected trees</i> , and SGN 3 <i>Ground protection</i>
Pollution control near retained trees: Any pollution control measures identified during risk assessment will be installed as described in SGN 4. <u>Will be completed before any potential pollutants arrive on site.</u>	All retained trees	SGN 4 <i>Pollution control</i>
Regular arboricultural supervision: Provision will be made to carry out and record agreed arboricultural supervision, as described in SGN 1.	All retained trees	SGN 1 <i>Monitoring tree protection</i>
Excavating in RPAs: These operations will be carried out as described in SGN 7.	T4	SGN 7 <i>Excavating in RPAs</i>
Installing/upgrading surfacing in RPAs: These operations will be carried out as described in the SGN 9.	T1, T2, T3, T14, T19	SGN 9 <i>Installing/upgrading surfacing in RPAs</i>
Installing structures in RPAs: These operations will be carried out as described in SGN 10.	T4	SGN 10 <i>Installing structures in RPAs</i>
Installing services in RPAs: These operations will be carried out as described in SGN 11.	All retained trees	SGN 11 <i>Installing services in RPAs</i>
Landscaping in RPAs: These operations will be carried out as described in SGN 12.	All retained trees	SGN 12 <i>Landscaping in RPAs</i>
Removing tree protection: <u>Protection can only be removed when there is no risk of damage to retained trees, as described in SGN 1.</u>	All retained trees	SGN 1 <i>Monitoring tree protection</i>

The operations summarised in this table, and supplemented by the more detailed explanations set out in the SGNs and the rest of this document, form the arboricultural method statement for this site. The Site Manager will ensure that its details and any agreed amendments are known and understood by all site personnel. Copies of the agreed documents will be available on site. All

2 Arboricultural method statement

personnel who could have an impact on trees will be briefed on the specific tree protection requirements as part of the site induction procedures. This requirement will be written into the site management documentation.

If unanticipated issues arise on site requiring work approved by the LPA, but not referenced in the above explanations, for example the unexpected need to install services in RPAs, or landscaping in RPAs, further guidance on how to manage them can be found in the accompanying Manual.

2.5 Construction method statement (heads of terms summary)

A construction method statement is a description of how operations that may affect trees will be carried out to minimise any adverse impact on them. The details of how the site will be managed are construction and contractual matters that can only be finalised once the post-consent detailed planning begins. For that reason, at this stage in the planning process, as explained in clause 5.5.6 of BS 5837, it is normally sufficient to list a heads of terms summary of the issues requiring more detailed consideration once consent is issued. On this site, those issues are likely to include:

1. Preparation of a written site management protocol for dealing with tree issues, to be incorporated into formal site management procedures, and to specifically include induction training for all operatives related to tree protection.
2. The order of work on site, including the installation of protective measures, the phasing of successive work locations, the removal of existing structures/surfacing, the installation of new structures/surfacing, the removal of tree protection, and any necessary reinstatement.
3. Erection and maintenance of tree protection measures.
4. Who will be responsible for protecting the trees on site.
5. Detailed proposals for inspecting and supervising the tree protection.
6. How accidents and emergencies involving trees will be managed, including accidental damage to roots and their treatment.
7. Details of facilitation pruning and access into site. What size vehicles will be used under canopies and will large machinery be lifted over trees.
8. The parking arrangements for workers and visitors.
9. A schedule of emergency contact numbers relating to trees.
10. Areas for loading and unloading of materials and storage of materials and plant.
11. Where site facilities will be located and when will they be installed.
12. How machinery and equipment (such as excavators, cranes and their loads, concrete pumps and piling rigs) will enter, move on, work on, and leave the site.
13. Pollution control to specifically consider chemical storage and wheel washing facilities in relation to trees.
14. Recycling and storage of waste in relation to trees.
15. Details of earthworks, grading and mounding and removal of spoil, including any planned lowering or raising of ground levels.
16. Precise services locations, including the method of excavation when near trees.
17. Details of upgrading/removing/replacing existing surfacing and areas where this will happen, including detailed and precise cross-sections where no-dig surfacing is to be installed.
18. Details of custom designed foundations.
19. How post-construction impacts through compaction to soil near trees will be ameliorated.

Appendix 1: Background administrative information and data collection

A1.1 Table 3: Background administrative information

	Background administrative information
Report date & reference	31 st October 2024; 23116-AA6-CA
Tree protection plan reference	23116-6
Instructing client	Harefield Property Improvements
Instructions	Visit the site, assess the relevant trees, prepare a schedule of their details, describe the impact of the proposal on those trees and identify the tree protection issues in an arboricultural method statement with a tree protection plan.
Provided documents	- Topographical survey, drawing reference 003, received by email on 25th August 2023 - Layout, drawing reference 01A, received by email on 27th March 2024 - Drainage drawing reference, Working Drawing-412A Finchampstead Road-Site Plan.dwg, received by email on 30th July 2024
Report author and credentials	Chris Alder is a Chartered Forester (www.charteredforesters.org), and a Fellow and Registered Consultant of the Arboricultural Association (www.trees.org.uk), and is fully qualified to undertake the assessments in this report (https://www.barrelltreecare.co.uk/who-we-are/).
Report limitations	This report does not consider ecological or archaeological issues, or any other matter beyond the assessment of the trees.
Technical references	In preparing the analysis in this report, we considered the guidance and advice in the following technical references: - Climate Change Act (2008) www.legislation.gov.uk/ukpga/2008/27/contents - Town and Country Planning Act 1990 www.legislation.gov.uk/ukpga/1990/8/contents - National Planning Policy Framework, published by the MHCLG www.gov.uk/government/publications/national-planning-policy-framework--2 - BS 5837 (2012) <i>Trees in relation to design, demolition and construction – Recommendations</i>, https://shop.bsigroup.com/ProductDetail?pid=000000000030213642 - BS 8545 (2014) <i>Trees: from nursery to independence in the landscape – Recommendations</i>, https://shop.bsigroup.com/ProductDetail?pid=000000000030219672 - BS 3998 (2010) <i>Tree work – Recommendations</i>, BSI https://shop.bsigroup.com/ProductDetail?pid=000000000030089960 <i>Trees in the Townscape: A Guide for Decision Makers</i>, published by the Trees & Design Action Group http://www.tdag.org.uk/ <i>Trees in Hard Landscapes: A Guide for Delivery</i>, published by the Trees & Design Action Group www.tdag.org.uk/ - National Joint Utilities Group (2007) Volume 4, Issue 2: <i>Guidelines for the planning, installation and maintenance of utility apparatus in proximity to trees</i> http://streetworks.org.uk/wp-content/uploads/2016/09/V4-Trees-Issue-2-16-11-2007.pdf
BS 5837 compliance	This report is BS 5837 compliant. BS 5837 (2012) <i>Trees in relation to design, demolition and construction – Recommendations</i> is 10 years old. Since its publication, there have been significant advancements in technology and thinking, informed by a decade

Appendix 1: Background administrative information and data collection

	Background administrative information
	of practical experience of putting principles into practice. In the document Foreword, it states: <i>“Any user claiming compliance with this British Standard is expected to be able to justify any course of action that deviates from its recommendations”</i>. This statement provides the opportunity for practitioners to claim compliance while moving best practice forward in the context of emerging technology, ideas, and experience. Although much of the BS 5837 content remains relevant and useful for managing trees in a planning context, there are now several aspects that are dated, and it is no longer appropriate to rigidly apply them to current planning submissions. Barrell Tree Consultancy (BTC) specialises in managing trees on development sites and retains a complete paper archive of every project it has carried out since starting business in 1980, with a digital data base listing those from 2004. In the decade since BS 5837 was published (April 2012), interrogation of the BTC archive confirms that we have been involved in a total of 3,884 projects, of which we estimate that about 3,845 were development related, and it is that depth of experience that informs the following statements on BS 5837 compliance. All BTC reports are prepared to be BS 5837 compliant and, although explanations are not explicitly required to claim compliance, the justifications for any deviations from its recommendations are set out below, referenced by the BS clause number: 1. 4.3 – soil assessment: All BTC consultants have basic training relating to soil assessment and regularly deal with soil issues during their daily work, but none are soil specialists and BTC has no specialist investigation equipment for carrying out the type of soil assessment listed in this BS clause. In a modern development context, it is not for arboricultural consultants to demand or carry out professional soil investigations, and BTC does not do that. However, we will review soil information provided from appropriate specialists, if available, and incorporate that into our assessments. 2. 4.4.2.1 – tagging trees: In some instances, it is not appropriate to tag trees, e.g., sensitive species, trees that are easily identified without a tag, inadequate access, project confidentiality, client instructions to the contrary, etc, and so although there will be a presumption to tag trees where feasible and appropriate, that may not be possible or necessary in every instance. 3. 4.4.2.5 e) – branch spread: BTC only work from provided topographical surveys and where the branch spreads are shown correctly on those surveys, there is not normally any practical need to regurgitate that information in a schedule. Additionally, in closely spaced groups or in treacherous terrain, it is sometimes not safe or realistically possible to collect this data for every tree. For these reasons, BTC normally only collects crown spread data to the four cardinal points where the provided topographical survey is assessed as unreliable, or where a full canopy cover assessment is requested, and it is both safe and practically feasible to do so. 4. 4.4.2.5 f) – branch and canopy height: In the absence of any definition of ‘canopy’ or ‘significant’ relating to branches in the <i>Terms and definitions</i> clause, and the lack of any practical guidance for reliably

Appendix 1: Background administrative information and data collection

	Background administrative information
	assessing these characteristics, BTC has adopted the following default position. We will only identify the height and orientation of branches where they have the potential to be damaged by vehicular access, i.e., below a height of 6 m, or where their removal would be beyond what the tree could tolerate during normal maintenance management, i.e., the branch removal would significantly adversely affect the health of the tree and potentially compromise its current safe useful life expectancy. 5. 4.4.2.5 g) – life stage: BS 5387 offers examples, but no definitions of what those examples mean. In the absence of a specific BS 5387 recommendation, BTC has reviewed the concept of maturity in a planning context, taking maturity to be a simplistic indication of a tree's ability to cope with change and its potential for further growth. For the purposes of development site advice, BTC conceptualises useful life-stage descriptions as; young indicating a potential to significantly increase in size and a high ability to cope with change; maturing indicating some potential to increase in size and a medium ability to cope with change; and, mature indicating little potential to increase in size and low ability to cope with change. 6. 4.4.2.5 i) – estimated remaining contribution: BTC accepts the category recommendations in Table 1 on the remaining contribution in the context of category, i.e., greater than 40 years for A trees, greater than 20 years for B trees, at least 10 years for C trees, and less than 10 years for U trees, and so this is also not listed separately in the schedule. 7. 4.5.4 – subcategories: BTC adopts a presumption that all trees are subcategory 1 (Mainly arboricultural qualities) unless noted to the contrary, and so for conciseness and to avoid complication, the subcategory is not listed in the schedule unless it is 2 or 3. 8. Table 2 and 4.4.2 – colour coding: The colours included in this table take no account of the inability of some people to distinguish between red and green, which is not helpful to people suffering with this form of colour blindness. To address this discriminatory failing with the BS approach, BTC has adopted a more intuitively obvious regime of green and blue colours, which can be easily distinguished by colour-blind people, with the best category A and B trees (High and moderate quality) being green, and the lower category C and U trees (Low quality and unsuitable for retention) as blue. The differentiation between the two categories in each colour is provided by symbols rather than using different colours. This is clearly shown on the plan key, so there can be no doubt about what category a tree is, which is an intuitive approach to avoiding discrimination of colour-blind people. In any event, the tree category is now included next to each number, so there can be no question about the category and BS 5387 compliance. 9. 5.2.1 – RPAs: This clause recommends that the RPAs for category A, B, and C trees are shown as the existing constraints on the plans used in the "<i>concept and design</i>", i.e., the tree constraints plan. However, the BS does not explicitly recommend that all those constraints are shown on

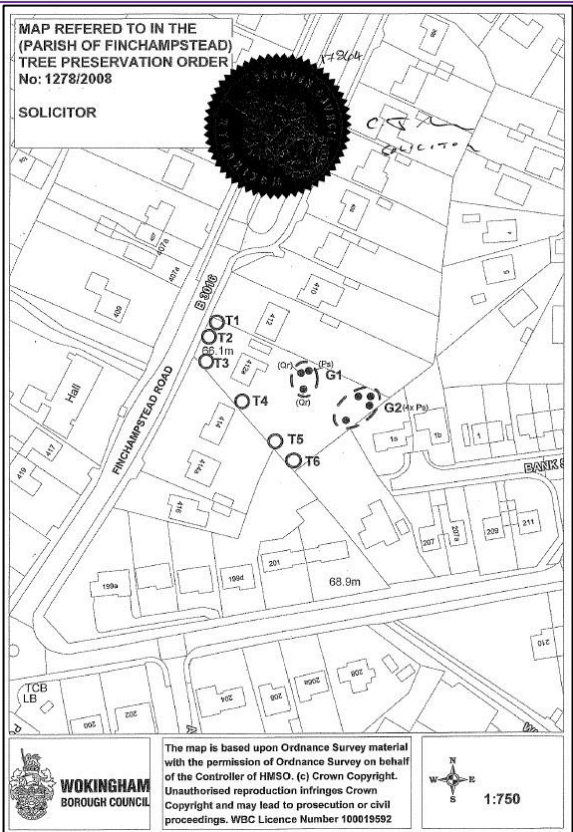
Appendix 1: Background administrative information and data collection

	Background administrative information
	the tree protection plan, which is logical because only category A (High quality), and category B (Moderate quality) trees can realistically be material constraints, with category C (Low quality) and category U (Unsuitable for retention) trees obviously unsuitable to be determinative of the final design. Although it is not a BS recommendation to include the RPAs of category C trees on the tree protection plan because they cannot be material constraints, it is sometimes helpful as an informative to be able to see them if category C are planned for retention to assess if that is feasible. For that reason, BTC tree protection plans show the RPAs of category C trees as a thin grey line rather than the thicker grey line denoting category A and B RPAs. 10. 5.2.2 Notes 1 and 2 – shading: These notes offer general information on how shading can be assessed, which is presented in italics. The implications of the convention of using italics within the BS is set out in the Foreword as: <i>“Commentary, explanation and general informative material is presented in smaller italic type, and does not constitute a normative element.”</i> Our interpretation of that statement is that the application of Notes 1 and 2 is not part of the BS recommendations, and is not necessary for BS 5837 compliance. In our experience, the assessment of daylight issues is a specialist discipline and way beyond our expertise as arboriculturists, and so we would defer to an appropriate specialist, where any detailed guidance is required.

A1.2 Table 4: Data collection

	Data collection
Date of site visit	10 th August 2023
People present during site visit	Chris Alder
Weather & visibility	Clear and dry, with good visibility
Limitations to observations	• The inspection of the trees for the purposes of assessing their condition and work requirements was made on the basis that they will be annually inspected in the future to identify any changes in condition and review the original recommendations. For these reasons, the tree assessment advice only remains valid for one year from the date that the trees were last inspected. • All observations were of a preliminary nature and did not involve any climbing or detailed investigation beyond what was visible from accessible points at ground level. • Observations of trees outside the site boundaries are confined to what was visible from within the site. • All dimensions were estimated unless otherwise indicated.
Statutory protection through Tree Preservation Orders and Conservation Areas	There is a TPO (ref: 1278/2008) made by Wokingham Borough Council which covers a number of the trees. The TPO reference numbers are included in the tree schedule at appendix 2. An extract from the TPO plan is included below.

Appendix 1: Background administrative information and data collection

	Data collection
Tree location and numbering	 TPO Plan extract
Crown spreads	Each tree, and group was inspected, and the numbering scheme is shown on the tree protection plan. Where significant trees were found on site that were not included on the provided land survey, their approximate positions are illustrated as a brown dot on the tree protection plan. Crown radial spreads were estimated to the nearest metre and represent our assessment of the viable crown dimensions that would be retainable after normal management. For clarification, the viable crown spread is the size of the main body of the crown, and not necessarily the furthest extent of odd branches that extend out beyond this core of the crown.
Recording of tree data	For each identified tree, and group the information collected was recorded on the tree schedule in Appendix 2 and the tree protection plan.
Calculation of RPAs	The RPAs were calculated as recommended in BS 5837, and the nominal RPA radius for each tree is listed in the tree schedule in Appendix 2. Where appropriate, RPAs for trees on the site were adjusted as recommended in BS 5837 and illustrated on the plan.



Appendix 2: Tree schedule and explanatory notes

NOTE: Colour annotation is A & B trees with green background; C & U trees with blue background; trees to be removed in red text.

Tree No	Species	Height (m)	Diameter (cm) @ 1.5 m	Maturity	Low Branches	Category	Notes	Tree Works	RPA Radius (m)
All retained trees & hedges								Carry out safety check and lift over site to 3-4 m as necessary.	
T1	Oak	16	70*	Mature		B	TPO T1. Leaning to east, minor deadwood, partially failed secondary stem		8.4
T2	Turkey oak	22	75*	Mature		B	Previously topped at 8 m, three stems, sparse crown		9
T3	Oak	18	77.5*	Mature		B	TPO T3. Previously topped at 8 m, multiple ascending stems		9.3
T4	Oak	20	95	Mature		B	TPO T4. Hollowing stem, bulge at 1 m, previously topped at 6 m, multiple ascending stems, ivy clad		11.4
T5	Oak	20	102.5*	Mature		B	TPO T5. Multiple stems from 8 m		12.3
T6	Oak	17	85*	Mature		B	TPO T6. One sided, suppressed by T5		10.2
T7	Scots Pine	16	60*	Mature		B	Part of TPO G2. Co dominant stem at 10 m		7.2
T8	Scots Pine	15	55*	Mature		B	Part of TPO G2. One sided crown		6.6
T9	Scots Pine	15	50*	Mature		B	Part of TPO G2. One sided crown		6
T10	Scots Pine	17	85*	Mature		B	Part of TPO G2. Ivy clad, deadwood		10.2
T11	Oak	20	77.5*	Mature		A	Part of TPO G1.		9.3
T12	Oak	20	65*	Mature		B	Part of TPO G1. One sided due to competition		7.8



Appendix 2: Tree schedule and explanatory notes

Tree No	Species	Height (m)	Diameter (cm) @ 1.5 m	Maturity	Low Branches	Category	Notes	Tree Works	RPA Radius (m)
T13	Scots Pine	20	70*	Mature		B	Part of TPO G1. Twin stem at 3 m, leaning		8.4
T14	Beech	14	45	Mature		B	Leaning through fence, swept stem		5.4
G15	Lawson cypress	10	30	Maturing		C	Off site, Overgrown hedge		3.6
T16	Beech	8	45*	Maturing		C	Small tree previously lost top		5.4
G17	Holly	5	15	Maturing		C	Off site, small trees		1.8
T18	Cypress	8	35*	Maturing		C	Off site		4.2
T19	Oak	14	45*	Mature		B	TPO T2. One sided crown, weighted over road		5.4

Appendix 2: Tree schedule and explanatory notes

Explanatory Notes

- **Abbreviations:**

G: Group
T: Tree

- **Botanical tree names:**

Beech : *Fagus sylvatica*
Cypress : *Cupressus* sp
Holly : *Ilex aquifolium*
Lawson cypress : *Chamaecyparis lawsoniana*
Oak : *Quercus robur*
Scots pine : *Pinus sylvestris*
Turkey oak : *Quercus cerris*

- **BS 5837 (2012) compliance:** All data has been collected based on the recommendations set out in subsection 4.4 of BS 5837.
- **Tree checks and site limitations:** Each tree was subjected to a quick visual check level of inspection. Where there is restricted access to the base of a tree, its attributes are assessed from the nearest point of access. Climbing inspections are not carried out during this level of inspection and, if heavy ivy is present, tree condition is assessed from what can be seen from the ground. A separate note is recorded if further investigation may be required to clarify its status.
- **Crown spreads:** Crown radial spreads were estimated to the nearest metre and represent our assessment of the viable crown dimensions that would be retainable after normal management. For clarification, the viable crown spread is the size of the main body of the crown, and not necessarily the furthest extent of odd branches that extend out beyond this core of the crown.
- **Dimensions:** All dimensions are estimated unless otherwise indicated with an asterisk (*) after the figure.
- **Species:** Species identification is based on visual observations. Where there is some doubt over tree identity, sp is noted after the genus name to indicate that the species cannot be reliably identified at the time of the survey. Where there is more than one species in a group, only the most frequent are noted and not all the species present may be listed.
- **Height:** Height is estimated to provide a broad indication of the size of the tree.
- **Trunk diameter:** Trunk diameter is estimated or measured (with a diameter tape), at the discretion of the consultant. Estimates may be made where access is restricted, direct measurement is prevented because of ivy on the trunk, or the tree is assessed as low quality. The point of measurement and the adjustments for stem variations are as advised in Figure C1 of BS 5837. Individual diameters for multiple stems are recorded in the notes, with the calculated cumulative diameter recorded in the diameter column.
- **Maturity:** In planning context, maturity provides a simplistic indication of a tree's ability to cope with change and its potential for further growth. For the purposes of this report, young indicates a potential to significantly increase in size and a high ability to cope with change, maturing indicates some potential to increase in size and a medium ability to cope with change, and mature indicates little potential to increase in size and limited ability to cope with change.
- **Low branches:** Any low branches that would not be feasible for removal during normal management and should be considered as a design constraint are noted here and explained in the notes.
- **Category:** Our assessment automatically considered tree physiological/structural condition (BS 5837, 4.4.2.5h), and so these are not listed separately in the schedule. Additionally, the category accounts for the remaining contribution (BS 5837, 4.4.2.5i) as greater than 40 years for A trees, greater than 20 years for B trees, at least 10 years for C trees and less than 10 years for U trees, so this is also not listed separately in the schedule. Category A, B and C trees are automatically listed as sub-category 1 unless otherwise stated.
- **Notes:** Only relevant features relating to physiological or structural condition and low branches that may help clarify the categorisation are recorded. If there are no notes, then the presumption should be that no relevant features were observed.
- **RPAs:** The RPAs were calculated as recommended in BS 5837, and the nominal RPA radius for each tree listed, irrespective of any modifying factors. Where appropriate, RPAs for trees on the site may have been adjusted as recommended in BS 5837 and illustrated on the plan.



Appendix 2: Tree schedule and explanatory notes

- **Future tree safety inspections:** Due to the time that may elapse between the original survey and the start of development, all trees should be re-inspected as part of the standard risk management process before any works start on site. Our assessment of the trees was carried out on the basis that a re-inspection would be carried out within a year of the assessment visit and our advice on tree condition must be reviewed annually from the date of that visit.

Appendix 3: QR Codes for SGNs (Scan with reader to download)

		
SGN 1 <i>Monitoring tree protection</i>	SGN 2 <i>Fencing protected trees</i>	SGN 3 <i>Ground protection</i>
		
SGN 4 <i>Pollution control</i>	SGN 5 <i>Site cranes & piling rigs</i>	SGN 6 <i>Height restrictions</i>
		
SGN 7 <i>Excavating in RPAs</i>	SGN 8 <i>Removing surfacing and structures in RPAs</i>	SGN 9 <i>Installing/upgrading surfacing in RPAs</i>
		
SGN 10 <i>Installing structures in RPAs</i>	SGN 11 <i>Installing services in RPAs</i>	SGN 12 <i>Landscaping in RPAs</i>



Field House Fordingbridge Business Park Fordingbridge Hampshire SP6 1BD
☎ 01425 651470 ✉ info@barrelltreecare.co.uk 🌐 www.barrelltreecare.co.uk