





Figure 1: Example of a protective barrier

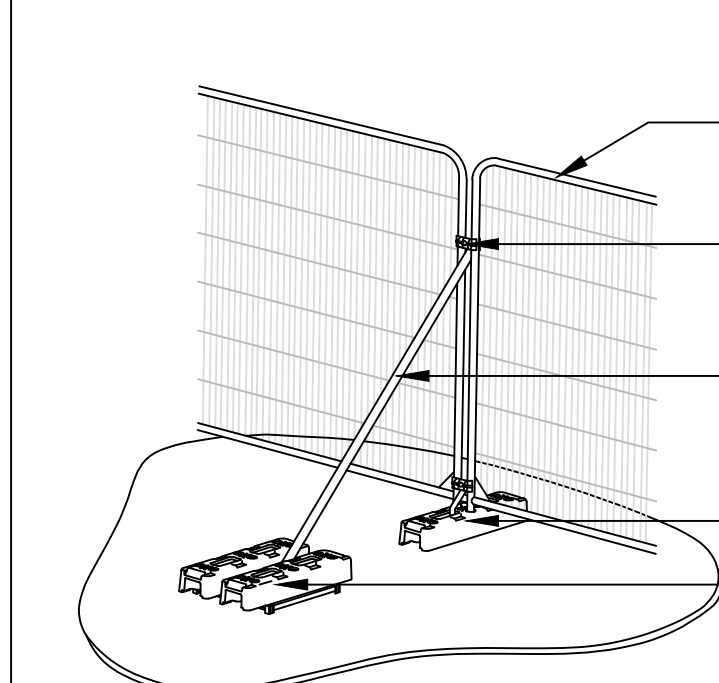


- Steel mesh panel
- Connectors fitted to secure panels
- Diagonal strut
- Block feet to avoid driven scaffold poles
- Block tray weighted with blocks

© Keen Consultants

Figure 2: Typical ground protection detail

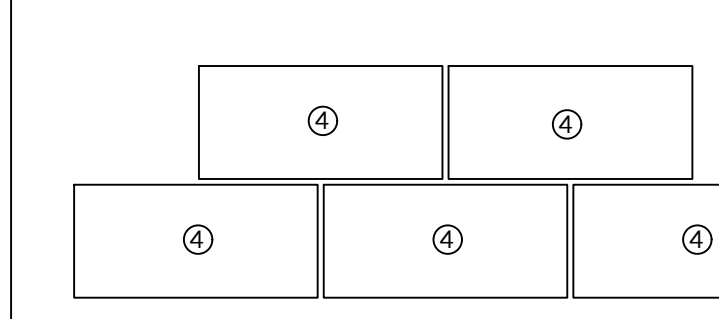

Section of ground protection detail

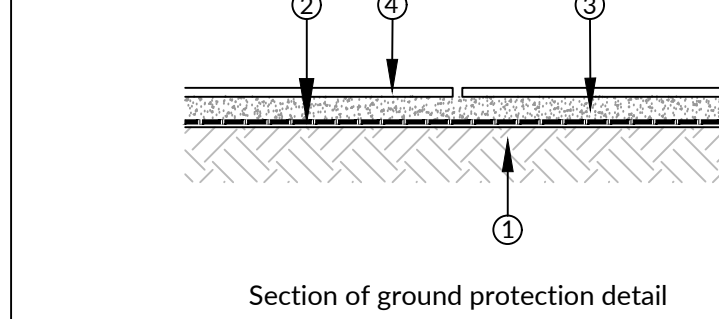

- Existing ground
- Geotextile membrane e.g. Terram 1000 or similar
- Compression-resistant layer (e.g. 100mm depth of woodchip)
- Robust sheets (timber, steel, recycled plastic) overlying Terram 1000 or similar
- 2.0m high barrier as detail in Figure 1 (Temporary, for the duration of works)

© Keen Consultants

- KEY
- Existing site features
 - Proposed layout
 - Trees retained (Green-coloured line indicates extent of canopy)
 - Trees for removal (Red-coloured dash line indicates extent of canopy)
 - 2.0m high barrier as detail in Figure 1 (Temporary, for the duration of works)
 - Area of ground protection as detail in Figure 2
 - Tree Preservation Order (TPO) woodland
 - Tree Preservation Order (TPO) area
 - Tree Preservation Order (TPO) group
 - Veteran trees
 - Natural England's recommended 15m stem diameter buffer
 - Minimum intervention zone to allow area around 'veteran' tree to naturalise
 - Ancient and Semi-Natural Woodland
 - 15m buffer to Ancient Woodland

Rev	Description	Date
A	Latest layout overlay	24.04.26
0	Preliminary issue	12.01.26

The Studio, Timbers,
Gables Road, Church Crookham
Fleet, Hampshire
GU12 6QY
T 01252 855094
mail@keenconsultants.co.uk
keenconsultants.co.uk

Client
TAYLOR WIMPEY WEST LONDON

Project
PHASE 1, LAND OFF WATMORE LANE,
WINNERSH

Title
TREE PROTECTION PLAN


Date
JAN 2026

Scale
1:500@A0

Drawn by
ML

Checked by
JTK

Drawing Number
1894-KC-PH1-YTREE-TPP02RevA

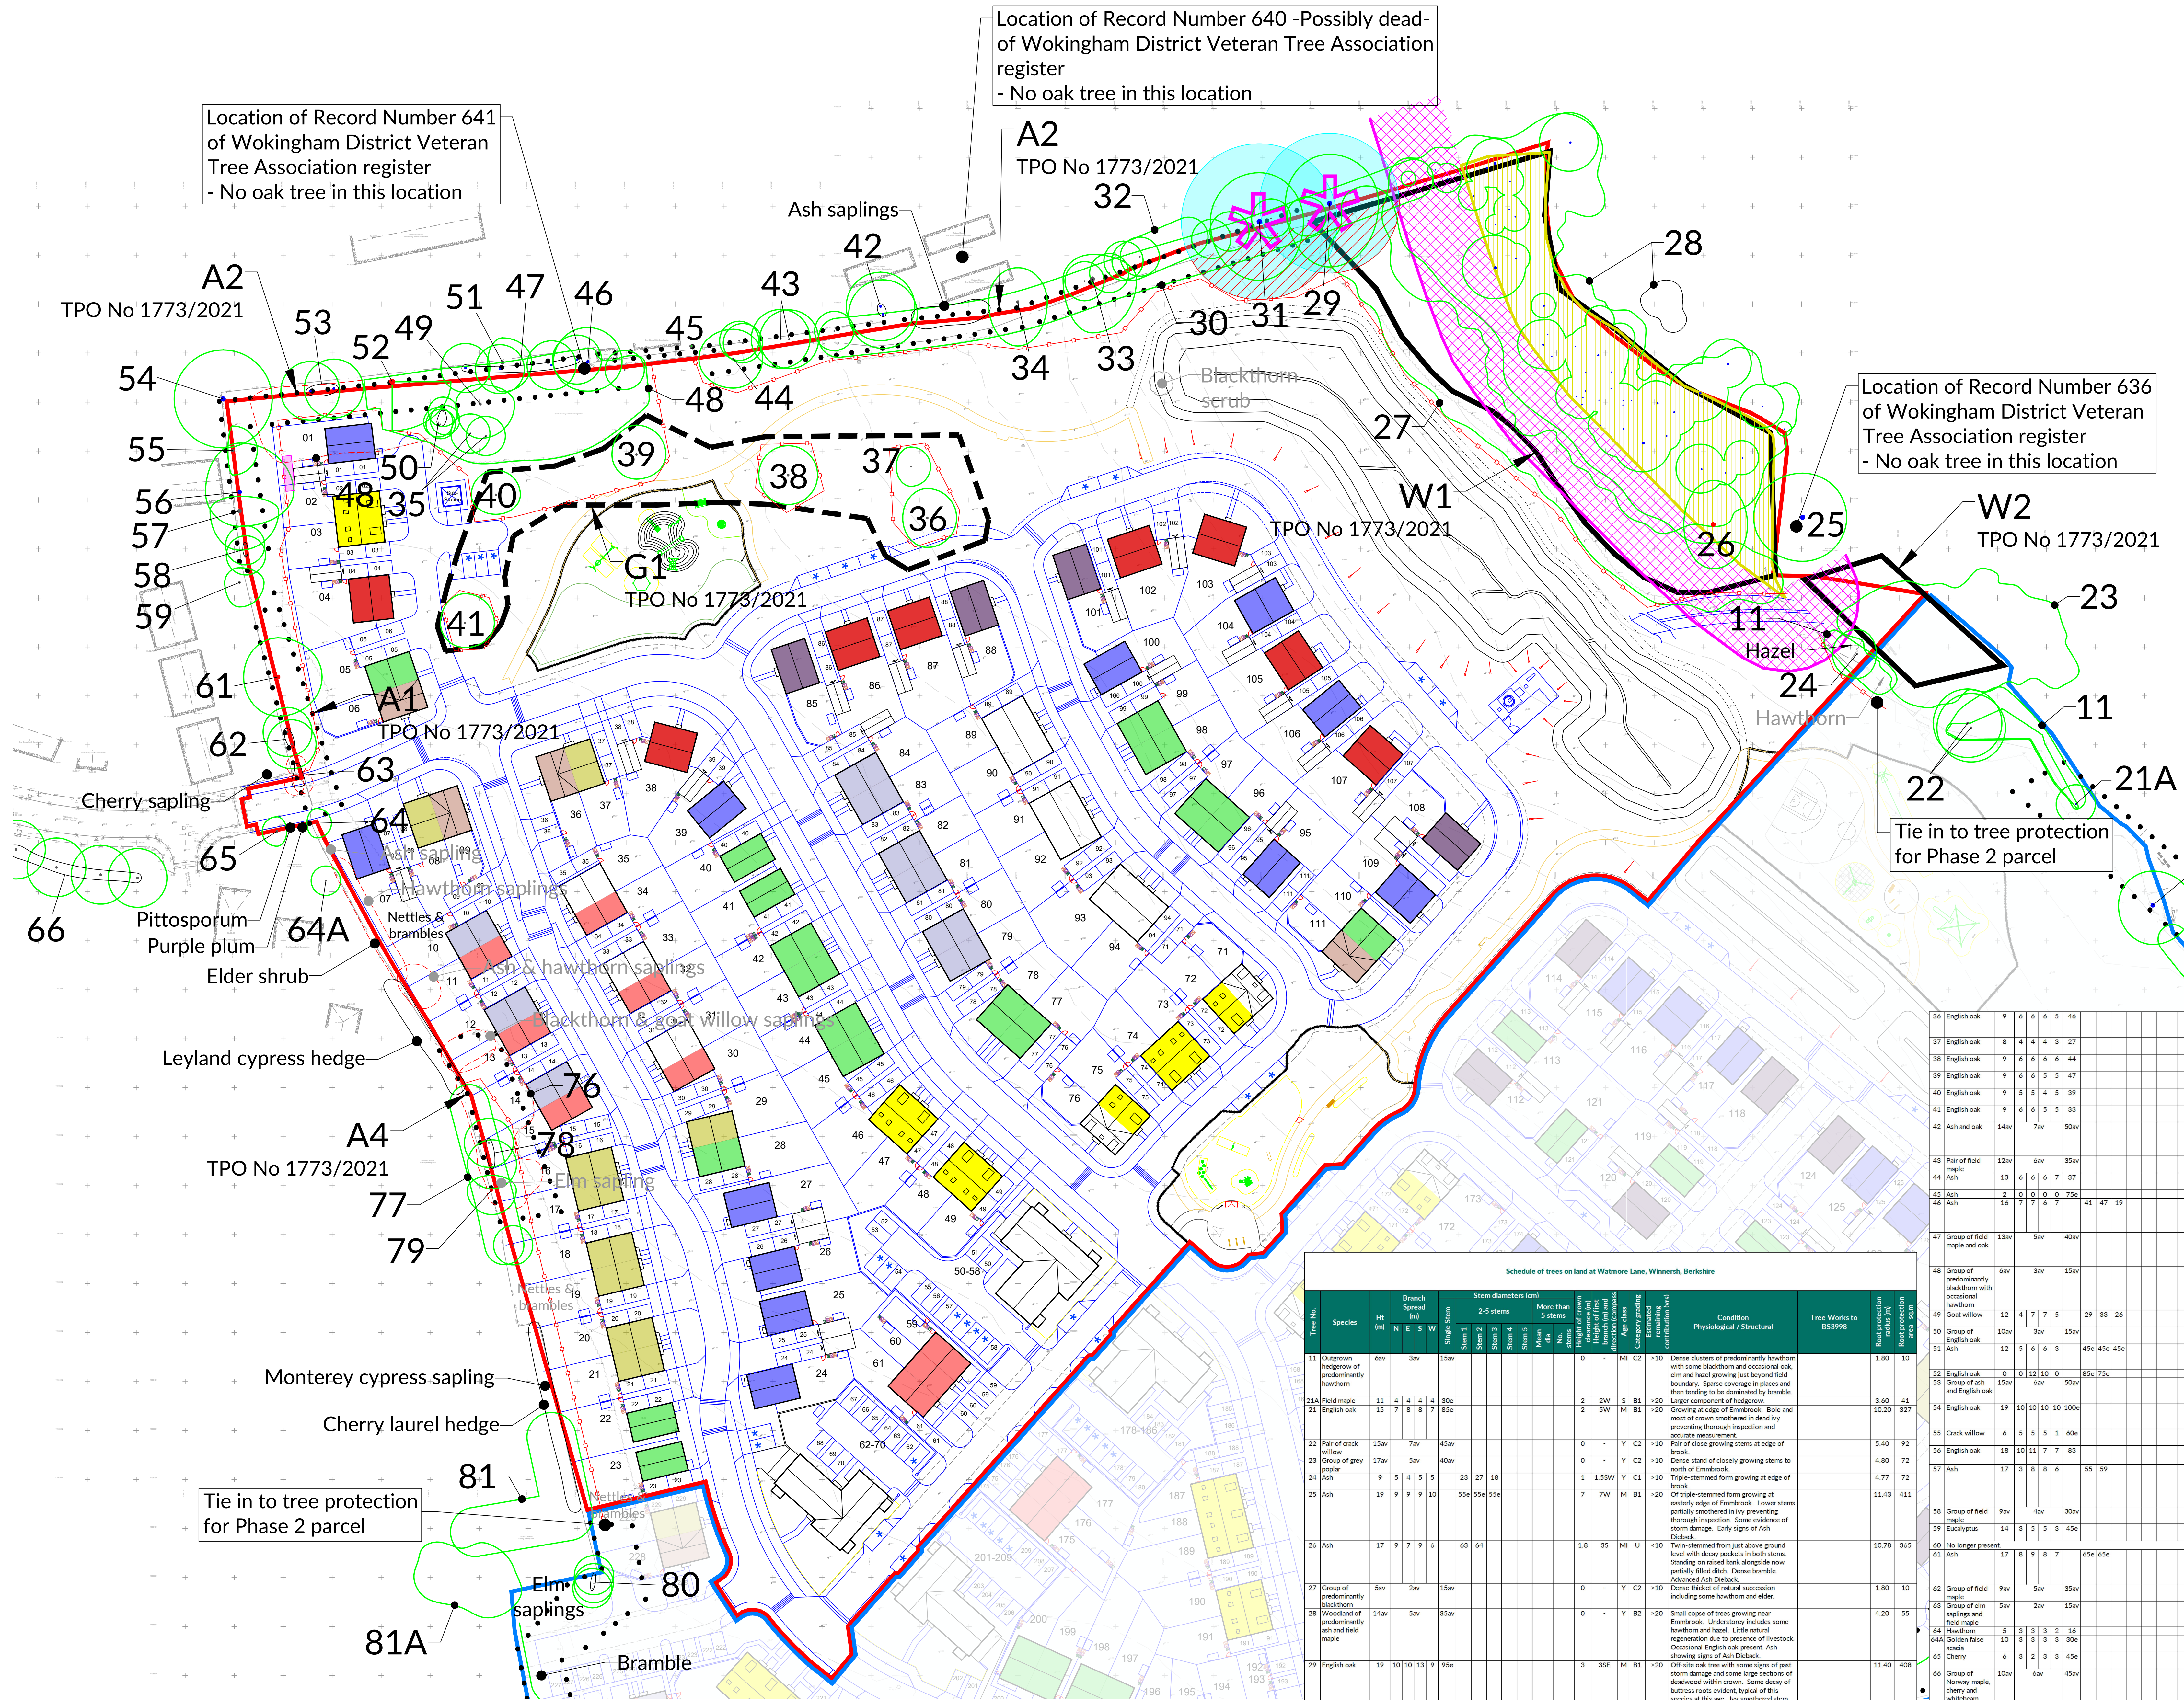

Schedule of trees on land at Watmore Lane, Winnersh, Berkshire																					
Tree No.	Species	Ht (m)	Branch spread (m)				Single Stem	Stem diameters (cm)					Height of crown (m)	Height of first major branch (m)	Age class	Category grading	Condition	Physiological / Structural	Tree Works to BS3998	Root protection radius (m)	Reason for work
			N	E	S	W		Stem1	Stem2	Stem3	Stem4	Stem5									
11	Outgrowth of hedgehog of predominantly hawthorn	6m					15m						0	-	M1	C2	>10	Dense clusters of predominantly hawthorn with some blackthorn and occasional oak, elm and holly growing just beyond field boundary. Sparse coverage in places and then tending to be dominated by brambles. Larger component of hedgehog.	3.60	41	10.20
21	Field maple	11	4	4	4	4	30e						2	2W	S	B1	>20	Dense stand of closely growing stems to north of Elm Ditch.	4.80	72	
22	Pair of crack willow	15m					7m						0	-	Y	C2	>10	Pair of close growing stems at edge of brook.	5.40	92	
23	Group of grey poplar	17m					5m						0	-	Y	C2	>10	Dense stand of closely growing stems to north of Elm Ditch.	4.77	72	
24	Ash	9	5	4	5	5	23	27	18			1	1.55W	Y	C1	>10	Triple-stemmed form growing at edge of brook.	11.43	411		
25	Ash	19	9	9	10	10	55e	55e	55e			7	7W	M1	B1	>10	Off triple-stemmed form growing at outer edge of Elm Ditch. Lower stems partially smothered in ivy preventing thorough inspection. Some evidence of storm damage. Early signs of Ash Dieback.	10.78	365		
26	Ash	17	9	7	9	6	63	64				1.8	35	M1	U	>10	Two-stemmed form just above ground level with decay pockets in both stems. Standing on raised bank alongside road partially filled ditch. Dense brambles. Advanced Ash Dieback.	1.80	10		
27	Group of predominantly blackthorn	5m					2m					0	-	Y	C2	>10	Dense thicket of natural succession including some hawthorn and elder.	4.20	55		
28	Woodland of predominantly ash and field maple	14m					35m					0	-	Y	B2	>10	Small copse of trees growing near Elm Brook. Understorey includes some Hawthorn and holly. Little natural regeneration due to presence of livestock. Occasional English oak present. Ash showing signs of Ash Dieback.	1.92	12		
29	English oak	19	10	10	13	9	95e					3	35E	M1	B1	>10	Off-site oak tree with some signs of past storm damage and some large sections of deadwood within crown. Some decay of buttress roots evident. Natural species at this age. Ivy smothered stem.	11.40	408		
30	Hedgehog of predominantly ash and hawthorn	8m					4m					2	25	M1	C2	>10	Outgrowth hedgehog, sparse in places. Some larger trees, as identified on survey plan, that include ash and field maple.	12.73	309		
32	Group of English oak	12m					4m					0	-	S	B2	>10	Larger components of hedgehog. Growing on bank to north side of ditch. Lower stem has collapsed and decay is associated therewith. Stems have regrown to create level spreading form but stems are vulnerable to failure.	4.20	55		
33	Crack willow	13	5	9	11	6	95e					2	25	M1	C1	>10	Growing on bank to north side of ditch. Lower stem has collapsed and decay is associated therewith. Stems have regrown to create level spreading form but stems are vulnerable to failure.	11.40	408		
34	Ash	13	7	6	9	6	40e	35e	25e			2	35	Y	C2	>10	Multi-stemmed tree growing amidst dense brambles to north of field. Broad spreading form. Early signs of Ash Dieback.	7.05	156		
35	Pair of English oak	10m					4m					1.2	1.25	Y	C2	>10	Pair of trees growing at edge of field. Neither tree of any particular merit.	3.60	41		