

Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

BS 5837:2012 TREE SURVEY FOR MARRON REMISE WARGRAVE



**Prepared on behalf of:
Beechwood Tree Care Ltd
2 Playhatch Farm Cottages
Playhatch
Reading
RG4 9QX**

Ref: PB/5837-25/06.11

24 June 2025



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

Bramley House
Newnham Bridge
Tenbury Wells
Worcestershire
WR15 8NX
Tel: 0118 976 2902

CONTENTS

- Summary**
- 1. Introduction**
- 2. Scope**
- 3. Site visit and the collection of data**
- 4. Constraints**
- 5. Tree protective measures**
- 6. Survey key**
- 7. Queries**

APPENDICES

- 1. Tree survey schedule**
- 2. Tree location plan**
- 3. Root protection area plan**
- 4. Shade constraints plan**
- 5. Figure 2, section 6, BS 5837:2012 (by permission)**
- 6. Tree protection fence sign**

© 2025 Tree Surveys

All rights in this report are reserved. No part of it may be reproduced, edited or transmitted, in any form or by any means, electronic, mechanical, photocopying, recording or otherwise, or stored in any retrieval system of any nature, without our written permission. Its content and format are for the exclusive use of Beechwood Tree Care Ltd and their clients/agents in dealing with this site. It may not be sold, lent, hired out or divulged to any third party not directly involved in this site without the written consent of Tree Surveys.

The statements made in this report do not take account of extremes in weather, accidental damage including fire, chemical and physical injury, or vandalism. Tree Surveys cannot therefore accept any liability in connection to these factors, or for work not carried out to current industry best practice. The validity of this report ceases at the prescribed time limit or after two years from the site inspection, or if the site conditions change due to unspecified works that affect the subject tree(s) whichever is the sooner.



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

Summary

A total of nine individual trees, two groups and two woodland groups were inspected on land at Marron Remise, Kentons Lane, Wargrave, RG10 8PD. The tree details are contained in the tree survey schedule included at Appendix 1. The trees were assessed in accordance with the cascade chart for tree quality (Table 1: Section 4) of British Standard (BS) 5837:2012. They are categorised as follows.

- Three trees and two woodland groups are in Category 'A' - "Trees of high category"
- Three trees and one group are in Category 'B' - "Trees of moderate quality".
- Three trees and one group are in Category 'C' - "Trees of low quality".

They are shown and located on the tree location plan ref PB/5837-25/06.11 included as Appendix 2.

Mitigation may be required to demonstrate how the retained trees' root protection areas (RPAs) will be protected during any development, including access to the proposed development area. The RPAs are shown on the plan included at Appendix 3.

1. Introduction

1.1 Instructions

- 1.1.1 We are instructed by Beechwood Tree Care Ltd, 2 Playhatch Farm Cottages, Playhatch, Reading, RG4 9QX on behalf of Mr F Taggart to visit land at Marron Remise, Kentons Lane, Wargrave, RG10 8PD and survey the trees implicated in a forthcoming planning application.
- 1.1.2 The trees were surveyed in accordance with 'British Standard (BS) 5837:2012' a guide for 'Trees in relation to design, demolition and construction - Recommendations' (Section 4).

1.2 Validation

- 1.2.1 This report fulfils the recommended national listed criteria for tree survey information as set out in BS 5837:2012 and includes the following:
 - A tree survey, undertaken by a qualified arboriculturist, and tree schedule, included at Appendix 1.
 - A plan at 1:200 scale with a north point, indicating the tree locations and colour coded, ref PB/5837-25/06.11 included as Appendix 2.
 - The root protection areas drawn to scale on a plan ref PB/RPA-25/06.11 included at Appendix 3.
 - The shade constraints plan, ref PB/SC-25/06.11 included at Appendix 4.
 - Default tree protection fencing from BS 5837:2012 and tree protection barrier sign included at Appendices 5 and 6.

1.3 Statutory designations

A search of Wokingham Borough Council website's 'Protected Tree Map' on 18 June 2025 confirmed that the trees within the site are protected by a Woodland Tree Preservation Order (TPO) TPO No. 0002/1951 WOODLAND 2 and that the site is not within a Conservation Area.



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

2. Scope of this report

- 2.1 The purpose of this report is to quantify the trees most likely to be impacted upon by the development proposal and to highlight how potential damage to them may be avoided.
- 2.2 The tree survey provides the basic data on the trees that may be implicated in any forthcoming planning application. It does not set out to put arguments for or against the development. It does set out how to decide upon the retention of the trees, means of protecting the retained trees during development and on means of incorporating the trees into the developed landscape, along with appropriate management and protective measures.
- 2.3 The primary purpose of this report is for the client and council to review the information provided and use it for the purpose of considering a planning application or engaging in further discussions towards the same end. The information is provided on the basis that it will be available to people other than arboriculturists i.e., those without specialist knowledge of the subject.

3. Site visit and the collection of data

3.1 Site visit

- 3.1.1 The trees were surveyed by Paul Billin BSc MICFor on 11 June 2025. The trees were inspected from ground level and without any form of detailed investigations; binoculars were used to aid the inspection process. The measurements we undertook on site were made with the aid of a rounded down diameter tape and TruPulse™ laser hypsometer. The trees were not tagged as they are easily identified on site and with reference to the attached tree location plan. The weather at the time of the inspections was sunny and clear.

3.2 The trees

- 3.2.1 We surveyed nine individual trees, two groups and two woodland groups with stem diameters of 75 millimetres and above. The tree details have been entered into a tree survey schedule included at Appendix 1.
- 3.2.2 For ease of identification the trees are shown on the tree location plan ref PB/5837-25/06.11 and have been allocated numbers. These numbers are cross-referenced within the BS 5837:2012 survey schedule.
- 3.2.3 In making the assessment, consideration has been given to:
 - The health, vigour and condition of the trees.
 - Any structural defects and safe life expectancy.
 - The size and form of the trees.
 - The rare, unusual or component part of a formal feature.
 - Groups or individual trees that provide definite screening or softening effect.
 - Trees forming distinct landscape features.



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

4. Constraints

4.1 Ecological constraints

- 4.1.1 The Conservation of Habitats and Species Regulations 2017 (as amended), and The Wildlife and Countryside Act 1981 as amended by the Countryside and Rights of Way Act 2000, provides statutory protection to birds, bats, and other tree dwelling species. They could impose significant constraints on the use and timing of any tree matters considered in this report.

4.2 Root protection areas (RPAs)

- 4.2.1 Using BS 5837:2012 the RPAs have been calculated for the trees by reference to section 4.6.1 (a) and/or (b). The RPA is frequently described as a circle with a radius of prescribed distance within which no unspecified activity should occur and a high level of care is needed during any activities that are authorised within them, if they are to be successfully retained.
- 4.2.2 Specified intrusions into the RPAs can take place only where the ground is adequately protected in accordance with the requirements of section 6 (6.2.3.3) of the BS or as may be agreed with the Local Planning Authority (LPA). The RPAs have been plotted as dodecagons or polygons taking account of the site constraints on plan ref PB/RPA-25/06.11.
- 4.2.3 The shape and position of the RPA may only be modified by an arboriculturist to meet the pre-existing site conditions or other factors that indicate that rooting has occurred asymmetrically. In all cases, we have considered the adjacent constraints including such things as the existing highway, site topography and existing buildings.

4.3 Shade constraints

- 4.3.1 Large trees that cast dense shade may result in pressure to prune or remove them. Whilst either shade or sunlight might be desirable depending on the potential use; the design should avoid unreasonable obstruction of light. The shade constraints posed by the trees are plotted onto plan ref PB/SC-25/06.11.

5. Tree protective measures

- 5.1 To protect retained trees from construction activities, notwithstanding the need for an Arboricultural Method Statement (AMS) in specific instances, the retained trees must be protected by suitable protection barriers and ground protection, the accompanying root protection area plan shows the RPAs and specific tree protection locations required prior to and during the construction activities.
- 5.2 The tree protection barrier is designed to provide construction exclusion zones around the RPAs of all trees to be retained.
- 5.3 The tree protection fencing should be fit for the purpose of excluding construction activity and appropriate to the degree and proximity of work taking place around the retained trees. The default specification for protective barriers is that specified in BS 5837:2012 Figure 2, section 6. A copy of Figure 2 is reproduced at Appendix 5. All weather signs must be attached by cable ties to each Heras panel as set out in Appendix 6.



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

6. Tree survey key

No:	Tree number on survey drawing
Species:	Common/English and or Latin name
Height:	Height in metres above ground level
Number of stems:	Single stem, or number of stems if more than one
Canopy spread:	In metres taken at the four cardinal points (N.E.S.W.)
Diameter:	In millimetres measured in accordance with BS 5837 2012

Height & direction of 1st branch: In metres and by cardinal compass points. This can be found on the detailed tree assessment

Age class:	Young
	Semi-mature
	Early-mature
	Mature
	Over-mature

Root protection area: In square metres and the nominal radius of a circle required to achieve this in metres

Health - Physiological Condition (Phy Con):	Good
	Fair
	Poor
	Decline
	Dead

Structural Condition: Crown, Stem, Basal Area:	Good
	Fair
	Poor
	Ivy

Survey Comment:
i.e. Further investigation, aerial inspection, decay detection, wildlife study

Estimated Remaining Contribution (ERC) in years:
i.e. less than 10, 10 to 20, 20 to 40, 40+

Category Grading:	Code U	Trees unsuitable for retention	RED
	Code A	High quality category	GREEN
	Code B	Moderate category	BLUE
	Code C	Low category	GREY



Tree Surveys


BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

7. Queries

Any queries regarding this tree report should be addressed in the first instance to Tree Surveys:

Tree Surveys
Bramley House
Newnham Bridge
Tenbury Wells
Worcestershire
WR15 8NX

Telephone: 0118 976 2902
Email: info@tree-surveys.com




Paul Billin, BSc, MICFor
Chartered Arboriculturist
Tree Surveys

Prepared as a PDF Binder on 24 June 2023

Revisions:

None to date

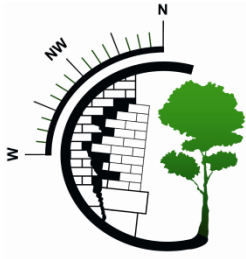

Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

APPENDIX 1

BS5837:2012 Tree Survey

Tree Surveys

Client: Beechwood Tree Care Ltd
 Project: Marron Remise
 Survey Date: 11/06/2025
 Surveyor: Paul Billin



Bramley House
 Newnham Bridge
 Tenbury Wells
 Worcestershire
 WR15 8NX
 Phone: 0118 9762 902

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
Estimated Measurements													
G31													
A Group	7	1	160	N	3	SM	A: 11.6	Fair	C: Poor	No action :: Unspecified			C
- -				E	4		R: 1.92		S: Poor	Group of multi-stemmed laurel and one leaning, poor condition beech, severe squirrel damage [Facilitation, access and construction; remove]			10 to 20 yrs
				S	3				B: Fair				
				W	3								
Estimated Measurements													
G33													
A Group	15	1	180	N	2	SM	A: 14.7	Fair	C: Fair	No action :: Unspecified			B
- -				E	1		R: 2.16		S: Fair	Group with 1no beech, 1 no ash, 3no yew, 1 holly, 1no sycamore. Av stem recorded [Facilitation felling for development]			20 to 40 yrs
				S	2				B: Fair				
				W	2								
Estimated Measurements													
W29													
A Woodland	16	1	280			M	A: 35.5	Fair	C: Fair	No action :: Unspecified			A
- <i>Spp.</i>							R: 3.36		S: Fair	Woodland, semi-mature and mature. On slope dropping away from hard surfaced drive, below driveway hedge of laurel to act as TPB			>40 yrs
									B: Fair				
Estimated Measurements													
W32													
A Woodland	16	1	250			M	A: 28.3	Fair	C: Fair	No action :: Unspecified			A
- <i>Spp.</i>							R: 3		S: Fair	Woodland, semi-mature and mature; yew, ash, holly, Field maple, sycamore. On slope rising up from driveway with sleeper edging wall, and above chalk/flint excavated retaining wall			>40 yrs
									B: Fair				
Age Classifications:	N	Newly planted	EM	Early Mature		Condition:	C	Crown		Stems:	Ø	Diameter	
	Y	Young	M	Mature			S	Stem			(Eq)	Equivalent stem diameter using BS5837:2012 definition	
	SM	Semi-mature	OM	Over Mature			B	Basal area		ERC:		Estimated Remaining Contributio	

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations			Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment			
10													
Sycamore <i>Acer pseudoplatanus</i>	20.5	1	450	N	8	3	M	A: 91.6 R: 5.39	Fair	C: Fair S: Fair B: Fair	No action :: Unspecified		A
				E	7	5					Single stem, fair form and condition. Rooting zone likely restricted on north side.		>40 yrs
				S	9	8							
				W	8	4							
23													
Common Holly <i>Ilex aquifolium</i>	7	1	140	N	2.5	1	Y	A: 8.9 R: 1.68	Fair	C: Fair S: Poor B: Fair	No action :: Unspecified		C
				E	1	1					Single stem, poor form, stem leaningband asymmetric canopy biased to west		>40 yrs
				S	1	2							
				W	3	3							
24													
Common Beech <i>Fagus sylvatica</i>	7	1	150	N	5	2	Y	A: 10.2 R: 1.8	Fair	C: Fair S: Poor B: Fair	No action :: Unspecified		C
				E	1	4					Single stem, poor form, stem leaning and asymmetric canopy biased to west		>40 yrs
				S	1	4							
				W	3.5	2.5							
25													
Common Beech <i>Fagus sylvatica</i>	9	1	210	N	6	4	Y	A: 20 R: 2.52	Fair	C: Fair S: Poor B: Fair	No action :: Unspecified		B
				E	2.5	4					Single stem, poor form, stem leaning and asymmetric canopy biased to west		>40 yrs
				S	3	4							
				W	4.5	4							
26													
Common Beech <i>Fagus sylvatica</i>	10	1	170	N	5	4	Y	A: 13.1 R: 2.04	Fair	C: Fair S: Poor B: Fair	No action :: Unspecified		B
				E	2.5	4					Single stem, poor form, stem leaning and asymmetric canopy biased to west		>40 yrs
				S	3	4							
				W	4.5	4							
27													
Common Yew <i>Taxus baccata</i>	18	2	588 (Eq)	N	8	6	M	A: 156.4 R: 7.05	Fair	C: Fair S: Fair B: Fair	No action :: Unspecified		A
				E	6	6					Co-dominant stems from union 1.4m AGL. Slight loss if needle density		>40 yrs
				S	6	7							
				W	6	5							
Age Classifications:	N Y SM	Newly planted Young Semi-mature	EM M OM	Early Mature Mature Over Mature			Condition:	C S B	Crown Stem Basal area		Stems: ERC:	Ø Diameter (Eq) Equivalent stem diameter using BS5837:2012 definition Estimated Remaining Contributio	

Report selection criteria.

Projects.

Marron Remise

Date Range.

Any Date

Work types.

----> No action :: Unspecified

Latest Survey.

All surveys for the selected trees.
---> Last survey for each selected tree.

Work Completed.

---> Work Completed
---> Work Not Completed

Number of trees in selected Project(s) 12

Number of trees in Report selection 12


Age Classifications:	N	Newly planted	EM	Early Mature	Condition:	C	Crown	Stems:	Ø	Diameter
	Y	Young	M	Mature		S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition
	SM	Semi-mature	OM	Over Mature		B	Basal area		ERC:	Estimated Remaining Contributio



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

APPENDIX 2

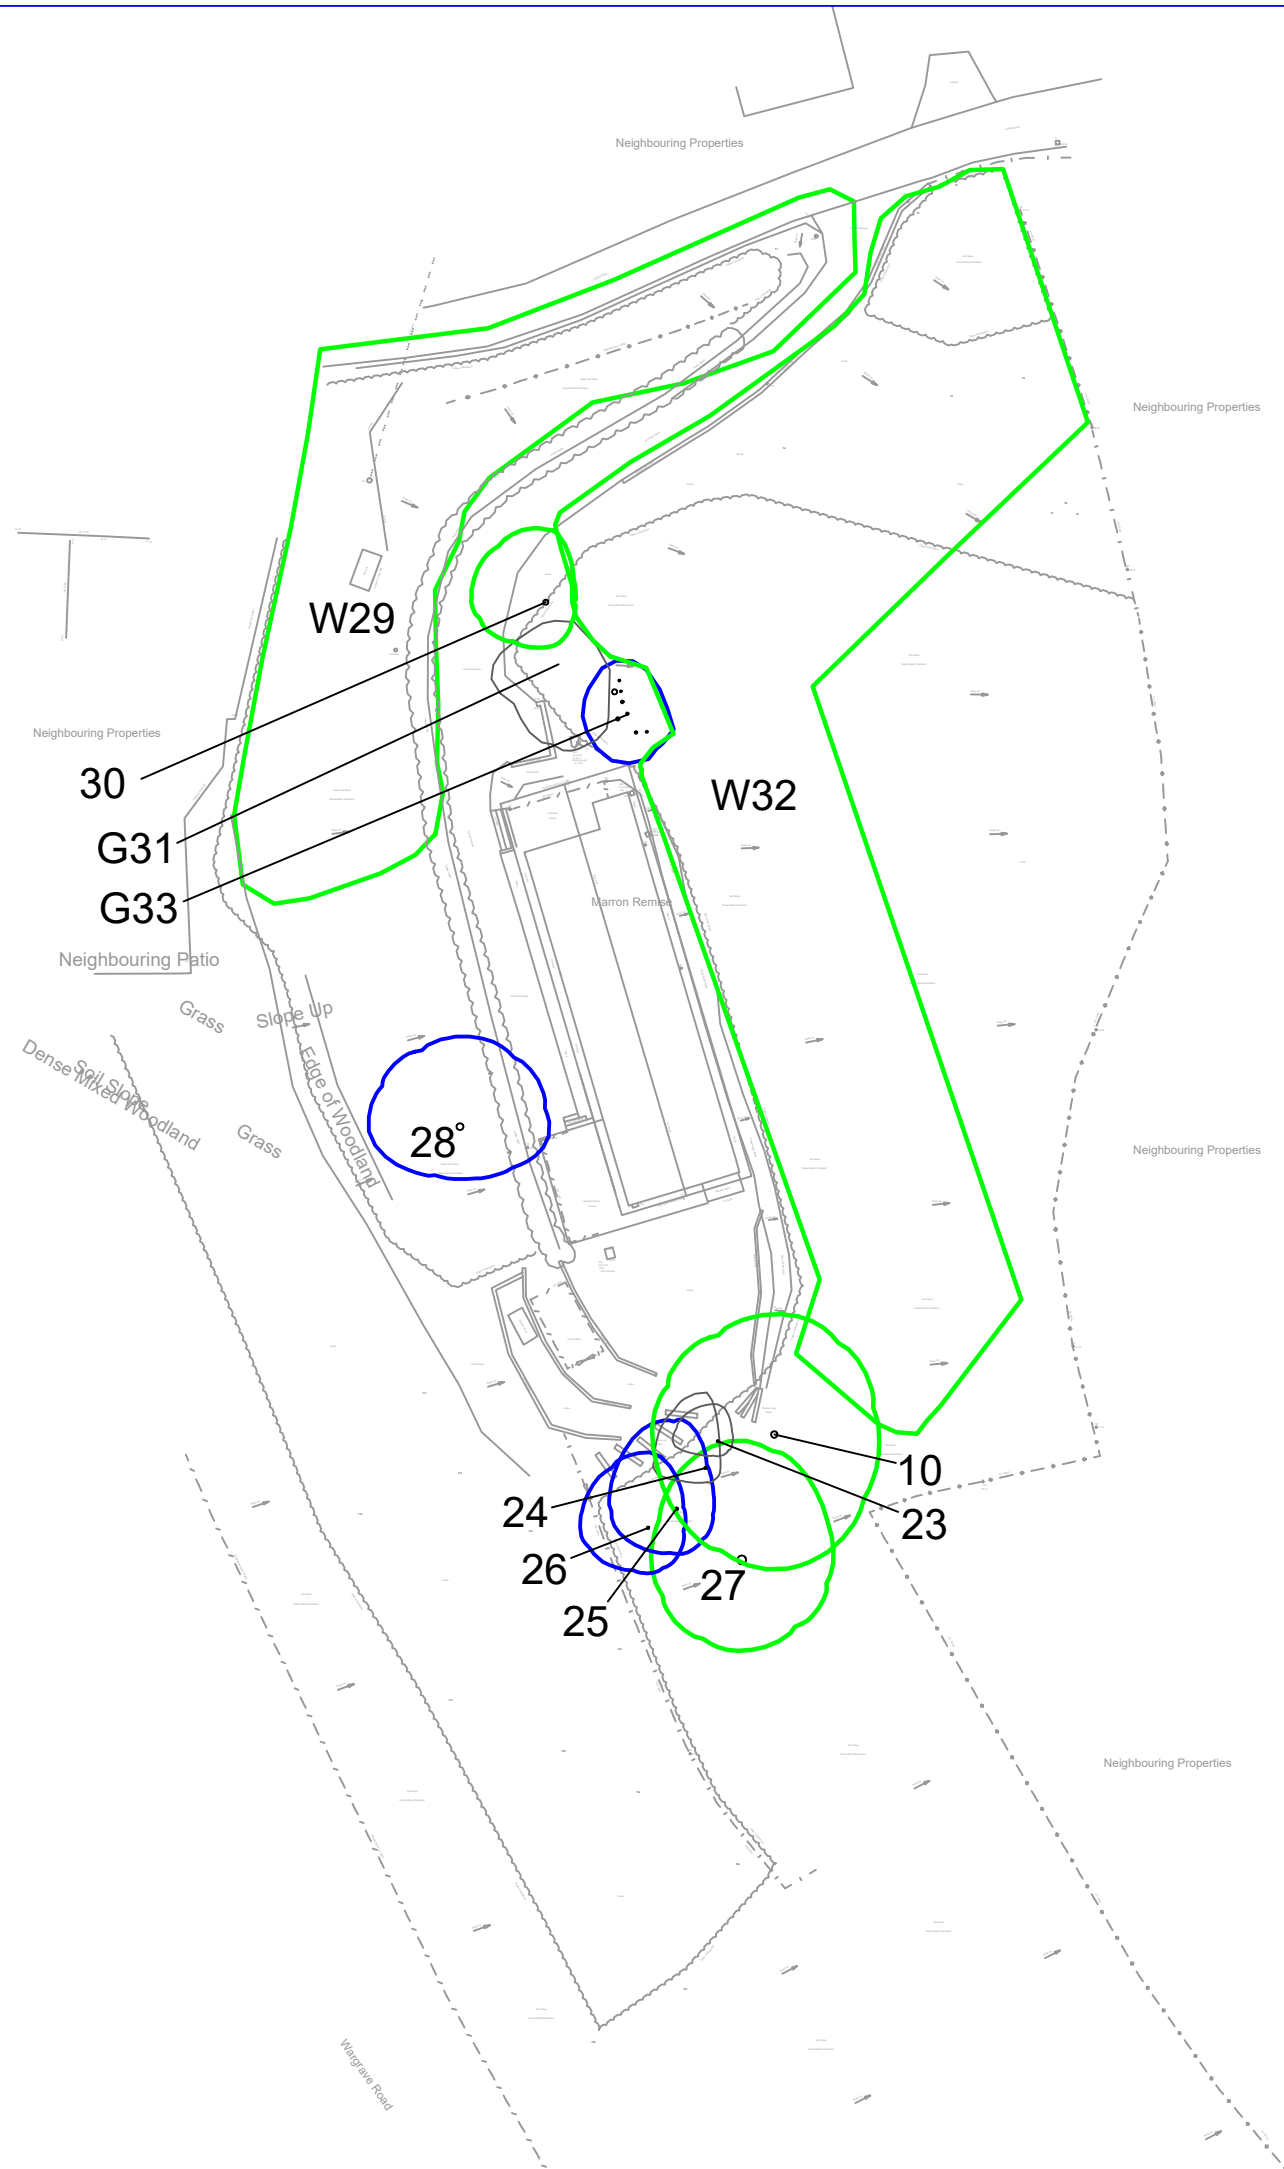


NOTES


- All dimensions must be checked on site and not scaled from this drawing.
- The original of this drawing was produced in colour, a monochrome copy should not be relied upon.
- Read drawings in conjunction with arboricultural report.
- Topo based on OS data, Licence No. 100022432.



- Key:
- Tree Category A 1,2 or 3
- trees of high quality
 - Tree Category B 1,2 or 3
- trees of moderate quality
 - Tree Category C 1,2 or 3
- trees of low quality
 - Tree Category U
- trees that cannot realistically be retained
 - Tree number
- refer to report for information
 - Existing site features



© copyright

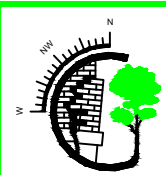

Tree Surveys

Bramley House,
Newnham Bridge,
Tenbury Wells,
Worcestershire, WR15 8NX
Tel: 0118 762902
e-mail: info@tree-surveys.com


Client	Beechwood Tree Care Ltd		
Job Title	Marron Remise, Kentons Lane, Reading		
Drawing Title	TREE LOCATION PLAN		
Scale	1:500 @ A3		
Date	June 2025	Drawn: MjE	Checked: PB
Drg. No.	PB/5837-25/06.11	Rev.	



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

APPENDIX 3

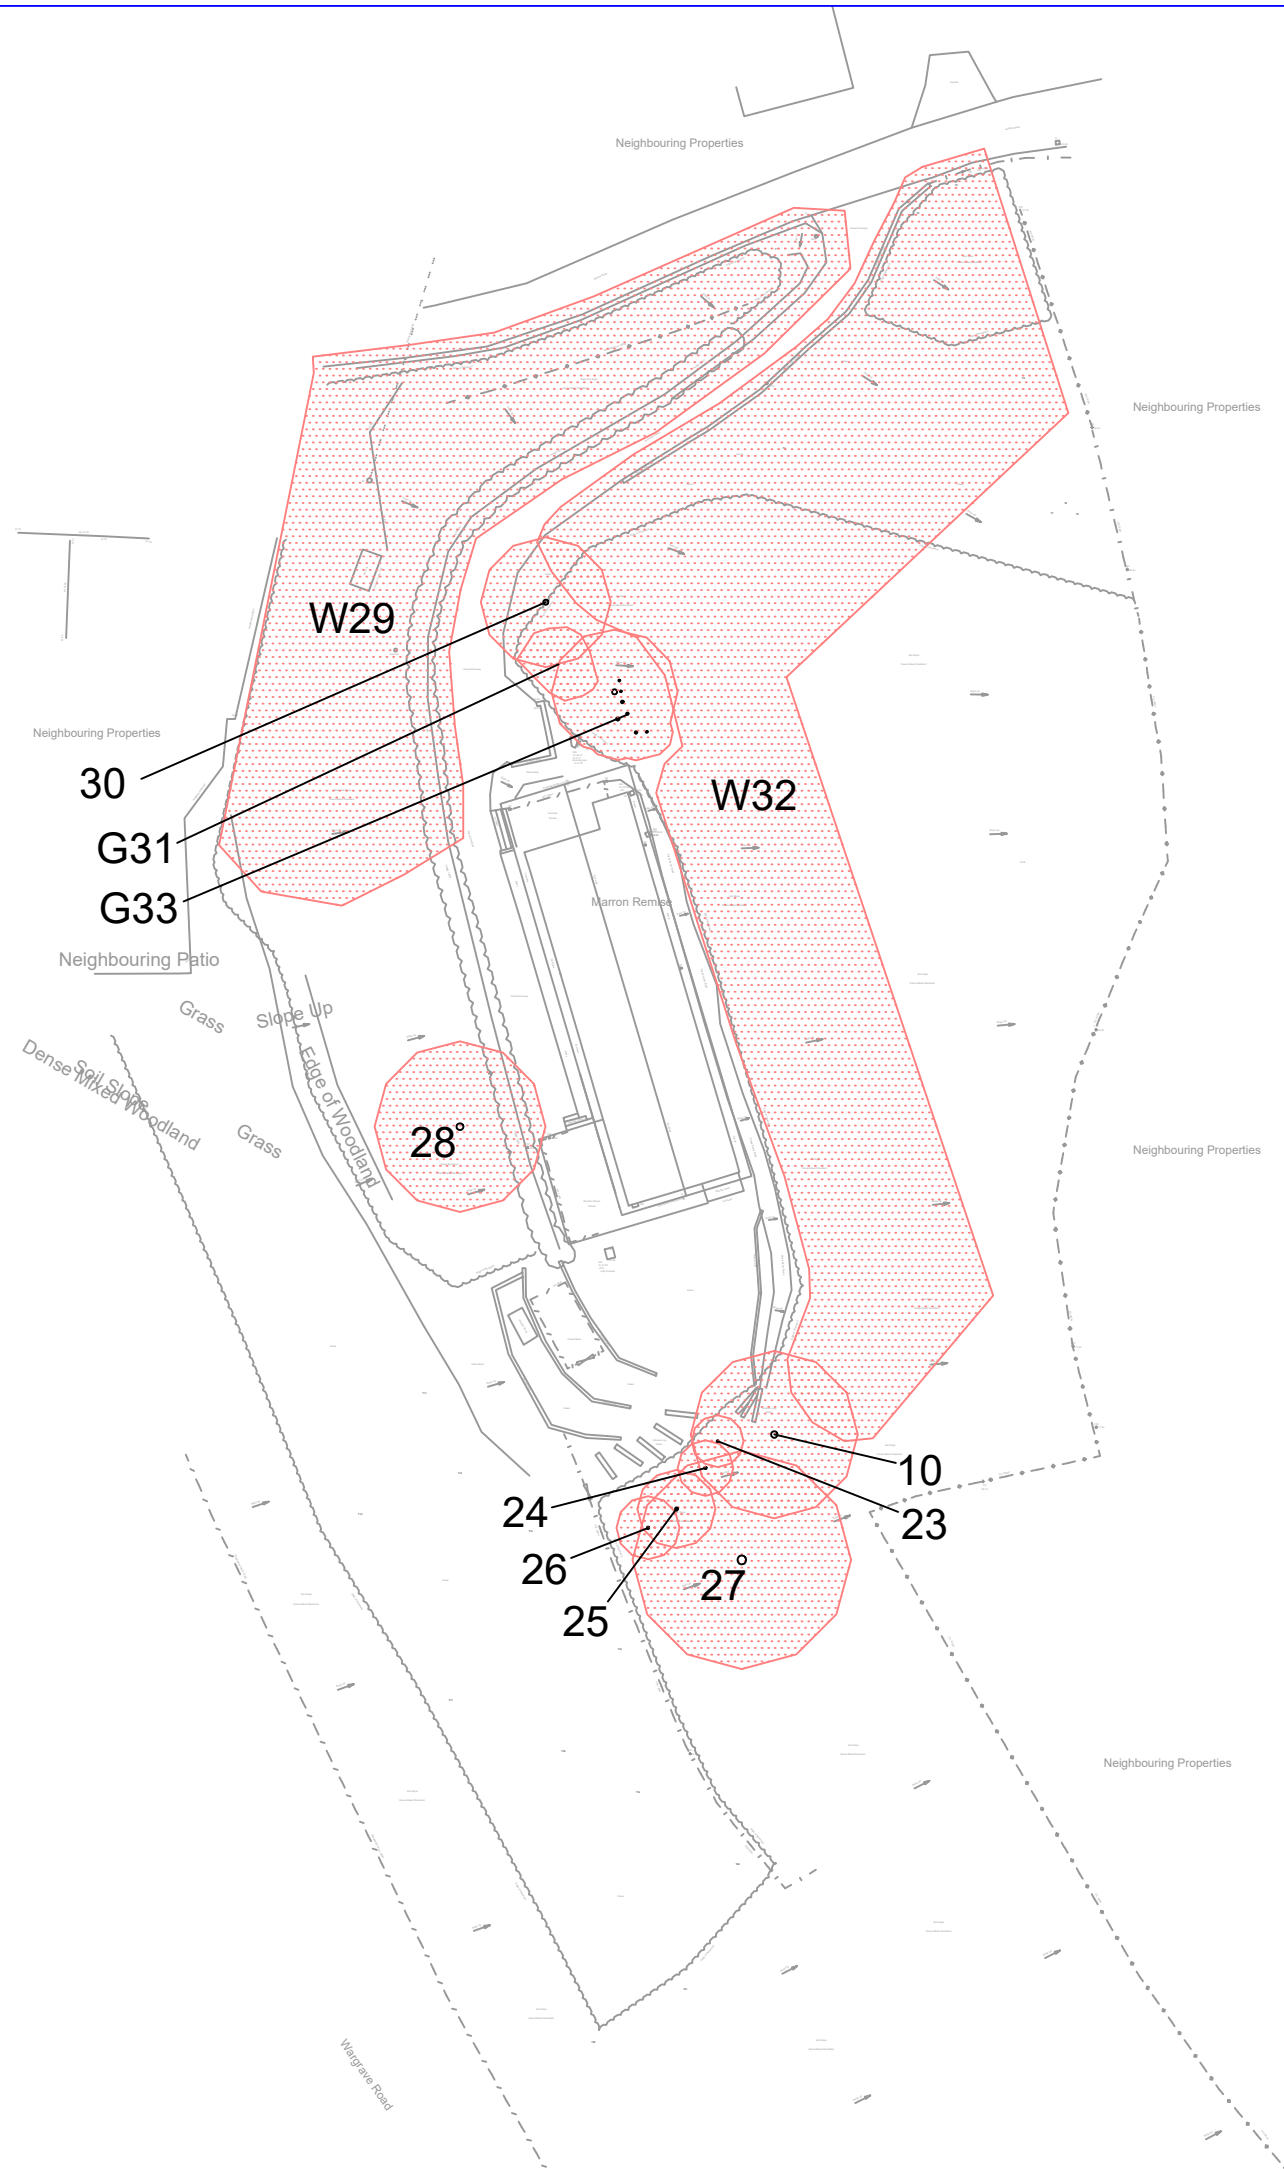


NOTES

- All dimensions must be checked on site and not scaled from this drawing.
- The original of this drawing was produced in colour, a monochrome copy should not be relied upon.
- Read drawings in conjunction with arboricultural report.
- Topo based on OS data, Licence No. 100022432.



Key:


- Tree Category A 1,2 or 3
- trees of high quality
- Tree Category B 1,2 or 3
- trees of moderate quality
- Tree Category C 1,2 or 3
- trees of low quality
- Tree Category U
- trees that cannot realistically be retained
- Tree number
- refer to report for information
- Existing site features
- Root protection area (RPA)



© copyright

Tree Surveys
Bramley House,
Newnham Bridge,
Tenbury Wells,
Worcestershire, WR15 8NX
Tel: 0118 762902
e-mail: info@tree-surveys.com


Client	Beechwood Tree Care Ltd		
Job Title	Marron Remise, Kentons Lane, Reading		
Drawing Title	ROOT PROTECTION AREA PLAN		
Scale	1:500 @ A3		
Date	June 2025	Drawn: MjE	Checked: PB
Drg. No.	PB/RPA-25/06.11	Rev.	

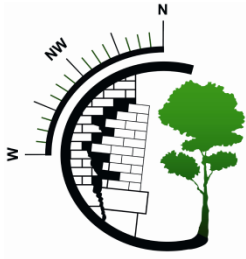

Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction


APPENDIX 4

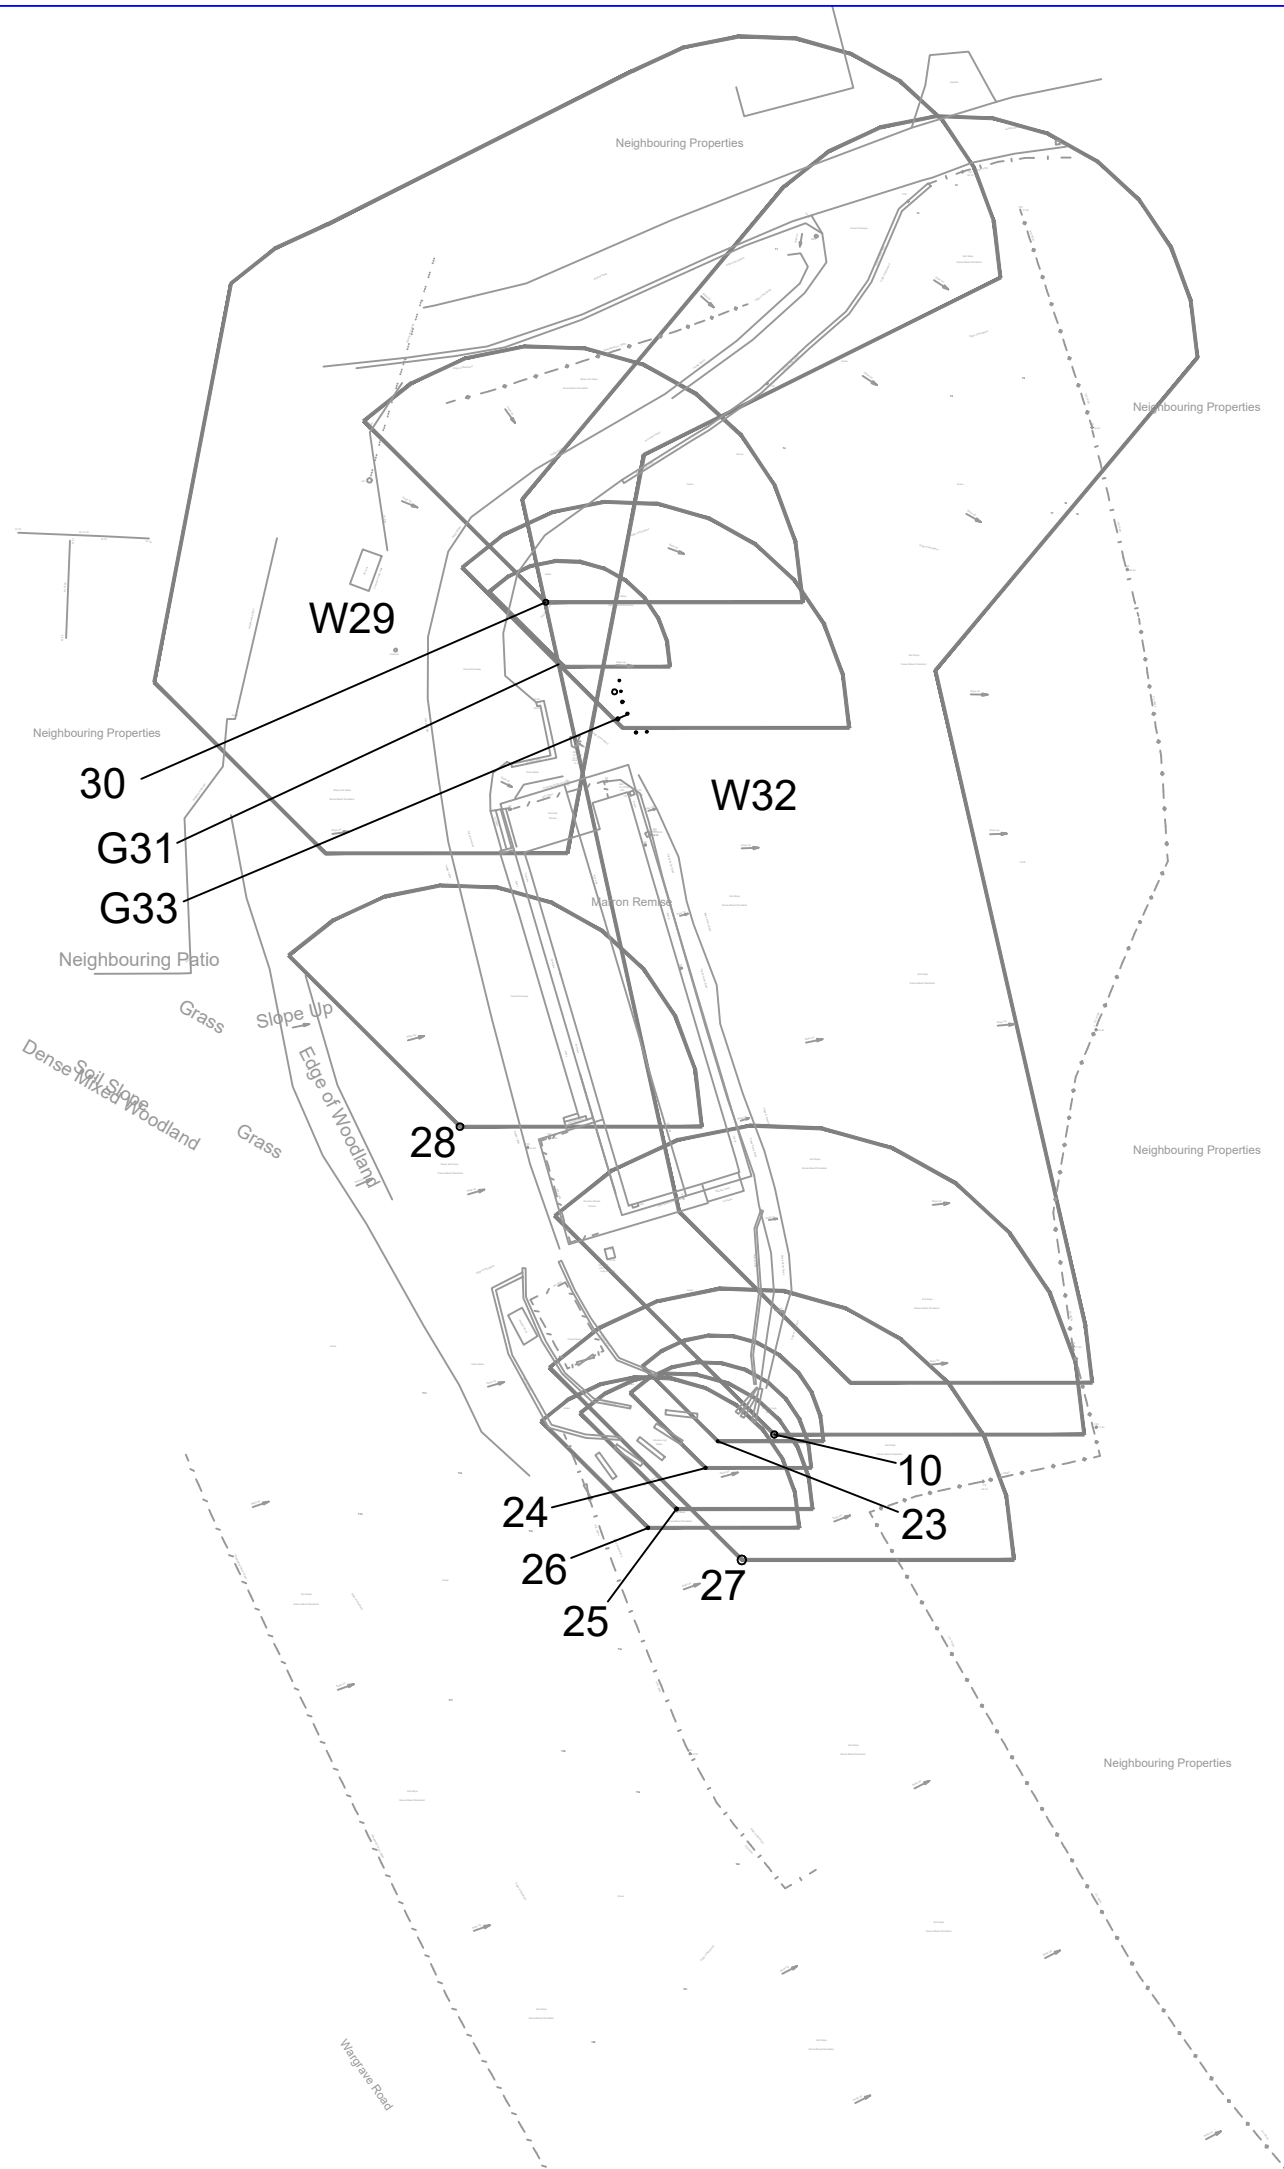

- NOTES
- All dimensions must be checked on site and not scaled from this drawing.
 - The original of this drawing was produced in colour, a monochrome copy should not be relied upon.
 - Read drawings in conjunction with arboricultural report.
 - Topo based on OS data, Licence No. 100022432.



- Key:
- Tree Category A 1,2 or 3
- trees of high quality
 - Tree Category B 1,2 or 3
- trees of moderate quality
 - Tree Category C 1,2 or 3
- trees of low quality
 - Tree Category U
- trees that cannot realistically be retained
 - Tree number
- refer to report for information
 - Existing site features
 - Area of shade



© copyright

Tree Surveys
Bramley House,
Newnham Bridge,
Tenbury Wells,
Worcestershire, WR15 8NX
Tel: 0118 762902
e-mail: info@tree-surveys.com

Client	Beechwood Tree Care Ltd		
Job Title	Marron Remise, Kentons Lane, Reading		
Drawing Title	SHADE CONSTRAINTS PLAN		
Scale	1:500 @ A3		
Date	June 2025	Drawn: MjE	Checked: PB
Drg. No.	PB/SC-25/06.11	Rev.	



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

APPENDIX 5



Tree Surveys


BS5837 – Pre Planning – Mortgage – Risk Management & Prediction – Expert Witness

BS 5837 FIGURE 2 TREE PROTECTION

Root Protection Areas (RPAs), enclosed by Default Temporary Protective Fencing, as detailed below and to be agreed with the Local Planning Authority (LPA), shall:

1. Be protected throughout the development process, as specified and detailed in BS 5837:2012 Section 6.2, Fig 2
2. Be erected prior to any construction, demolition or excavation works and remain in place for the duration of the project.
3. Preclude any delivery of site accommodation and or materials and or plant machinery.
4. Preclude all construction related activity, with the sole exception of specified arboricultural works and any other works carried out under supervision that has been agreed by all parties, and:
5. Preclude the storage of all development related materials and substances including fuel, oils, additives, cement and or any other deleterious substances.
6. Any incursions into RPAs must be by prior arrangement, following consultation with the LPA.

Figure 2 Default specification for protective barrier

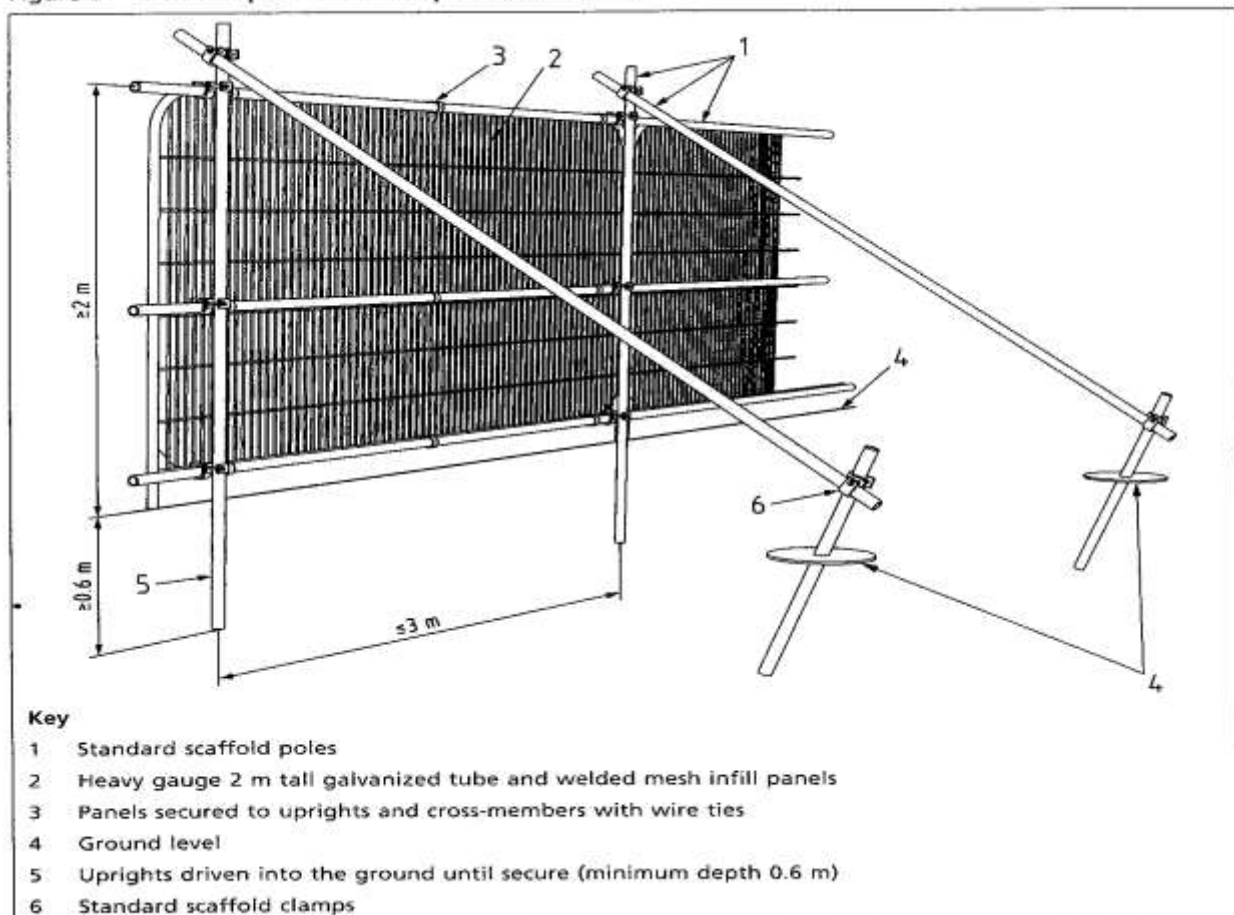



Tree Surveys

BS5837 – Pre Planning – Mortgage – Risk Management & Prediction

APPENDIX 6

TREE PROTECTION ZONE
KEEP OUT!

NO DIGGING OR TRENCHING
NO STORAGE OF PLANT OR MATERIALS
NO VEHICLE ACCESS
NO FIRE LIGHTING
NO CHEMICAL HANDLING
AVOID PLANT CONTACT WITH TREE CANOPY
REPORT ANY DAMAGE
TO TREES OR FENCING IMMEDIATELY