

Monitoring Details:

Crack and Level Monitoring

Provider Name: SML Subsidence

Monitoring Interval: Every 8 weeks

Instruction Date: 11/06/2026

Number of Visits: 7

Reading Date: 18/06/2026

Visits Completed: 4

Date of Issue: 25/06/2026

Visits Outstanding: 3

Client Details:

Client: Sedgwick


Engineer / Handler: -

Job Reference:

Monitored Address:

Address: 14 Fakenham Close, lower Early, RG6 4AB

Site Plan

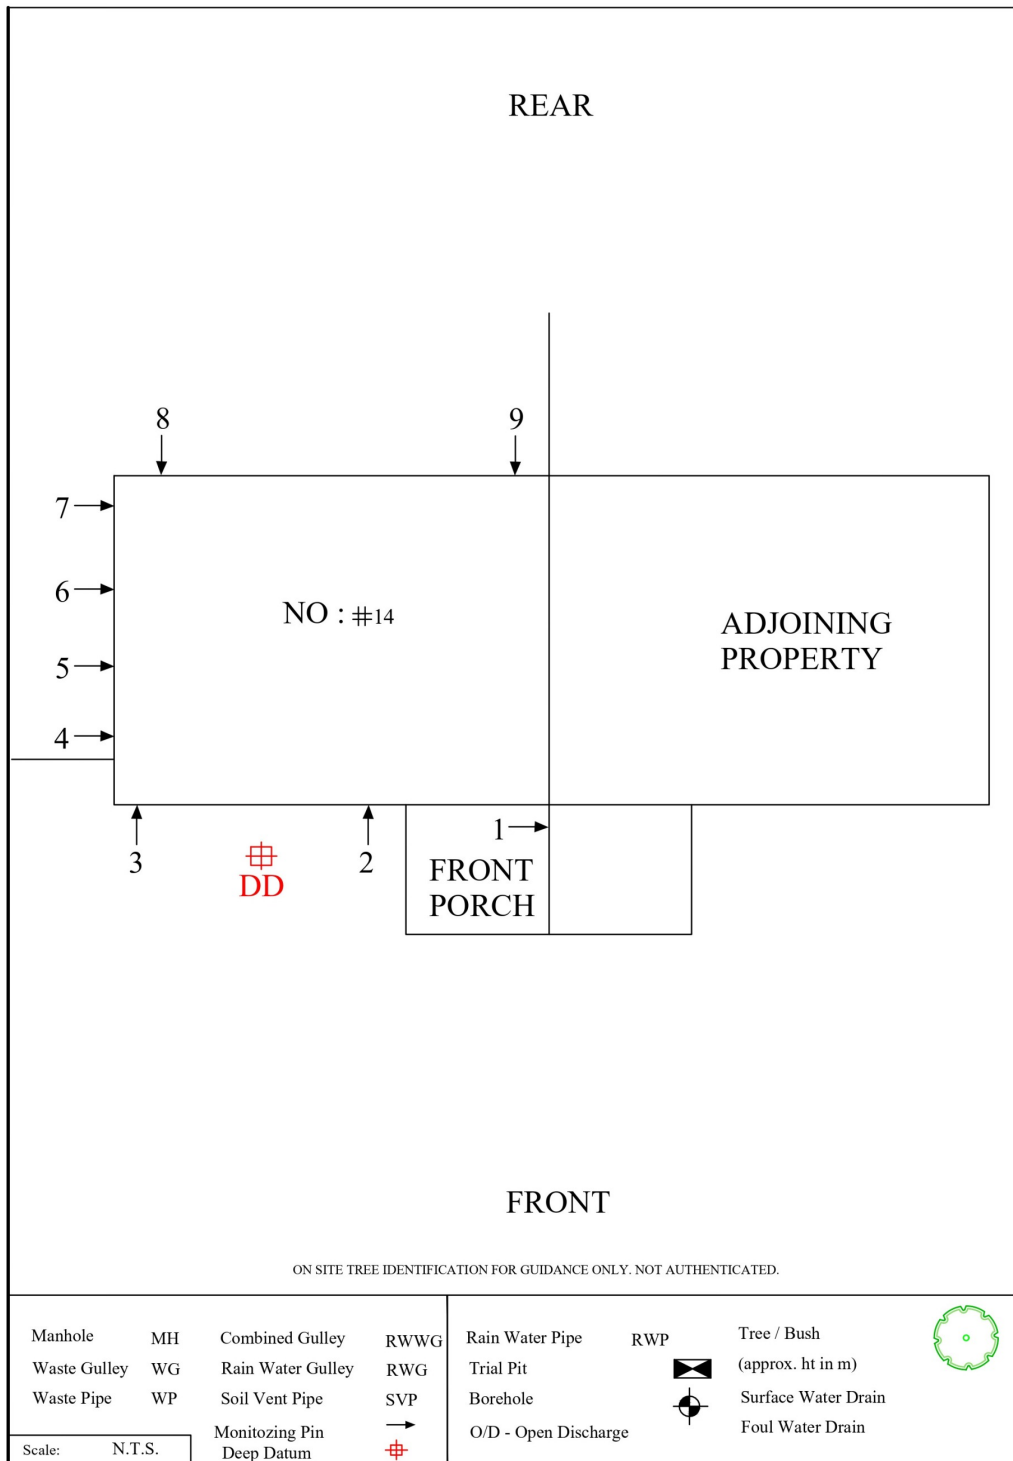

Visit Notes

No visit notes have been entered for any visits

Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
1	10.8164	10.8325	10.8357	10.8295				
2	10.2285	10.2404	10.2422	10.2355				
3	10.5622	10.5670	10.5673	10.5631				
4	10.6318	10.6352	10.6331	10.6307				
5	10.5540	10.5550	10.5562	10.5519				
6	10.6328	10.6341	10.6338	10.6293				
7	10.6127	10.6141	10.6120	10.6080				
8	10.7868	10.7902	10.7881	10.7836				
Taken by	N/A	N/A	N/A	TF				
Serial number	00001	0001	00001	1180				


Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
1	0	+16.1	+19.3	+13.1				
2	0	+11.9	+13.7	+7				
3	0	+4.8	+5.1	+0.9				
4	0	+3.4	+1.3	-1.1				
5	0	+1	+2.2	-2.1				
6	0	+1.3	+1	-3.5				
7	0	+1.4	-0.7	-4.7				
8	0	+3.4	+1.3	-3.2				

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
9	10.7084	10.7108	10.7091	10.7041				
Taken by	N/A	N/A	N/A	TF				
Serial number	00001	0001	00001	1180				

[illegible]

Level Readings Chart (Points 1 - 9)

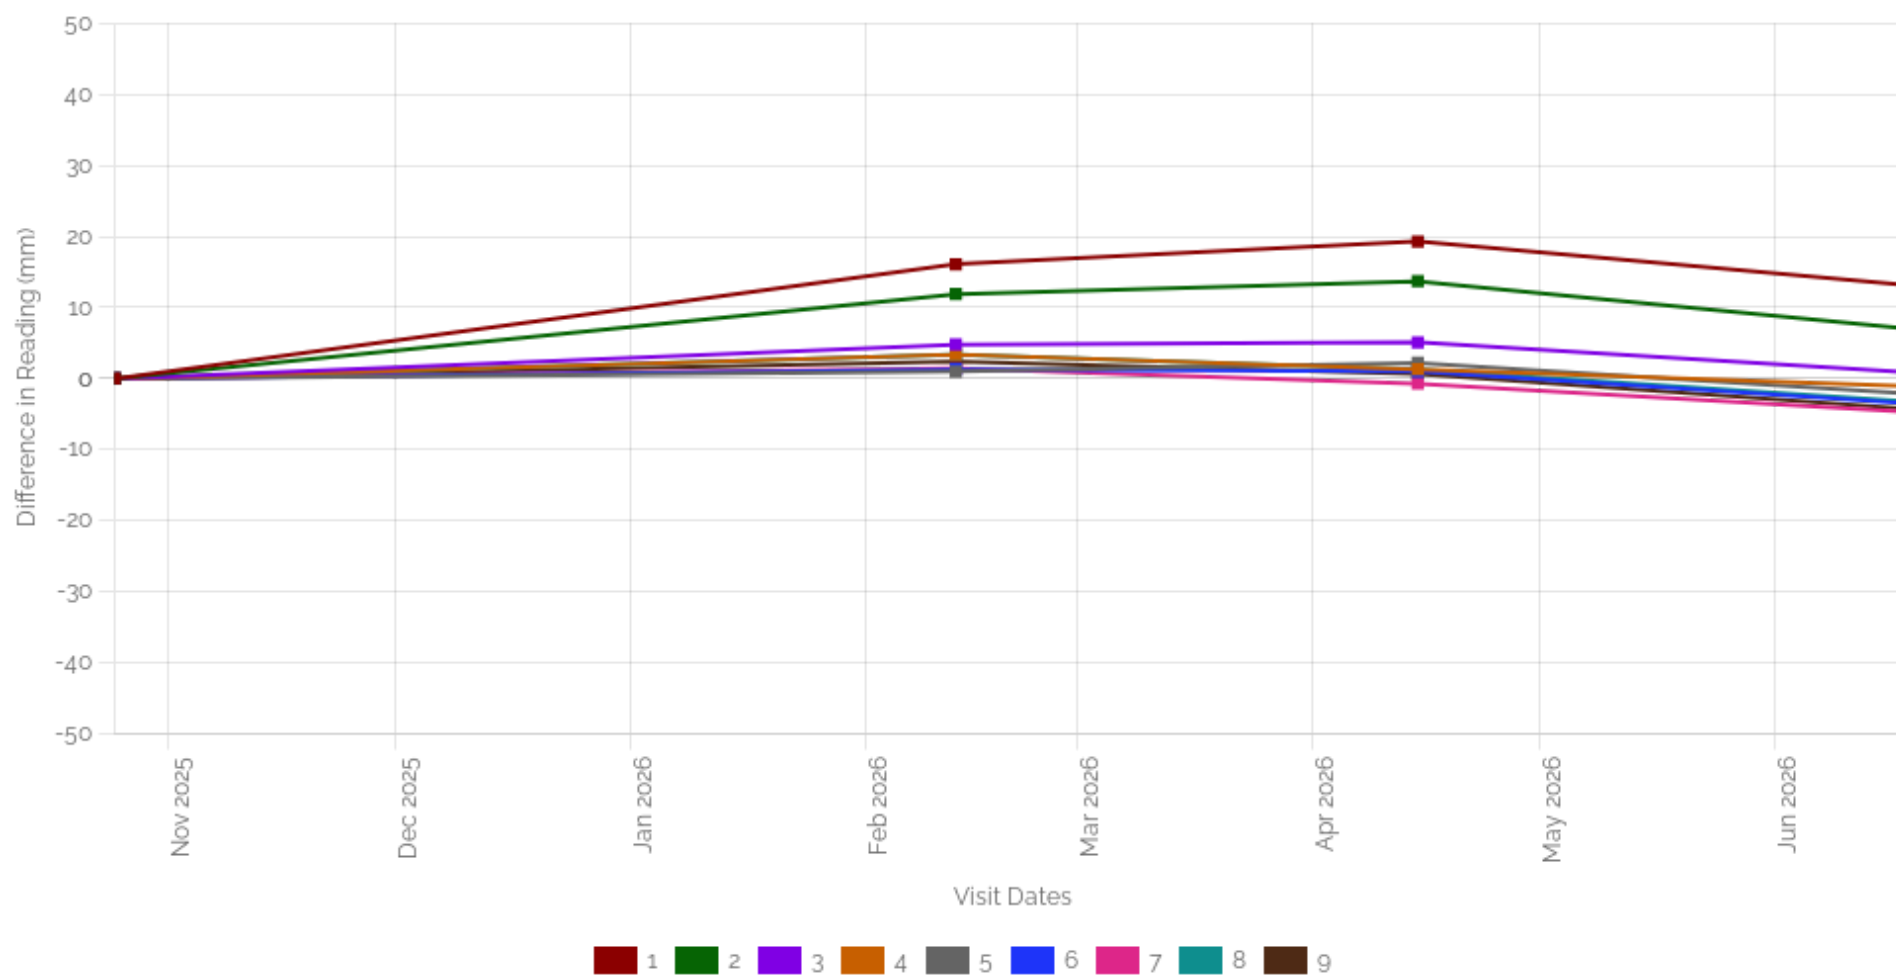


Crack Monitoring

(External) left elevation above gas box

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
H	6359	6279	6328	6495				
V	4461	4474	4214	4435				
D	8183	8157	8143	8323				
Taken by	N/A	N/A	N/A	TF				
Callipers	0001	0001	0001	1430				

(External) left elevation above gas box - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
H	0	-0.8	-0.31	136				
V	0	0.13	-2.47	-0.26				
D	0	-0.26	-0.4	14				

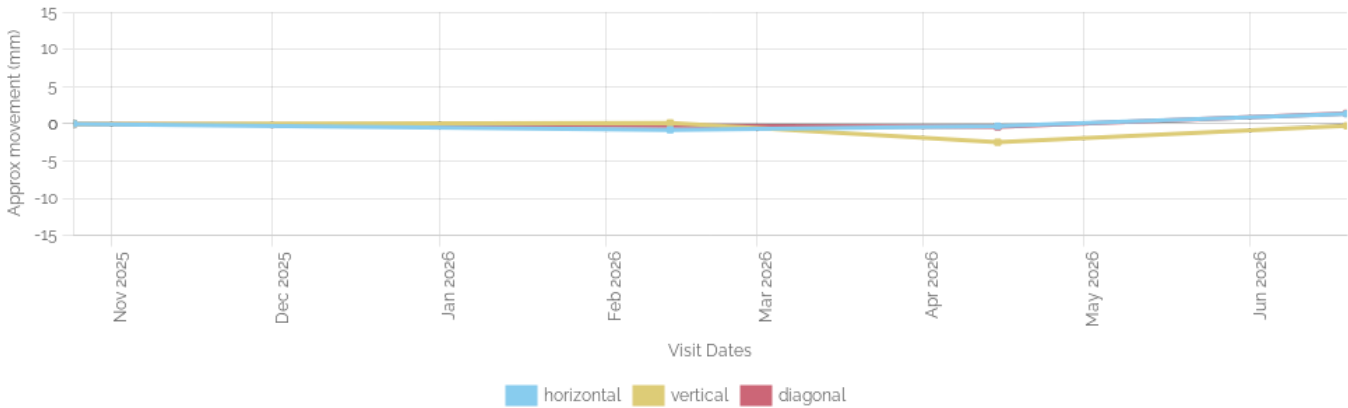

(External) left elevation above gas box - Photo




Crack Monitoring

(External) front elevation under window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
H	33.33	30.72	30.68	32.71				
V	28.82	27.26	27.36	29.2				
D	38.13	38.01	38.06	39.83				
Taken by	N/A	N/A	N/A	TF				
Callipers	0001	0001	0001	1430				

(External) front elevation under window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8
	24/10/25	12/02/26	14/04/26	18/06/26				
H	0	-2.61	-2.65	-0.62				
V	0	-1.56	-1.46	0.38				
D	0	-0.12	-0.07	1.7				

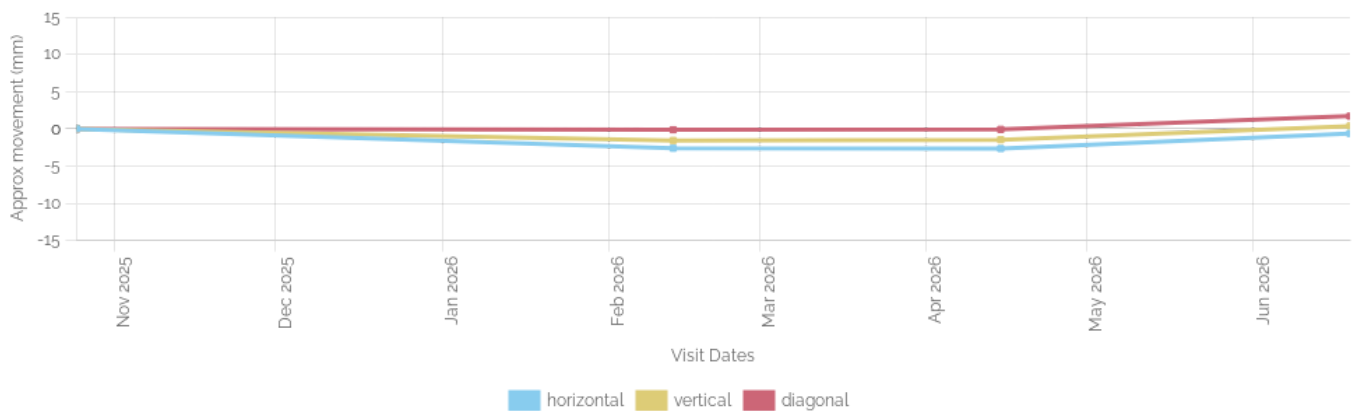

(External) front elevation under window - Photo

