

LEVEL MONITORING

for SMS (AVI, PRE)

5 Sharpthorpe Close, Lower Earley, Reading, RG6 4DB

Client:	SMS (AVI, PRE)
Client Contact:	
Claim Number:	
Client Reference:	
Policy Holder:	
Report Date:	6 February 2025
Our Ref:	

Level Monitoring Readings

The following table shows the reading levels of the various Level Monitoring Station points.

Date	1	2	3	4	5	6	7	8	9
12/08/2023	9.7169	9.8037	10.1030	10.1129	10.1749	10.0920	10.0924	9.8026	9.8014
03/10/2023	9.7176	9.8040	10.1032	10.1132	10.1755	10.0898	10.0924	9.8027	9.8016
27/11/2023	9.7170	9.8034	10.1029	10.1132	10.1752	10.0887	10.0914	9.8015	9.8007
18/01/2024	9.7180	9.8038	10.1030	10.1135	10.1756	10.0889	10.0914	9.8016	9.8009
14/03/2024	9.7177	9.8034	10.1031	10.1136	10.1756	10.0907	10.0934	9.8036	9.8029
02/05/2024	9.7172	9.8029	10.1030	10.1134	10.1752	10.0890	10.0920	9.8021	9.8012
26/07/2024	9.7175	9.8033	10.1031	10.1134	10.1752	10.0886	10.0916	9.8015	9.8004
03/10/2024	9.7174	9.8033	10.1032	10.1131	10.1749	10.0885	10.0910	9.8007	9.7996
28/11/2024	9.7170	9.8029	10.1031	10.1135	10.1748	10.0885	10.0909	9.8006	9.7998
30/01/2025	9.7176	9.8033	10.1034	10.1137	10.1756	10.0894	10.0921	9.8018	9.8013



Level Monitoring Difference Graphs

The following graphs display the progressive movement that each Level Monitoring Station recorded at each separate site visit date to give an overall look at how much the property is moving.



Level Monitoring Displacement Map

The following image shows an isometric representation of the movement of the property, based on the Level Monitoring Stations that were installed.

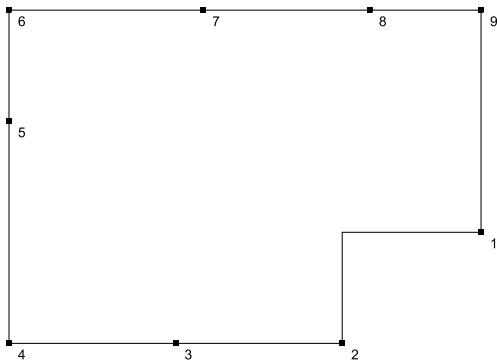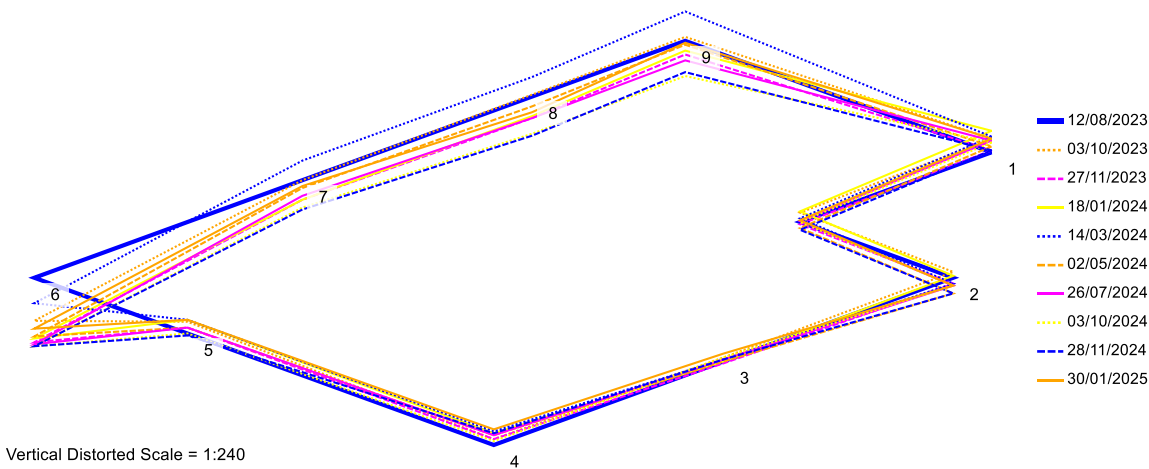

FRONT

Site Visit Notes

TBM is a manhole outside of No 5. No secondary TBM available. If this is not suitable, please advise if a deep datum is required.