



Arboricultural Consultancy
Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

**Tree Survey
Arboricultural Impact Assessment
Arboricultural Method Statement**

Relating to:

University of Reading, Wessex Hall – Fuel Separator

Produced for:

University of Reading

Prepared by:

Challice Consulting Ltd.
Mr. David Challice
Dip. Arb. (RFS), F. Arbor. A, MICFor
Chartered Arboriculturist

Date:

4th July 2024

Our Ref:

AR5455

Challice Consulting Ltd.
VAT Registration No. 886 2277 82
Registered Office: c/o Ellis Atkins Chartered Accountants The Atrium Business Centre Curtis Road
Dorking Surrey RH4 1XA United Kingdom
Registered in England and Wales No. 06080792

INTRODUCTION**SECTION**

Frequently Used Key Terms and Abbreviations	1.0
The Proposal	2.0
Instructions and Purpose	3.0
Scope	4.0
Documents Supplied/Used	5.0
Site Details	6.0

TREE SURVEY

Survey Method	7.0
Tree Details	8.0

ARBORICULTURAL IMPACT ASSESSMENT

Introduction to Arboricultural Impact Assessment	9.0
Tree Removal and Retention	10.0
Tree Pruning Works	11.0
Incursions into Root Protection Areas	12.0
Proximity Issues and Shading	13.0
Summary of Arboricultural Impact	14.0

ARBORICULTURAL METHOD STATEMENT

Introduction to Arboricultural Method Statement	15.0
Pre-Commencement Meeting	16.0
General Site Precautions	17.0
Tree Works	18.0
Tree Protective Fencing	19.0
Ground Protection	20.0
Site Access/Hard Surfaces	21.0
Demolition	22.0
Underground Services	23.0
Foundations	24.0
Hard Landscaping/Material Storage	25.0
Soft Landscaping/Boundary Fencing	26.0
Sequencing/Supervision, Responsibility and Incident Reporting	27.0
Amendments	28.0

Challice Consulting Ltd.

Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

APPENDICES

Appendix 1	Tree Survey Schedule with Recommended Tree Works
Appendix 2	Tree Protection Plan in Colour at A1 and Scale 1:200 with Tree Protective Fencing and Ground Protection Specifications
Appendix 3	Example of Site Inspection Record
Appendix 4	Induction Form for Personnel

INTRODUCTION

1.0 Frequently Used Key Terms and Abbreviations

Tree Preservation Order	TPO
Arboricultural Method Statement	AMS
British Standard 5837:2012 – Recommendations for Trees in Relation to Design, Demolition and Construction	BS 5837
British Standard 3998:2010 - Recommendations for Tree Work	BS 3998
Root Protection Area/Root Protection Areas	RPA/RPAs
Local Planning Authority	LPA

2.0 The Proposal

- 2.1 It is proposed to install a bypass fuel separator on the drainage run between Wessex Hall and Whiteknights lake.

3.0 Instructions and Purpose

- 3.1 This report has been commissioned by the University of Reading to;
- Survey the trees in accordance with British Standard (BS 5837) 5837:2012 - Trees in Relation to Design, Demolition and Construction- Recommendations.
 - Make suggestions to decrease the arboricultural impact of the proposed scheme on the surveyed trees during the design process.
 - Detail the arboricultural impact of the proposed project.
 - Prepare a tree work schedule to British Standard (BS 3998) 3998:2010 - Recommendations for Tree Work.
 - Develop a tree protection strategy for the duration of the development including any demolition works.
- 3.2 Provision of the above information is designed to address the requirements of the LPA in terms of the arboricultural information necessary to register and determine the planning application.

4.0 Scope

- 4.1 In surveying the trees to the requirements of BS 5837, trees on and immediately adjacent to the site with a stem diameter over 75mm have been included. Large shrubs and hedges have been included where these are considered to be of significant amenity value. These are particularly important where they provide boundary screening. For clarity and ease of data interpretation, large shrubs have been classified as trees.

- 4.2 A full hazard assessment of the trees (including the assessment of decay or defects and their impact), has not been undertaken as this is considered beyond the scope of this report. Any obvious hazards and defects have been identified in the Tree Survey Schedule and appropriate works recommended for immediate action.
- 4.3 It is the Client or their representative's responsibility to review the contents of this report to ensure it meets their requirements before it is sent to the LPA.

5.0 Documents Supplied/Used

Document	Obtained From	Format/Ref.
Existing and proposed layout plans	University of Reading	Dwg.

6.0 Site Details

- 6.1 The site is comprised of an amenity grass and woodland area located adjacent to the Whiteknights lake.
- 6.2 There are no significant inclines in any direction that would affect the recommendations in this report.
- 6.3 The site is within the administrative jurisdiction of Wokingham Borough Council.
- 6.4 I have not been instructed to ascertain the protection status of any of the trees on or near the site.

TREE SURVEY

7.0 Survey Method

- 7.1 The site and trees were inspected on 2nd July 2024.
- 7.2 The trees were inspected from ground level and no climbing inspections were undertaken.

- 7.3 Stem diameters were measured using a diameter tape at 1.5m from ground level unless stated in the Tree Survey Schedule at **Appendix 1**. The locations of the surveyed trees have originated from the drawings supplied by the Client unless otherwise stated in the Tree Survey Schedule.

8.0 Tree Details

- 8.1 The total number of records is as follows:
Individual Trees (T): 5
Tree Groups (G): 3
- 8.2 The tree details and proposed works are presented in the Tree Survey Schedule with Recommended Tree Works at **Appendix 1** and tree positions are shown on the Tree Protection Plan at **Appendix 2**.
- 8.3 The quality and value of the tree stock has been broken down by BS 5837 quality grade. The grading system can be summarised as follows:
A Grade – trees of high quality and value with a life expectancy of more than 40 years
B Grade – trees of moderate quality and value, with a life expectancy of more than 20 years
C Grade – trees of low quality and value, with a life expectancy of more than 10 years
U Grade – trees usually for removal (unless otherwise stated), with a life expectancy of less than 10 years

Quality and Value of Existing Tree Stock

	A Grade	B Grade	C Grade	U Grade
No. of Tree Records by Grade	6	2	0	0


- 8.4 The RPAs of the trees are included in the Tree Survey Schedule with reference to Table 1 of BS 5837. The RPA is the area, measured in m², which is calculated in accordance with the BS 5837 using the stem diameter of the trees. This should provide surveyed trees with sufficient rooting environment to survive the proposed development. Section 4.6.3

Challice Consulting Ltd.

Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

of BS 5837 provides for the shape of the RPA to be modified from the starting point of a circle to account for site features where rooting may be restricted, as long as the total area remains the same.

Diagrammatic Representation of a Restricted Root Protection Area

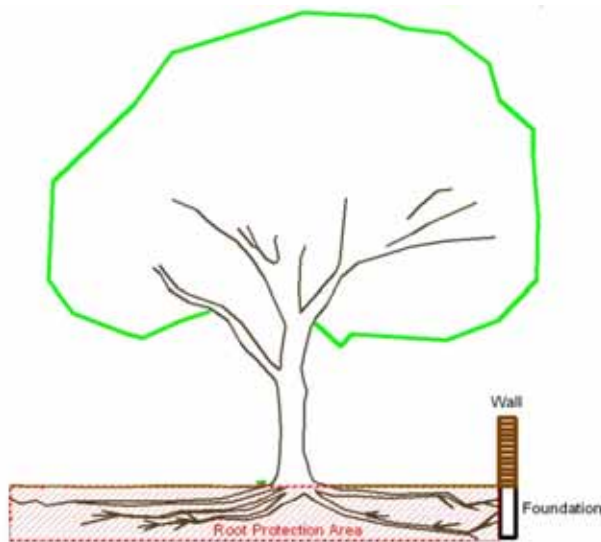

Modified RPAs

Tree No.	Impediments to Normal Rooting
T3, T4 and T6	Existing hard surfacing and the lake

ARBORICULTURAL IMPACT ASSESSMENT

9.0 Introduction to Arboricultural Impact Assessment

9.1 This section comprises an assessment of the impact the proposed works detailed in Section 2 above have on trees. It considers the arboricultural impact and how this may be mitigated.

10.0 Tree Removal and Retention

10.1 The proposed scheme provides for the retention and protection of all the trees surveyed.

11.0 Tree Pruning Works

- 11.1 Minor tree pruning is recommended to ensure reasonable clearance from the proposed construction. The pruning described in the Tree Survey Schedule with Recommended Tree Works at **Appendix 1** will not adversely affect the trees or their contribution to local amenity.

12.0 Incursions into Root Protection Areas

- 12.1 There are no incursions into the RPAs of the surveyed trees within this scheme.
- 12.2 No new underground services are to be installed within the RPAs of the surveyed trees.

13.0 Proximity Issues and Shading

- 13.1 The shade patterns for the surveyed trees have not been plotted as this is not a constraint to this type of development.

14.0 Summary of Arboricultural Impact

- 14.1 In summary, the arboricultural impact of the proposed scheme is minor as no trees are to be removed as a result of the development and minimal pruning is required to enable construction works to be completed.
- 14.2 The surveyed trees can be afforded an appropriate degree of protection in accordance with the BS 5837 as detailed in the AMS.
- 14.3 I have assessed the impact of the proposed development and it is considered to be in line with the recommendations set out in British Standard 5837.

ARBORICULTURAL METHOD STATEMENT

15.0 Introduction to Arboricultural Method Statement

- 15.1 To safeguard the surveyed trees (both above and below ground parts) during the development works and preserve the soil structure of areas which could be allocated for new planting, it will be necessary to implement tree protection measures as outlined below.
- 15.2 The basic principle is that a construction exclusion zone will be formed inside the tree protective fencing which is to be maintained for the duration of the works.
- 15.3 A copy of this AMS shall be maintained on site at all times and made available to all site personnel.
- 15.4 All site personnel shall be made aware of the key impact of this AMS and be given an arboricultural induction by the Site Manager. An Induction Form is attached at **Appendix 4**. A copy of the Induction Form will be signed by all site personnel to confirm that they have understood the issues involved.
- 15.5 As of 2005, Local Planning Authorities have powers to serve **Temporary Stop Notices** if agreed tree protection measures are not carried out. Adhering to this AMS will ensure that such costly and time consuming action is avoided.

16.0 Pre-Commencement Meeting

- 16.1 A pre-commencement site meeting, involving representatives from the Development Company, the Arboricultural Consultant and the LPA Tree Officer will be held to ensure that all aspects of the tree protection process are understood and agreed. A record of the meeting will be communicated to all parties by the Arboricultural Consultant within five days of the meeting.

Challice Consulting Ltd.

Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

- 16.2 Attendance at a pre-commencement site meeting and for any site supervision (see Section 27.0) is chargeable at the standard hourly rate as stated in the terms and conditions attached to the quotation for this report.

17.0 General Site Precautions

- 17.1 The following points will be observed at all times:
- o No fires will be lit on site during the construction or demolition phases.
 - o No access will be permitted inside the tree protective fencing.
 - o No materials, equipment or debris will be stored within the tree protective fencing.
 - o Notice boards, telephone cables or other services will not be attached to any parts of the surveyed trees.
 - o Materials which will contaminate the soil (e.g. diesel oil and vehicle washings) will not be permitted to migrate into the RPAs of the surveyed trees.
 - o A dedicated mixing and cleaning area will be set up to prevent concrete, cement and cleaning residue leaching into the RPAs of the surveyed trees (see Tree Protection Plan for specification).
 - o Site cranes are to be automatically programmed to avoid loads striking the crowns, stems and branches of the surveyed trees.
 - o Site and lorry mounted cranes are to be automatically programmed (or a banksman will be present) to avoid loads striking the crowns, stems and branches of the surveyed trees.
 - o All vehicle movements associated with the site (including skips) will be supervised by the on-site Arboricultural Liaison to ensure that the surveyed trees are not damaged during loading or unloading.
 - o All cement/toxic materials are to be stored inside the site and not in the RPAs of any surveyed trees.

18.0 Tree Works

- 18.1 All tree works will be carried out in accordance with BS 3998:2010 'Recommendations for Tree Work' (as amended) and to current arboricultural best practice. Tree works will be carried out by a suitably qualified and experienced Arboricultural Contractor holding the necessary insurance cover. This contractor should carry out the relevant site specific

Challice Consulting Ltd.

Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

- risk assessments and record such information prior to commencement of tasks and work in accordance with current health and safety standards, practices and legislation. A list of such contractors is available from the Arboricultural Association at www.trees.org.uk.
- 18.2 The subject trees may be protected by virtue of being within a Conservation Area or covered by a TPO. Submission of this AMS in connection with a planning application should be construed as a formal application to carry out those works specified in the Tree Survey Schedule with Recommended Tree Works at **Appendix 1**. It is recommended that this matter be clarified by the Client in writing with the LPA prior to any works commencing.
- 18.3 In addition, prior to the commencement of any tree works, an ecological assessment of specific trees may be required to ascertain whether protected species (e.g. nesting birds, bats, badgers and certain invertebrates) may be affected.
- 18.4 Tree ownership should be clarified in writing by the Client before any trees are removed or pruned.
- 18.5 If additional pruning of trees is required to facilitate the proposed works or access for machinery/plant, the Arboricultural Consultant will be contacted to advise on appropriate works and liaise with the LPA as necessary.
- 19.0 Tree Protective Fencing**
- 19.1 Tree protective fencing is used to ensure that the RPAs of the surveyed trees are safeguarded. These measures may also be employed to protect areas of ground for new landscaping.
- 19.2 The positioning and specification of the fencing is shown in **Appendix 2**. In this case, the default specification of BS 5837 consisting of **fixed Heras** fencing would be effective.
- 19.3 The protective fencing will remain in position for the duration of the development, including the removal of any existing structures. Clear signs

will be attached to the fencing once erected – suggested wording will be **‘Construction Exclusion Zone No Access’**.

20.0 Ground Protection

- 20.1 A provision has been made to install ground protection between the edge of the proposed development and the tree protective fencing. This provides adequate working space to permit the safe and practical completion of construction works whilst protecting the rooting environment of the surveyed trees. In this instance (and unless agreed otherwise by the Tree Officer) the proprietary trackway system for traffic over 2 tonnes will be the default specification (position and specification shown in **Appendix 2**). The ground protection will remain in place for the duration of the development, including the removal of any existing structures.

21.0 Site Access/Hard Surfaces

- 21.1 The existing and proposed vehicle and pedestrian accesses into the site are suitable for ingress and egress during demolition and construction and no damage is anticipated to the root systems of the surveyed trees.

22.0 Demolition

- 22.1 There is no requirement for demolition within the RPAs of the surveyed trees.

23.0 Underground Services

- 23.1 The proposed scheme can make use of existing services located inside and outside the site boundary and all new services will be located in the adequate space outside the RPAs of the surveyed trees.
- 23.2 The locations, specifications and installation methods of all new services will be available for review at the pre-commencement site meeting before any works start on site.

24.0 Foundations

- 24.1 There is no requirement for any foundations within the RPAs of the surveyed trees.

25.0 Hard Landscaping/Material Storage

- 25.1 There is no requirement for additional hard landscaping within the RPAs of the surveyed trees.
- 25.2 The storage of all materials required to complete the construction process will be located outside the RPAs of the surveyed trees and the line of the tree protective fencing.
- 25.3 Subject to all of the above tree protection measures being implemented, construction works may proceed without risk of damage to the surveyed trees.

26.0 Soft Landscaping/Boundary Fencing

- 26.1 Soft landscaping will be undertaken when heavy machinery has been removed from site and tree protective fencing taken down. The following points will be observed:
- Care will be taken not to compact the soil within the RPAs of the surveyed trees or where new tree planting is to be carried out.
 - No changes in ground levels will occur within the RPAs of the surveyed trees.
 - Unwanted vegetation will be removed manually or using contact herbicides that will not damage existing tree roots.
 - No irrigation or drainage pipes will be installed within the RPAs of the surveyed trees.
 - If soil has been compacted in areas where planting is proposed, measures to improve soil structure (e.g. decompaction) may be necessary to facilitate successful plant establishment.

27.0 Sequencing/Supervision, Responsibility and Incident Reporting

- 27.1 Effective tree protection relies on following a logical sequence of events and arboricultural inspection/supervision.
- 27.2 All the works detailed in this report which have the potential to affect trees will be supervised by a suitably qualified and experienced Arboricultural Consultant. Regular inspection visits will also be undertaken to ensure that tree protection measures are being adhered to. The final details of supervision and the frequency of inspection visits will be agreed with the Tree Officer at the pre-commencement meeting. The Arboricultural Consultant will make a record of visits, which will be attached to the site copy of the AMS for inspection and communicated in writing to the LPA within five days of the site visit. An example of the Site Inspection Record is found in **Appendix 3**.
- 27.3 Daily inspection of the physical tree protection measures will be carried out by the on-site Arboricultural Liaison, who does not have to be a trained Arborist, but will be responsible for the implementation of the approved tree protection. Any deviation from the approved methodologies will need to be agreed by the Arboricultural Consultant who may need to visit site to authorise the revised tree protection measures. It is the responsibility of the Client or the Arboricultural Liaison to instruct the Arboricultural Consultant to attend site for the key events requiring supervision or monitoring. Any required modification to the tree protection measures or building techniques within the RPAs of the surveyed trees will be communicated in writing to both the appointed Arboricultural Consultant and the Tree Officer before the changes occur.
- 27.4 Any damage to stems, branches or any size roots of the surveyed trees will be reported immediately by email and telephone by the Arboricultural Liaison to the Arboricultural Consultant. The Arboricultural Liaison will take photographs of the damage and send these to the Arboricultural Consultant who will visit site to assess the scale of the damage and report to the LPA Tree Officer. Mitigation for the damage will be agreed with the LPA Tree Officer.

Sequencing and Supervision

Stage	Action/Task	Personnel Responsible
1.	Issue arboricultural report to site manager	Client/Developer
2.	Give the Arboricultural Consultant (AC) and the Local Authority Tree Officer at least a week's notice of pre-commencement meeting	Client/Developer
3.	Arboricultural induction and appointment of the Arboricultural Liaison	Site Manager
4.	Carry out tree works (the Client is to establish tree ownership and protection status in writing before any tree works are carried out)	Site Manager
5.	Install all tree protective measures	Site Manager
6.	Pre-commencement meeting to review the service plan and tree protection measures	AC, Tree Officer, Client and Site Manager
7.	Construct fuel separator	Site Manager
8.	Install underground services	AC to supervise
9.	Remove machinery/plant	Site Manager
10.	Remove all tree protective measures	Site Manager
11.	Carry out soft landscaping, tree planting and erect boundary fencing	Site Manager to brief landscaping company on site and supervise

28.0 Amendments

- 28.1 Issues sometimes arise on development sites which require amendments to the previously agreed tree protection details. Any amendments to this AMS will be discussed with the Arboricultural Consultant and approved in writing by the LPA prior to being implemented. Copies of paperwork relating to any amendments shall be attached to the site copy of the AMS to provide a definitive record of what has been agreed.

Appendix 1

Tree Survey Schedule with Recommended Tree Works



Site: University of Reading, Wessex Hall - Fuel Separator

Date Surveyed: 02/07/2024

Surveyor: Mr. David Challice

Job Number: AR 5455

Tree No.	English Name	Height	Radial Crown Spread	Ground Clearance	Life Stage	Stem Diameter	Protection Radius	Growth Vitality	Structural Condition	Landscape Contribution	BS Cat	Useful Life	Observations	Reason/Works/Priority
T1	Common Oak	18m	7m	4m 6m E	Mature	890mm	10.7m	Fair	Fair	High	A (2)	40+	Decay fungi at base. Significant deadwood over 25mm in diameter over low target area.	Safety: Carry out a detailed tree inspection. 1 year.
T2	Common Oak	18m	N11m E14m S8m W14m	4m 6m E	Mature	1200mm	14.4m	Good	Good	High	A (2)	40+	Tree with insignificant defects; significant deadwood over 25mm in diameter over low target area.	No works proposed.
T3	Common Oak	18m	N13m E14m S10m W6m	4m 6m E	Mature	980mm	11.8m	Good	Good	High	A (2)	40+	Tree with insignificant defects; significant deadwood over 25mm in diameter over low target area; stem leaning historically east.	No works proposed.
T4	Common Oak	18m	N14m E7m S10m W13m	4m 6m E	Mature	1230mm	14.8m	Good	Good	High	A (2)	40+	Tree with insignificant defects; significant deadwood over 25mm in diameter over low target area.	No works proposed.
G5	Common Hornbeam, Common Alder and Silver Birch	16m	4m	1m 1m N	Early Mature	400mm ave	4.8m	Good	Good	Moderate	B (2)	20+	Ivy smothering stems prevented inspection and stem measurements; significant deadwood over 25mm in diameter over low target area.	Development: Crown lift to approximately 4m over the proposed construction access route. Before development commences.
T6	Common Oak	18m	N10m E10m S10m W10m	4m 6m E	Mature	1240mm	14.9m	Good	Good	High	A (2)	40+	Tree with insignificant defects; significant deadwood over 25mm in diameter over low target area.	No works proposed.

Tree Survey Schedule with Recommended Tree Works



Site: University of Reading, Wessex Hall - Fuel Separator
Date Surveyed: 02/07/2024

Surveyor: Mr. David Challice
Job Number: AR 5455

Tree No.	English Name	Height	Radial Crown Spread	Ground Clearance	Life Stage	Stem Diameter	Protection Radius	Growth Vitality	Structural Condition	Landscape Contribution	BS Cat	Useful Life	Observations	Reason/Works/Priority
G7	Wild Cherry	16m	7m	2m 1m N	Mature	500mm ave	6.0m	Fair	Fair	Moderate	B (2)	20+	Ivy smothering stems prevented inspection and stem measurements.	Development: Crown lift to approximately 4m over the proposed construction access route. Before development commences.
G8	Common Oak	19m	11m	1m 2m N	Mature	1000mm ave	12.0m	Good	Good	High	A (2)	40+	Significant deadwood over 25mm in diameter over low target area.	No works proposed.

Key for the Tree Survey Schedule with Recommended Tree Works



- **Tree No.** refers to the tree reference number and the prefix of **T** - Single tree, **G** - Tree group, **H** - Hedge or **W** - Woodland.
- **English Name** refers to the tree's common name.
- **Height** describes the approximate height of the tree measured in meters from ground level.
- **Radial Crown Spread** refers to the crown radius in meters from the stem centre and can be labelled as the four compass points of N, E, S, W.
- **Ground Clearance** the first measurement refers to the lowest point of the crown height in meters above ground level, the second measurement is the height of the first significant branch and the cardinal point to which it is growing.
- **Stem Diameter** is the diameter of the stem measured in millimeters at 1.5m from ground level unless otherwise stated. The stem diameter may be estimated (est) where access is restricted or an average (ave) taken for groups or multi-stemmed trees with more than five stems. The number of stems is also indicated.
- **Protection Radius** is a radial distance measured in meters from the trunk centre.
- **Growth Vitality** - **Good**, **Fair** (below normal), **Poor** (sparse/weak) or **Dead** (dead or dying tree).
- **Structural Condition** - **Good** (no or only minor defects), **Fair** (remedial defects), **Poor** (major defects present) or **Hazardous** (defects require immediate remedial tree works).
- **Landscape Contribution** - **High** (prominent landscape feature), **Moderate** (visible in landscape) or **Low** (secluded/among other trees or obscured by structures).
- **BS Cat** refers to British Standard 5837:2012 Table 1 and refers to tree/group quality and value. **A** - High, **B** - Moderate, **C** - Low or **U** - Remove if within site ownership or control. The sub-category is in the line below the BS Cat in parentheses and refers to the retention criteria values where 1 is Arboricultural, 2 is Landscape and 3 is Cultural including Conservational, Historic and/or Commemorative.
- **Useful Life** is the tree's estimated remaining contribution in years.
- **Observations** provide additional information where it is necessary.

Appendix 2

Appendix 3



Arboricultural Consultancy
Holmwood Farm Grange Horsham Road North Holmwood Dorking Surrey RH5 4JR
Tel: 01306 743374 Email: info@challiceconsulting.co.uk Web: www.challiceconsulting.co.uk

(Sample) Arboricultural Site Supervision Record

Our Ref: ARxxxx

Site: xxxx

Application Number: xxxx/xxxx

Proposal: Front boundary wall, entrance gates and hard and soft landscaping.

Inspected by: Mr. David Challice

Date of Inspection: xx/xx/xxxx

Client: Mr. xxxx

Site Contact: Mr. xxxx

Local Authority: xxxx

Persons Present:

Mr. David Challice - Tree Consultant

Mr. xxxx – Landscape Architect

Tree Protective Fencing:

The tree protective fencing was installed according to the approved documentation.

Photograph of the Tree Protective Fencing



Works Within the Construction Exclusion Zone:

During the site meeting, the screw piles were installed under arboricultural supervision to discharge Condition 6 of the planning application reference xxxx/xxxx (drawing reference xxxxxx-x) for the approved boundary wall. This was undertaken as per the agreed specification to protect the roots of the off site hedge G8.

Photograph of the Screw Pile Installation within the Rooting Areas of Off Site Trees**Amendments to the Approved Arboricultural Documentation:**

There is no requirement for any amendments to the approved arboricultural documentation.

Remedial Work:

There is no requirement for any remedial tree works at this time as all the tree protective measures were installed according to the approved documentation.

General Comments:

I recommend that no further arboricultural site monitoring is required for this project. This report should be e-mailed by the Client to the Local Planning Authority.

Date of the Next Arboricultural Inspection:

No further arboricultural inspections are required.

Appendix 4

Induction Form for all Site Personnel:

Site Name:

- I have had explained to me by the Site Manager the key implications of the Arboricultural Method Statement relating to the development at the above site.
- I am aware that the tree protective fencing must remain in its original position and must not be moved without the approval of the appointed Arboricultural Consultant.
- I understand that certain operations must be supervised by the appointed Arboricultural Consultant and that these operations must not start until the consultant is present and has given approval.
- I confirm that I will bring any concerns about potential damage to trees to the attention of the Site Manager.
- I am aware that I must not cause damage to any of the retained trees on or adjacent to the site. Damage may be caused by direct means (i.e. physical damage caused to roots or the trunk/branches of the tree) or by indirect means (e.g. by fire or toxic materials entering the rooting environment of the tree).

Print Name:

Sign Name:

Date: