

Arboricultural Report



Relating to:

50 Bradmore Way, Lower Earley RG6 4DS

Tree Survey	✓
Arboricultural Impact Assessment	✓
Arboricultural Method Statement	✓

All to BS5837:2012 – Trees in relation to design, demolition and construction - Recommendations

Produced For:

Mr & Mrs D Thomas

Ref: APA/AP/2025/076

Date: 14th July 2025

Prepared By:

Andrew Pinchin BSc (Hons), Dip Arb (RFS), FArborA

Tel. 01932 450104

www.aparboriculture.co.uk

Contents

Section

Introduction

1

- Overview 1.1
- Key Issues for Implementation 1.2
- Contact Details 1.3
- Key Terms and Abbreviations 1.4
- The Proposal/Relevant Planning History 1.5
- Brief and Purpose 1.6
- Scope 1.7
- Documents Supplied and Used 1.8
- Site Details 1.9

Tree Survey

2

- Survey Method 2.1
- Tree Details 2.2
- Legal Protection Status of Trees 2.3

Arboricultural Impact Assessment

3

- Overview of Arboricultural Impact 3.1
- Tree works 3.2
- Incursions Within RPAs 3.3
- Light and Proximity Issues 3.4
- Mitigation 3.5
- Conclusion 3.6

Arboricultural Method Statement

4

- Introduction 4.1
- Pre-Commencement Meeting 4.2
- Sequencing and Inspection/Supervision 4.3
- General Site Precautions 4.4
- Carrying out of Tree Works 4.5
- Tree Protective Fencing and Ground Protection 4.6
- Site Access and Hard Surfacing 4.7
- Demolition 4.8
- Underground Services 4.9
- Foundations and Construction 4.10
- Fencing and Landscaping 4.11
- Amendments 4.12

Appendices

Appendix 1 – Tree Survey Schedule to BS5837:2012

Appendix 2 – Tree Protection Plan - Scale 1:200 at A3

Appendix 3 – BS5837 Categorisation System

BS 5837:2012



Trees in relation to design, demolition and construction – Recommendations

✓ BS5837: 2012 compliant report, supplied electronically as pdf document

This report is for the exclusive use of the clients and those involved in the submission and approval of the planning application to which the report relates and the implementation of any consented works. It may not be sold, lent, hired out or divulged to any third party not directly involved in the subject matter without the express consent of APArboriculture

Introduction

1.1 Overview

- The proposal is to erect a first floor extension and convert the existing garage to ancillary accommodation with related alterations
- A planning application is being submitted to Wokingham Borough Council for these works
- 15 trees have been surveyed
- No trees are to be removed
- 1 tree (off-site Ash T4) is to be pruned
- There is an incursion of new foundations/underpinning within the RPA of off-site Ash T4
- Precautions are to be observed when installing/underpinning the foundations as detailed in the AMS
- Works within the RPA of off-site Ash T4 are to be carried out under direct arboricultural supervision
- A pre-commencement meeting is to be convened on site prior to any development related activity commencing

1.2 Key Issues for Implementation

If the proposed development works are implemented, these are the key issues that the project manager/builder will need to be aware of:

- ***A pre-commencement meeting needs to be convened on site prior to any construction related activity starting (Section 4.2)***
- ***The tree protective fencing and ground protection need to be in place prior to any construction related activity starting (specifications given in Section 4.6)***
- ***Some of the works need to be carried out under the direct supervision of a suitably qualified and experienced arboricultural consultant (Section 4.3)***

1.3 Contact Details

Contact	Name	Company/LPA	Tel. / E-mail address	Sent report
Clients	Mr & Mrs D Thomas	-	-	✓
Architect/Planning Agent	Carl Richardson	Bastion	01256 962900 carl@wearebastion.co.uk	✓
Arboricultural Consultant	Andrew Pinchin	APArboriculture	01932 450104 aparboriculture@gmail.com	
LPA Tree Officer	Sarah Duckworth	Wokingham Borough Council	0118 9373 787 s.duckworth@wokingham.gov.uk	

1.4 Key Terms and Abbreviations

Arboricultural Impact Assessment - <i>An assessment of arboricultural impact</i>	AIA
Arboricultural Method Statement - <i>Contains the tree protection information</i>	AMS
British Standard 5837 2012: Trees in Relation to Design, Demolition and Construction – Recommendations – the relevant British Standard	The BS
Root Protection Area - <i>The volume of soil a tree needs to stay healthy</i>	RPA
Local Planning Authority - <i>The Council</i>	LPA
Tree Preservation Order - <i>A legal document that is used by the LPA to protect trees</i>	TPO

1.5 The Proposal/Relevant Planning History

The proposal is to erect a first floor extension and convert the existing garage to ancillary accommodation with related alterations.

A planning application is being submitted to Wokingham Borough Council for these works.

1.6 Brief and Purpose

This report has been commissioned by Mr & Mrs D Thomas to;

- Survey the trees in the vicinity of the proposed works in accordance with the BS.
- Assess the arboricultural impact of the proposed project.
- Present an effective tree protection strategy for the duration of the development works.
- Provide the necessary arboricultural information enable a planning application to be validated and determined.

1.7 Scope

The trees in the vicinity of the proposed works have been surveyed in accordance with the BS. Trees with a stem diameter over 75mm have been included.

The report is designed to fulfil the recommended criteria for the provision of arboricultural information in relation to the validation of planning applications (ref. Department for Communities and Local Government Circular 02/2008 and the associated guidance document entitled 'Validation of Planning Applications'.)

In addition to providing the necessary arboricultural information to enable a planning application to be validated and determined, the report is intended to be used as a working document for site personnel to inform and guide the tree protection process throughout the development works.

A full hazard assessment of the trees (including the assessment of decay or defects and their implications), has not been undertaken as this is considered beyond the scope of this report.

Detailed ecological considerations are also beyond the scope of this report.

1.8 Documents Supplied/Used


Document	Obtained From	Format/Ref
Existing and proposed plans	Bastion	Pdf & Dwg

1.9 Site Details

The site in question is within the administrative jurisdiction of Wokingham Borough Council. It lies in Bradmore Way in Lower Earley.

In terms of levels, the site is essentially level with no inclines of significance from an arboricultural perspective.

Site Location Plan

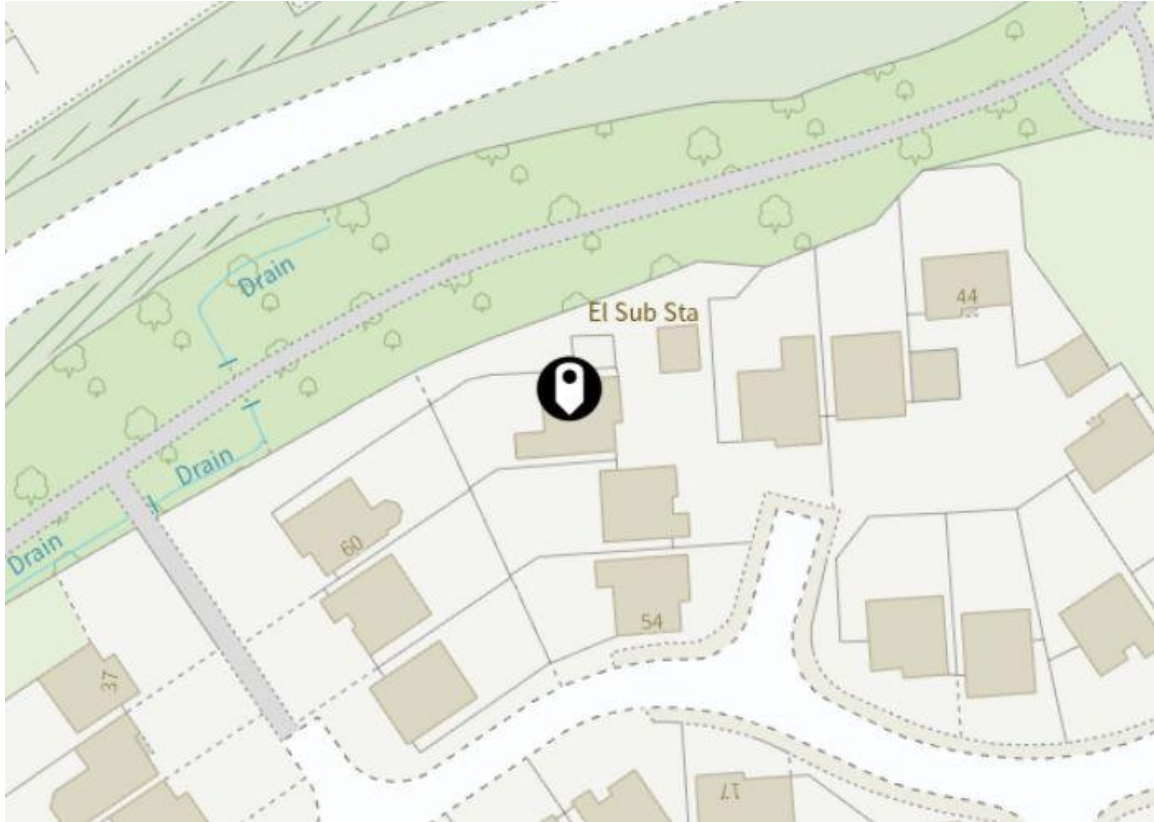

2 Tree Survey

2.1 Survey Method

The trees were surveyed on 8th July 2025.

Locations of the trees were plotted with a laser measuring device using triangulation and trilateration techniques.

The trees were inspected from ground level using widely accepted Visual Tree Assessment techniques. No climbing inspections were undertaken. No samples of soil, tree tissue or suspected pests/pathogens were taken.

Heights of the trees were estimated by eye. Crown spreads at each of the four cardinal points were measured using a laser measuring device. The diameters of the trees were measured at a height of 1.5m above ground level (using a diameter tape) as per Annex C of The BS.

Photographs were taken on site using a digital camera.





2.2 Tree Details

Full details of the surveyed trees and proposed works are given in the Tree Survey Schedule (Appendix 1). The locations of the trees are shown on the Tree Protection Plan (Appendix 2). The trees have been surveyed in accordance with the BS categorisation system, which can be summarised as follows:

- **Category A** – trees of high quality and value with a life expectancy of more than 40 years
- **Category B** – trees of moderate quality and value, with a life expectancy of more than 20 years
- **Category C** – trees of low quality and value, with a life expectancy of more than 10 years
- **Category U** – trees for removal, with a life expectancy of less than 10 years

- See Appendix 3 for more details on the BS5837 Categorisation System

An overview of the surveyed tree stock is as follows:

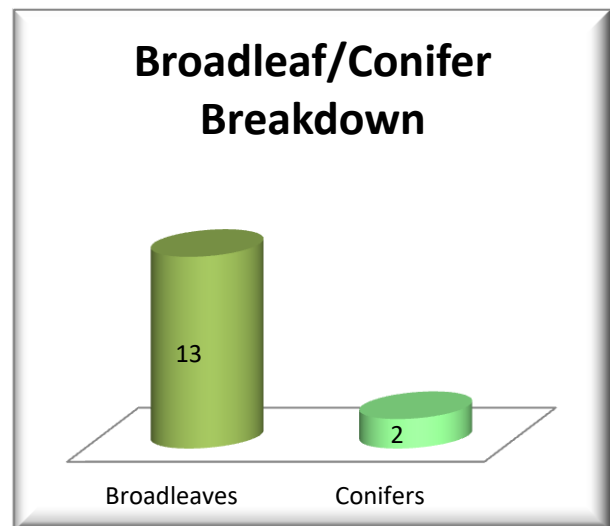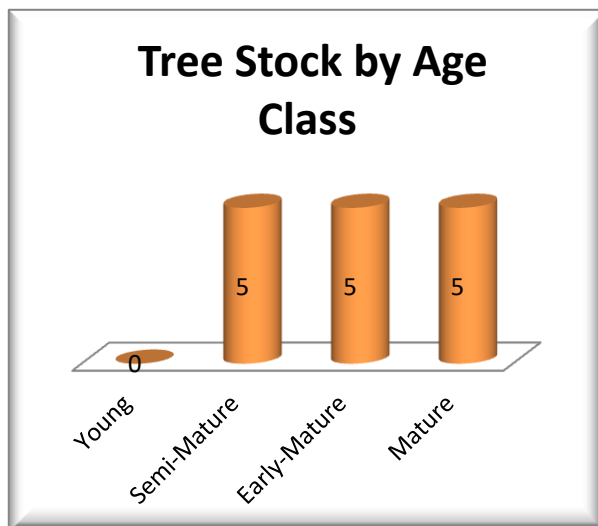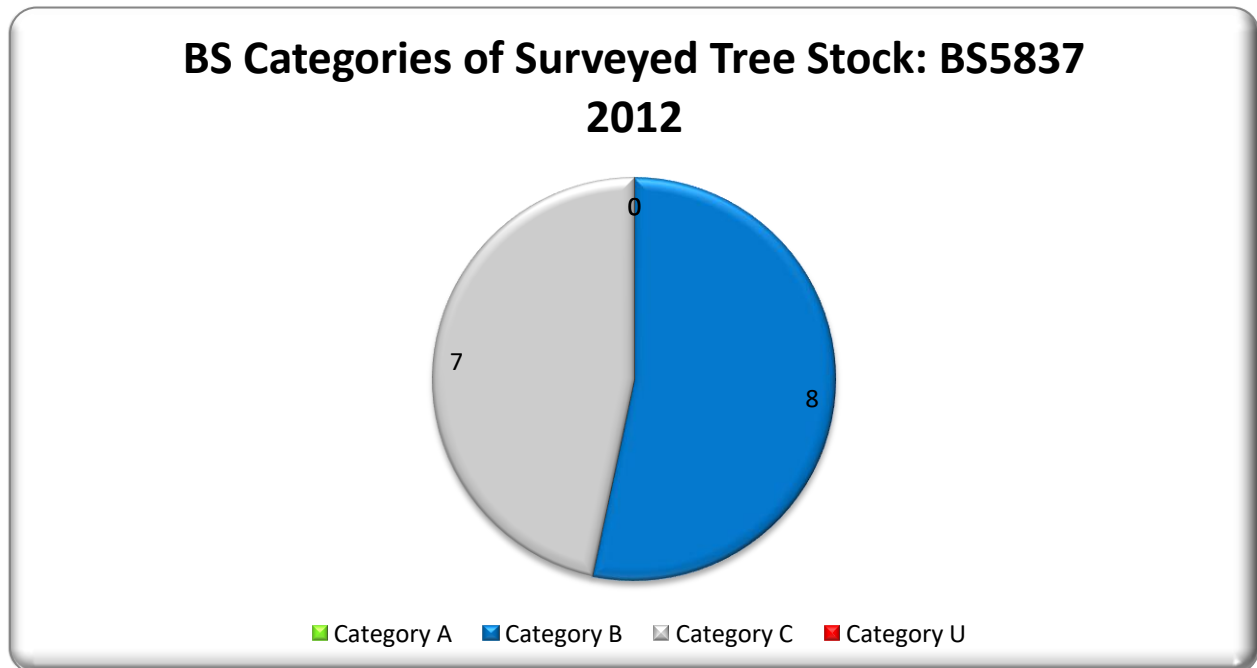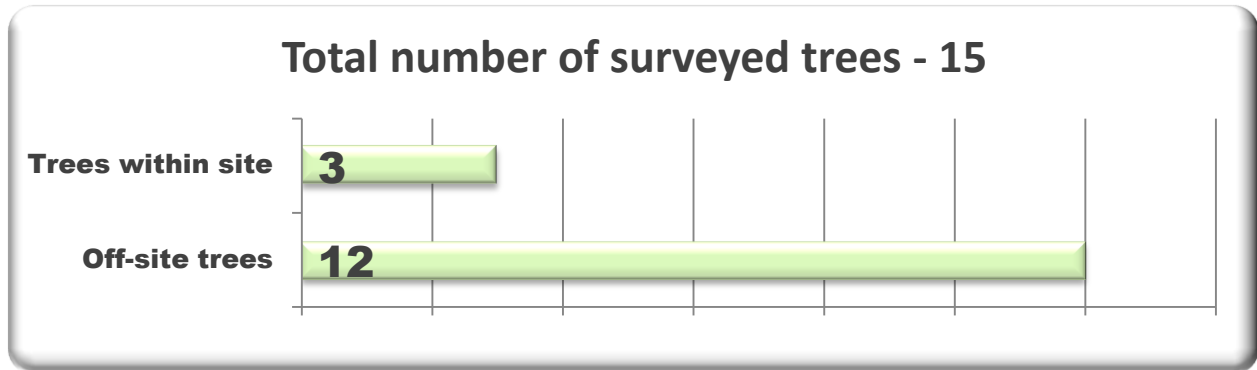


The RPAs of the trees have all been calculated in accordance with Annexe D of the BS and are given in the Tree Survey Schedule.

For single stemmed trees, the RPA radius is derived by multiplying the diameter of the tree at 1.5m above ground level by 12. For multi-stemmed trees, the RPA radius is derived by multiplying an equivalent stem diameter by 12. The formulae for calculating the equivalent stem diameters are as follows:

Equivalent stem diameter calculations for trees with multiple stems:

Trees with 2-5 stems: $\sqrt{(\text{stem diameter } 1)^2 + (\text{stem diameter } 2)^2 \dots + (\text{stem diameter } 5)^2}$

Trees with 5+ stems: $\sqrt{(\text{mean stem diameter})^2 \times \text{number of stems}}$

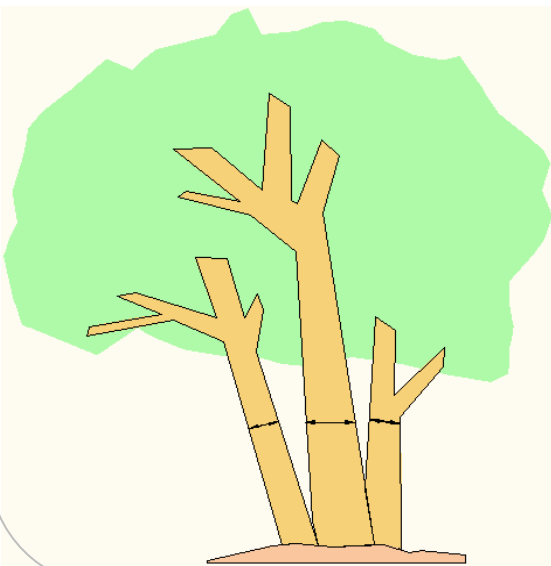

All stems measured at 1.5m above ground level.

RPA radius derived by multiplying equivalent stem diameter by 12

As for single stemmed trees, shape may under some circumstances be modified (with sound arboricultural justification) as long as total area remains the same

The RPA is the area (given in m²) that contains sufficient rooting volume for a tree to survive and remain healthy. Disturbance within this area has the potential to impact significantly upon tree health and vitality.

Sections 4.6.2 and 4.6.3 of the BS provide for the shape of the RPA to be modified from the starting point of a circle where rooting patterns are likely to be eccentric, subject to the total area remaining the same.

No RPAs have been modified in this instance and the RPAs of the surveyed trees are all shown as nominal circles on the Tree Protection Plan at Appendix 2.

2.3 Legal Protection Status of Trees

Type of Protection	Details/Ref.
Conservation Area	No
Tree Preservation Order	TPO 134/1978 Area Classification to north of property



Information derived from Wokingham Borough Council website on 14th July 2025.

Screenshot from Wokingham Borough Council website showing Tree Preservation Order to north of property:



3 Arboricultural Impact Assessment

3.1 Overview of Arboricultural Impact

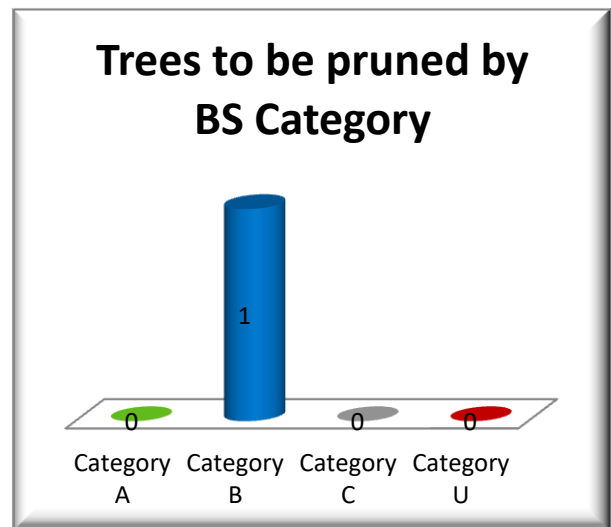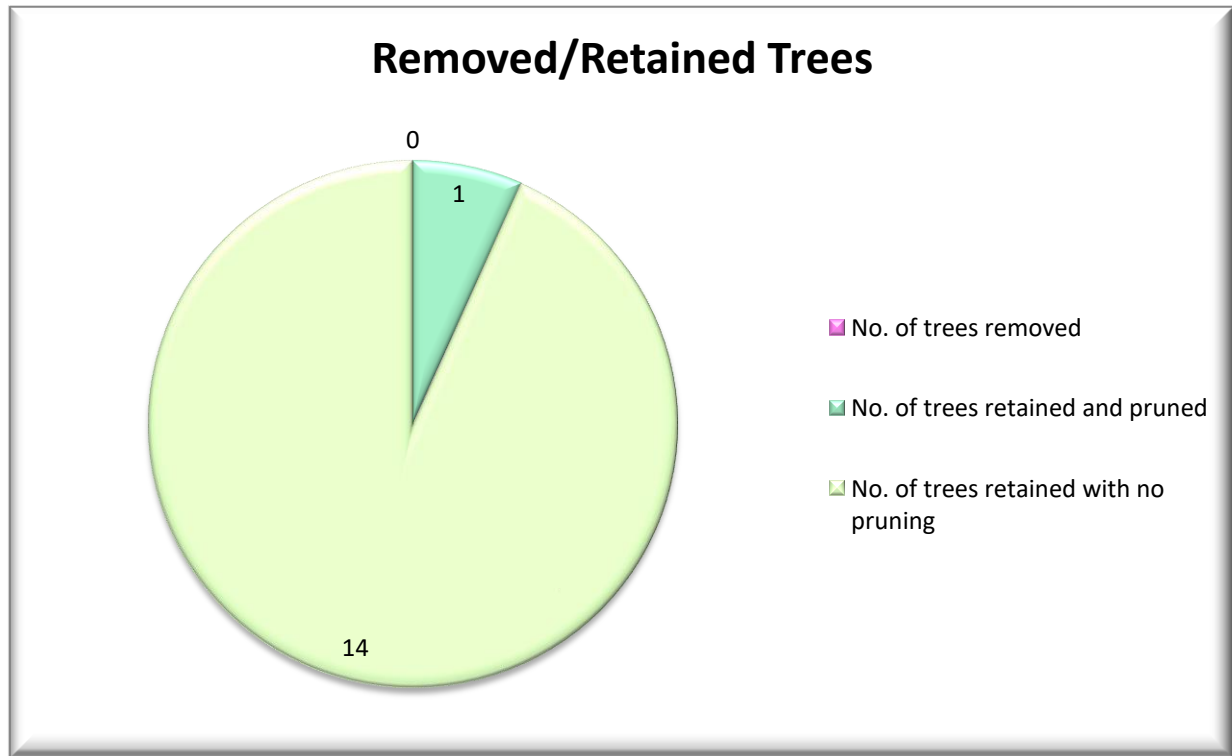

Number of trees with incursions within RPAs – 1

3.2 Tree Works

It will not be necessary to remove any trees to facilitate the proposed works.

Off-site Ash T4 is to be pruned to clear the new-build by up to 2m. This tree already has a crown height of 6m and the works required will be relatively minor. As such the works will have negligible public amenity implications.

It is not proposed to prune any other trees in connection with the project.

3.3 Incursions within RPAs

Incursions may be fully invasive (where a degree of root disturbance is considered acceptable) or low invasive (where specialist methods are used to limit the degree of disturbance).

The table below details the incursions and how they are to be dealt with:

Incursions into RPAs of Retained Trees/Hedges		
Type of Incursion	Trees affected	Action
New foundations/underpinning	Off-site Ash T4	Level of incursion within RPA relatively minor (<5%) at RPA margin. Precautions to be observed when carrying out works within RPA as detailed in AMS (including direct arboricultural supervision of works)

3.4 Light and Proximity Issues

Section 5.3 of the BS is concerned with the proximity of structures to trees and recommends that buildings are sited at distances from trees that allow for future growth without significant problems being experienced. Issues referred to include shading of buildings and open spaces, seasonal nuisances (dropping of leaves and fruits etc.) and concerns over safety.

These issues can lead to pressure to heavily prune or remove trees in the future and LPAs will be mindful of this potential pressure when considering whether proposals for development in proximity to trees are acceptable.

On balance, the proposed extension and other works are considered to be situated at acceptable distances from the retained trees.

Some minor pruning of off-site Ash T4 will be required from time to time to prevent branches touching the building but this is unlikely to present any particular problem.

3.5 Mitigation

No trees are to be removed in connection with the project and there are no specific proposals for soft landscaping/new planting.

3.6 Conclusion

Subject to full compliance with the AMS, the proposed works are considered supportable from an arboricultural perspective.

No trees are to be removed, 1 tree is to be lightly pruned and the retained trees are to be afforded an adequate degree of physical protection during the development process in accordance with the BS.

Works within the RPA of off-site Ash T4 are to be carried out in an arboriculturally sensitive manner under direct arboricultural supervision with specific precautions being observed as detailed in the AMS.

4 Arboricultural Method Statement

4.1 Introduction

To safeguard the retained trees during the development process, the tree protection measures set out below will be adhered to. These will protect the rooting systems and aerial parts of the trees/hedge.

The essential principle is that the area inside the tree protective fencing and where ground protection has been used is to be protected for the duration of the works.

Any specialist methods referred to in this AMS are to be implemented in full and arboricultural inspection/supervision is to be carried out as detailed in the Sequencing and Supervision Section (Section 4.3).

A copy of this AMS will be maintained on site at all times and made available to all site personnel.

All site personnel will be made aware of the key implications of this AMS. The Arboricultural Consultant can give a 'tool-box talk' to site personnel if required to ensure that the tree protection details are fully understood.

As of 2005, Local Planning Authorities have powers to serve Temporary Stop Notices if agreed tree protection measures are not carried out. Adhering to this AMS will ensure that such costly and time consuming action is avoided.

4.2 Pre-Commencement Meeting

A pre-commencement site meeting, involving the Site Manager, the Arboricultural Consultant and the LPA Tree Officer will be held to ensure that all aspects of the tree protection process are understood and agreed.

Any potential problems can be discussed at this stage, along with the exact sequencing of events and the level of arboricultural inspection/supervision required.

The Arboricultural Consultant will communicate a record of the meeting to all parties by e-mail.

Matters to be discussed at Pre-Commencement Meeting

- Timing and sequencing of works
- Exact locations and specifications for tree protective fencing and ground protection
- Works within the RPA of off-site Ash T4
- Any other arboricultural issues

It will also be useful for all parties to exchange current contact details at the meeting

4.3 Sequencing and Inspection/Supervision

Sequencing of events and effective arboricultural inspection/supervision are important elements of the tree protection process.

Works that have the potential to affect retained trees/hedges (works within the RPA of off-site Ash T4) will be supervised by a suitably qualified and experienced Arboricultural Consultant.

The appointed Arboricultural Consultant will make a record of any visits to the site and will communicate details of each visit to the Client and the LPA. This will provide evidence of compliance and ultimately enable the LPA to discharge tree related planning conditions.

Key Stages with suggested sequencing of works:

- AMS issued to Site Manager/Building Company
- AMS read by all site personnel to ensure full understanding of implications. Any queries addressed by appointed Arboricultural Consultant
- Convening of pre-commencement meeting
- Tree protective fencing erected and ground protection installed as per Tree Protection Plan

- Construction works carried out (with direct arboricultural supervision as detailed in AMS)
- Tree protective fencing and ground protection removed
- Landscaping works carried out (if any)

Summary of Required Arboricultural Inspection/Supervision:

Activity	Level of monitoring/supervision required
Erection of tree protective fencing and installation of ground protection	Inspection of tree protective fencing and ground protection by appointed arboricultural consultant
Installation/underpinning of foundations within RPA of off-site Ash T4	Direct supervision of works on site by appointed arboricultural consultant

4.4 General Site Precautions

The following points will be observed at all times:

- No fires will be lit within 10m of the canopies of retained trees.
- Notice boards, telephone cables or other services will not be attached to any parts of retained trees.
- Site operations will be planned to avoid damage to the aerial parts of trees. Particular care will be taken when using piling rigs and plant with booms, jibs and counterweights.

- Materials that contaminate the soil (e.g. concrete mixings, diesel oil, builders' sand and vehicle washings) will not be permitted to enter the RPAs of retained trees.

4.5 Carrying out of Tree Works

The proposed works on off-site Ash T4 will be carried out in accordance with BS 3998: 2010 'Recommendations for Tree Work' and to current arboricultural best practice.

The works will be carried out by a suitably qualified and experienced arboricultural contractor holding the necessary insurance cover. A list of such contractors is available from the Arboricultural Association at www.trees.org.uk.

Lists of reputable local tree contractors are also available on many Local Authority websites. APArboriculture can provide advice on enlisting the services of tree contractors where required.

If at any time during the project a need for additional tree works is highlighted to facilitate the proposed works or access for machinery/plant, the Arboricultural Consultant will be contacted to advise on appropriate works and liaise with the LPA as necessary.

4.6 Tree Protective Fencing and Ground Protection


Tree protective fencing and ground protection are used to ensure that the RPAs of retained trees are safeguarded.

The required tree protective fencing is shown on the Tree Protection Plan (Appendix 2). The fencing will remain in position for the duration of the development and will only be moved/alterd as agreed in writing by the LPA following arboricultural advice.

The tree protective fencing will be 2.0m Heras fencing as specified in the BS. The fencing will be supported by a scaffold framework with supporting struts firmed into the ground on the side of the trees.

The purpose of the supports is to prevent the fencing being moved during the development. Clear signs will be attached to the fencing (e.g. Tree Protection Area – Keep Out!).

Tree Protective Fencing Default Specification - BS5837: 2012

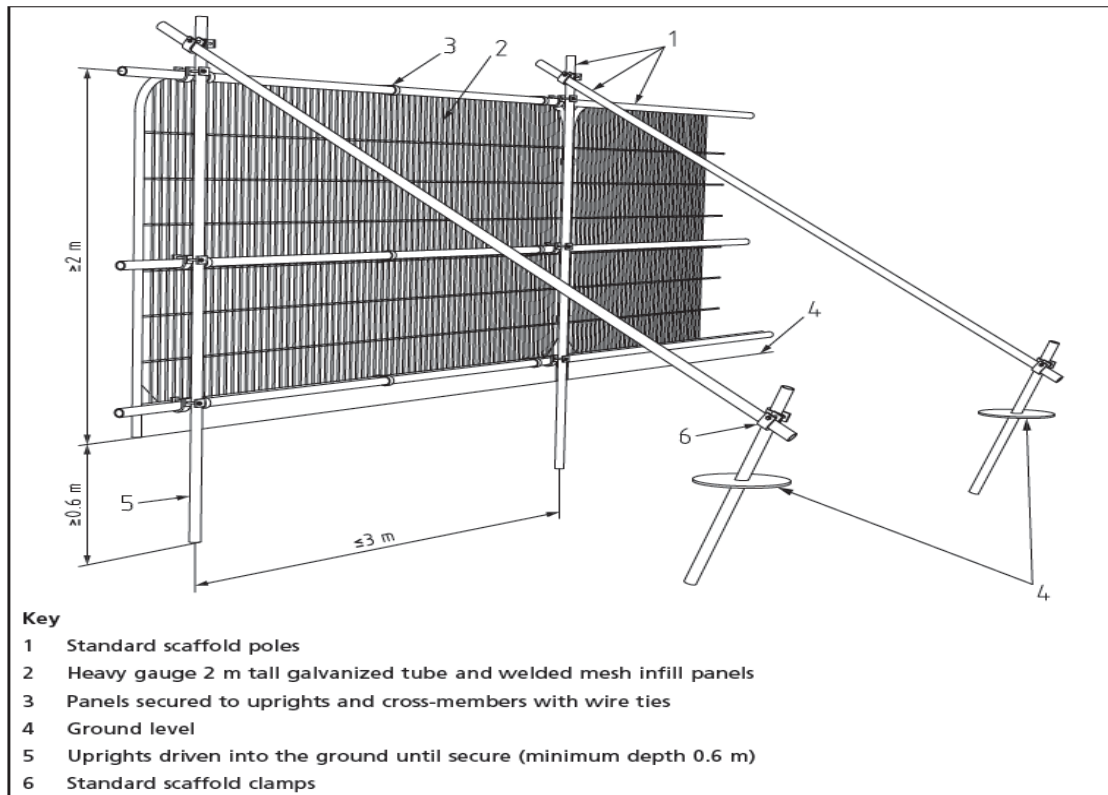

Braced Heras Tree Protective Fencing in situ – BS5837: 2012




It may *in some cases* be acceptable (e.g. on smaller sites) for rubber or concrete ‘feet’ at the base of heras fencing to be pinned to the ground or for short outriggers to be attached to the fencing and pinned to the ground in lieu of a full scaffold framework.

The exact specification of fencing that will be acceptable in this instance can be discussed at the pre-commencement meeting.

Ground protection has also been specified to protect the RPAs of retained trees as shown on the Tree Protection Plan at Appendix 2. To accord with the BS, the specification for the ground protection will be as follows:

- A geotextile membrane on the ground
- 100-150mm depth of a compressible layer (e.g. woodchips)
- Side butting scaffold boards or plywood on top

Schematic of ground protection & example on site

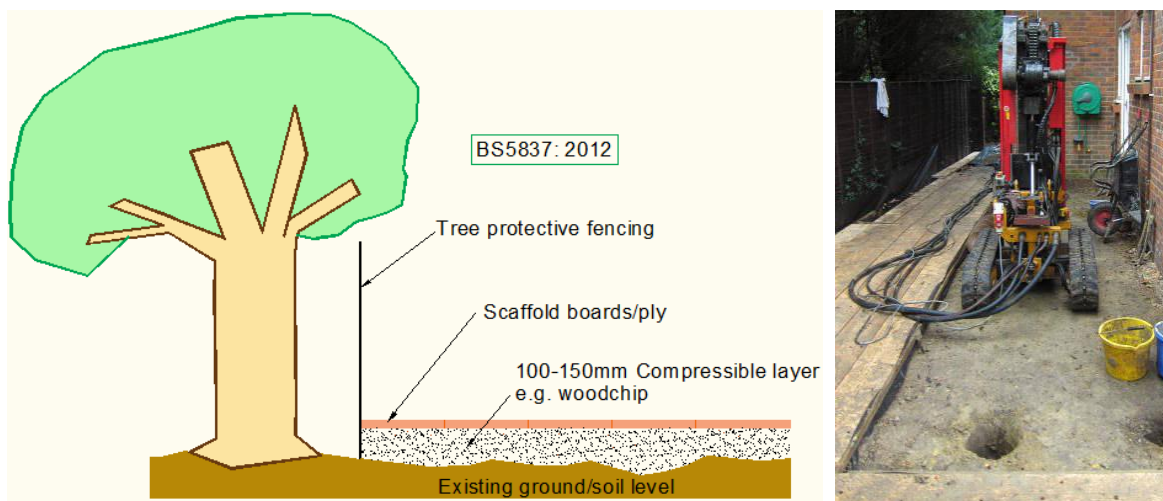

Nb. The above ground protection specification is suitable for loadings up to 2 metric tonnes (2000kg). For wheeled or tracked construction traffic of over 2 tonnes in weight (gross), more substantial ground protection will be required (e.g. Eve Trakway or a similar proprietary system).

4.7 Site Access and Hard Surfacing.

No hard surfacing is to be removed or installed within the RPAs of retained trees.

4.8 Demolition

No demolition works are to take place within the RPAs of retained trees.

4.9 Underground Services

It will not be necessary to install any new underground services within the RPAs of retained trees.

4.10 Foundations and Construction

To facilitate construction of the first floor extension it appears likely that the existing foundations will need to be either replaced or underpinned to support the additional loadings (most likely the latter in this instance).

The incursion within the RPA of off-site Ash T4 is relatively minor (<5%) at the RPA margin and as such use of conventional methods is considered acceptable.

The following specific precautions are to be observed when installing/underpinning the foundations within the RPA of the tree:

- The existing paving at the side of the house will be retained. This will provide effective ground protection throughout the development process
- The works will be carried out under direct arboricultural supervision
- Hand tools only will be used for any excavation works within the RPA of the tree for at least the first 800mm of depth
- Any roots that need to be severed will be cut cleanly with a sharp saw/secateurs to prevent ingress of decay fungi/other pathogens via shattered root ends
- The new foundations/underpinning will be lined with heavy gauge polythene/damp-proof membrane to protect the rooting environment of the tree from the potentially toxic effects of leaching concrete/cement

The exact manner in which the foundations are to be installed/underpinned within the RPA of the tree and the precautions to be observed can be discussed and clarified at the pre-commencement meeting.

4.11 Fencing and Landscaping

During the landscaping phase of the project (if any landscaping works take place), the following precautions will be observed:

- Soil within the RPAs of retained trees/hedges (and where new tree planting is proposed) will not be compacted. This will preclude the use of heavy plant within RPAs unless suitable ground protection is used
- There will be no changes in ground levels within the RPAs of retained trees
- Unwanted vegetation within the RPAs of retained trees/hedges will be removed manually or using contact herbicides that will not damage tree roots
- No underground irrigation or drainage pipes will be installed within the RPAs of retained trees/hedges
- Care will be taken when carrying out planting works not to damage the roots of retained trees/hedges. All planting pits within RPAs will be dug by hand and hedging will not be trench-planted

It is not in this instance proposed to install any new fencing.

4.12 Amendments

Issues may arise on projects of this nature that require amendments to the previously agreed tree protection details. Any amendments to this AMS will be approved in writing by the LPA prior to being implemented. Copies of paperwork relating to any amendments will be communicated by the Arboricultural Consultant to the Client and LPA.

Appendix 1

Tree Survey Schedule





Tree Survey Schedule

Tel. 01932 450104

BS5837: 2012 compliant survey by:

Andrew Pinchin

Ref. APA/AP/2025/076

Page 1

Tree Ref	Common Name	Height	Crown Spread	Crown Height	Age Class	No. of Stems	Stem Diameter	RPA Radius	Vigour	Structural Condition	Landscape Value	BS Cat	Useful Life	Notes & Observations
T1	Sallow	6	1 2 1 3	2.5	EM	2	360	4.3	Normal	Poor	Low	C1	10+	Heavily topped and trimmed in manner of hedging; of modest quality and landscape significance
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T2	Beech	18	8 6 8 7	5	M	1	600 e	7.2	Normal	Fair	Medium	B1	20+	Off-site tree; Ivy on stem has been cut
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T3	Oak	14	5 4 8 6	6	EM	1	460 e	5.5	Normal	Fair	Medium	B1	20+	Off-site tree; heavily colonised with Ivy; small Hawthorn at base on South side
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T4	Ash	15	3 3 4 4	6	SM	1	220	2.6	Normal	Fair	Medium	B1	20+	Off-site tree; drawn structure; crown slightly suppressed by adjacent trees
No. of trees: 1														
Recommended Works: Prune to clear new-build by up to 2m Reasons for Works: To facilitate proposed development works														
T5	Oak	22	11 10 10 11	6	M	1	900 e	10.8	Normal	Fair	Medium	B1, B2	20+	Substantial off-site Oak with broad; spreading crown
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														

Tree Survey Schedule Page 2

Tree Ref	Common Name	Height	Crown Spread	Crown Height	Age Class	No. of Stems	Stem Diameter	RPA Radius	Vigour	Structural Condition	Landscape Value	BS Cat	Useful Life	Notes & Observations
T6	Field Maple	7	4 3 3	1.5	SM	1	210 e	2.5	Normal	Fair	Low	C1	20+	Off-site tree; suppressed by adjacent trees; heavily colonised by Ivy
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T7	Oak	23	9 10 9	7	M	1	900 e	10.8	Normal	Fair	Medium	B1, B2	20+	Substantial off-site Oak with broad, spreading crown; stem colonised by Ivy
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T8	Oak	19	6 7 7	7	EM	1	480 e	5.8	Normal	Fair	Medium	B1, B2	20+	Off-site tree; stem colonised by Ivy
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
G9	Oak	23	9 8 9	7	M	1	760 e	9.1	Normal	Fair	Medium	B1, B2	20+	2 off-site Oaks; some distal die-back with dead wood in crowns to 150mm + diameter
No. of trees: 2														
Recommended Works: No works proposed Reasons for Works: N/A														
T10	Field Maple	8	5 5 5	1.5	EM	4	460 e	5.5	Normal	Poor	Low	C1	10+	Off-site tree; multi-stemmed at base; stems colonised by Ivy
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														
T11	Pear	4	3 2 1	1.5	SM	1	100	1.2	Normal	Fair	Low	C1	10+	Small Pear of modest quality and landscape significance; stem colonised by Ivy
No. of trees: 1														
Recommended Works: No works proposed Reasons for Works: N/A														

Tree Survey Schedule Page 3

Tree Ref	Common Name	Height	Crown Spread	Crown Height	Age Class	No. of Stems	Stem Diameter	RPA Radius	Vigour	Structural Condition	Landscape Value	BS Cat	Useful Life	Notes & Observations
T12	Plum	6	3 3 4 4	1.5	EM	2	200	2.4	Normal	Fair	Low	C1	10+	Small Plum of modest quality and landscape significance; stems colonised by Ivy
No. of trees: 1														
Recommended Works:		No works proposed												
Reasons for Works:		N/A												
G13	Lawson Cypress	4	2 2 1 1	2	SM	3	170 e	2.0	Moderate	Poor	Low	C1, C2	10+	2 off-site trees; heavily topped; of very modest quality and landscape significance
No. of trees: 2														
Recommended Works:		No works proposed												
Reasons for Works:		N/A												

Total no. of surveyed trees: 15

Key to Tree Survey Schedule (BS5837: 2012)

Tree Ref. – Consecutive numbering. T = Individual Tree: G = Tree Group: H = Hedge

Species – Common or Latin name for tree

Height – Height of tree in metres

Crown Spread – Radial crown spread in metres at the four cardinal points (N E S W)

Crown Height – Height of lowest parts of crown above ground level in metres

Age Class – Young, Semi-Mature, Early-Mature, Mature, Over-Mature

No. of Stems – Number of stems over 75mm in diameter at 1.5m above ground level

Stem Diameter – Diameter of stem in mm at 1.5m above ground for single stemmed trees. For multi-stemmed trees, equivalent diameter figure calculated as per the BS (e= estimated value; m = mean value)

RPA Radius – The radius of the Root Protection Area of the tree (from the tree centre) in metres

Vigour – An indication of the physiological condition/health of the tree: Normal, Moderate, Poor, Dead

Structural Condition – An assessment of the overall structural condition of the tree: Good, Fair, Poor

Landscape Value – High, Medium, Low

BS Cat – BS5837: 2012 Category. A- High, B- Moderate, C- Low, U- Remove. *For full description of categories see Table 1 of BS5837:2012*

Useful Life – Estimated remaining contribution to the landscape in years


Notes and Observations – miscellaneous notes where it is considered that these may be useful

(Recommended works and reasons for works also given in Tree Survey Schedule).

Appendix 2

Tree Protection Plan







LPA - Wokingham Borough Council

Conservation Area - No

Tree Preservation Order - TPO 134/1978 adjacent to north (Area classification)

Proposal: First floor extension
& conversion of garage

RPAs of T2 & T3
protected by exg
walling & block
pavior drive

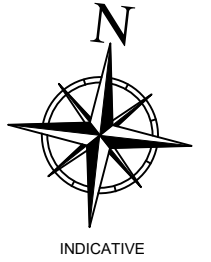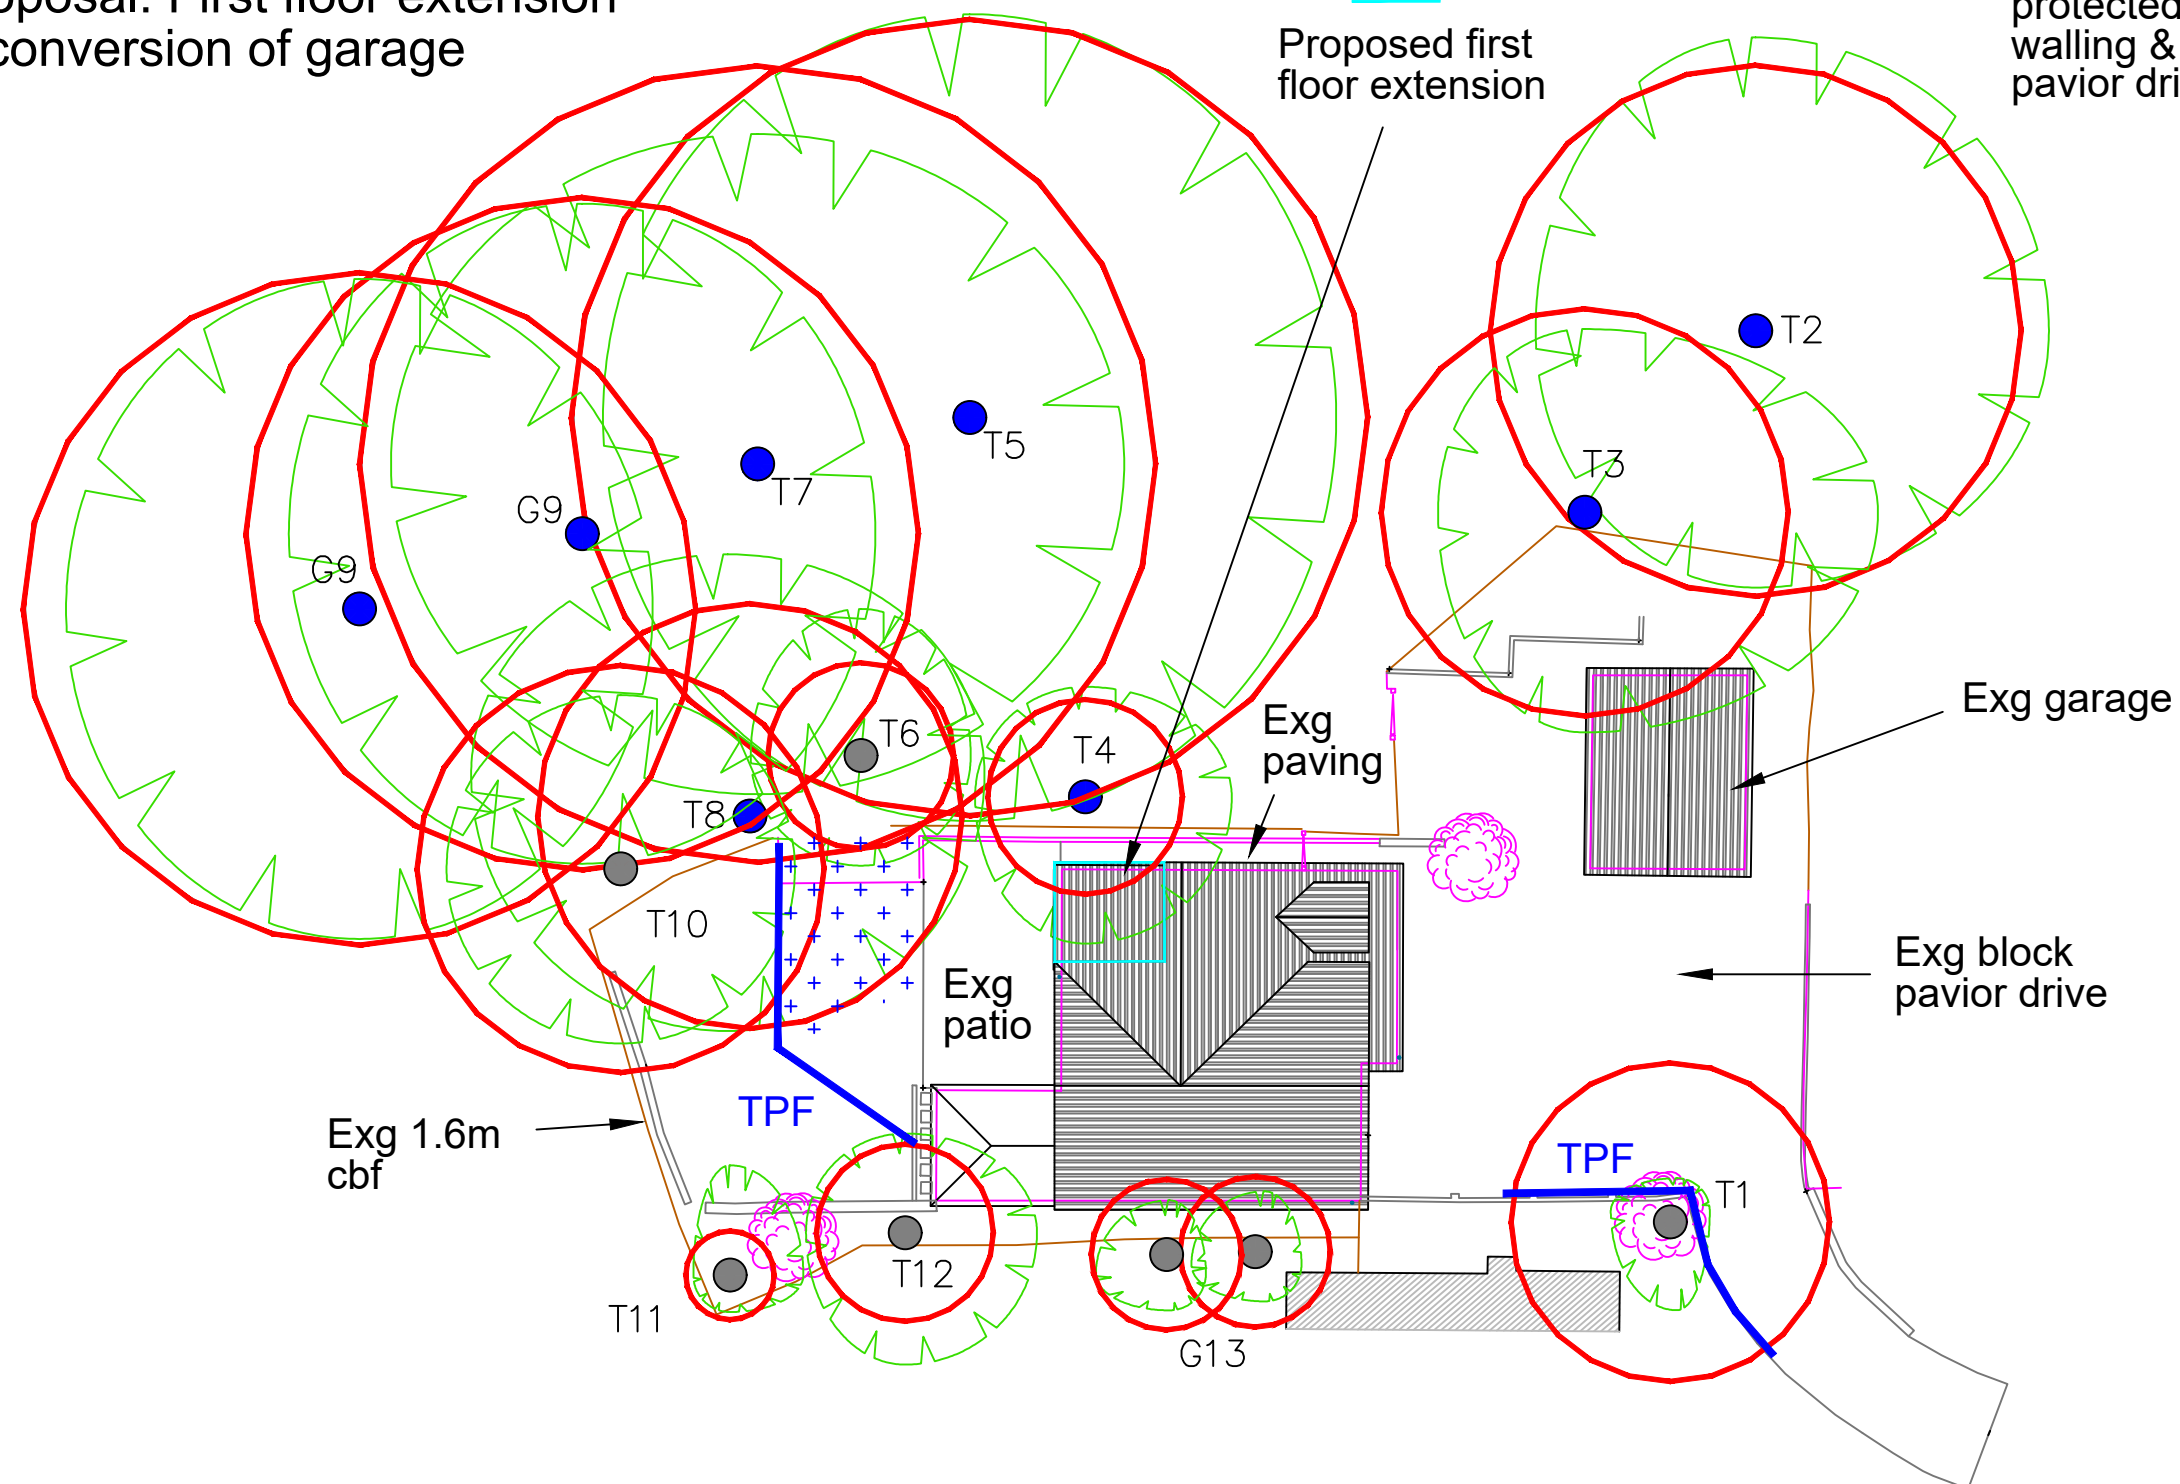

- Root Protection Area (RPA) (ref. BS5837:2012)
- Category A
- Category B
- Category C
- Category U
- Tree to be removed
- Ground protection
- TPF Tree protective fencing

Plan to be printed in colour and to scale

DRAWING TITLE

Tree Protection Plan

50 Bradmore Way
Lower Earley
RG6 4DS

SCALE	DATE	DRAWN BY
1:200 (A3)	14.07.25	AP
DRAWING NUMBER	REV	
TPP/APA/AP/2025/076		

APArboriculture

15 Church Street
Weybridge
Surrey
KT13 8NA

Tel: 01932 450104

aparboriculture@gmail.com

www.aparboriculture.co.uk




Appendix 3


BS5837 Categorisation System



BS5837:2012 Categorisation System (Abbreviated)

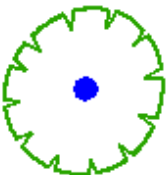Category A		<i>Trees of high quality with an estimated remaining life expectancy of at least 40 years. Particularly good specimens (A1); Trees, groups or woodlands of particular landscape significance (A2); Trees, groups or woodlands of significant conservation, historical or commemorative value (A3)</i>
Category B		<i>Trees of moderate quality with an estimated remaining life expectancy of at least 20 years. Trees of slightly lower individual quality (B1); Trees of collective value but of lesser overall landscape significance than Category A trees (B2); Trees with material conservation or cultural value (B3)</i>
Category C		<i>Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm. Unremarkable trees of limited merit (C1); Trees, groups or woodlands of low landscape value (C2); Trees with no material conservation or cultural value (C3)</i>
Category U		<i>Trees in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years (dead, declining and diseased trees etc.) It will normally be recommended that these trees be removed (unless they have particular conservation/ecological value)</i>

- Category A, B and C trees should be considered for retention
- Although Category C trees are generally of lower overall quality and landscape significance, they may still constitute a material planning constraint
- Category U trees are usually unsuitable for retention

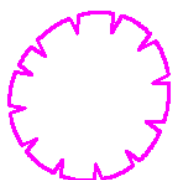

Tree to be removed (Category U trees and other trees where justification can be presented within context of development works being proposed)

The legal protection status of the trees will also be an important consideration regarding retention or otherwise of trees (see Section 2.3 of report)