

KP HOLDING GROUP LTD

LAND SOUTH OF SCHOOL ROAD, HURST, BERKSHIRE RG10 0DB

**INFILTRATION TEST REPORT
STATUS FINAL**

Reference: 1753/IR

20th June 2025

**CLIENT: KP Holding Group Ltd
3 Lloyd Road, Broadstairs,
Kent, United Kingdom,
CT10 1HY**

**SITE: Land South of School Road,
Hurst, RG10 0DB**

INFILTRATION TEST REPORT

Reference: 1753/IR

20th June 2025

Prepared By:

**Peter Baxter Associates
Kestner Works
Bredgar Road
Gillingham]
Kent
ME8 6PL
Tel: 01634 717974**

www.peterbaxterassociates.co.uk

Contents

FOREWORD

1.0	SUMMARY TEXT	1
1.1	Summary and Infiltration Tests Results.....	1
1.2	Site Location, Description, and Geology	1
1.3	Tests Dates, Locations and Methodology	2
1.4	Results and Comparison with Reference Values	2
2.0	REFERENCES	3

FIGURES

Figure 1 Test Location Plan	ii
-----------------------------------	----

APPENDICES

Appendix A DESK STUDY DATA

Appendix A 1 Geological Maps.....	v
-----------------------------------	---

Appendix B FIELD DATA

Appendix B 1 Trial Pits Logs.....	vii
Appendix B 2 Infiltration Test Reports.....	viii

APPENDIX C 1 Photographs	ix
---------------------------------------	-----------

FOREWORD

1. This document has been prepared by Peter Baxter Associates Ltd with all reasonable skill, care, and diligence within the terms of the contract with the Client and within the limitations of the resources devoted to it by agreement with the client.
2. This document is confidential to the Client and Peter Baxter Associates Ltd accepts no responsibility whatsoever to third parties to whom this document, or any part thereof, is made known. Any such party relies upon the document at their own risk.
3. This document shall not be used unless the document status is 'Final', and Peter Baxter Associates Ltd's fees have been settled in full.
4. Unless specifically assigned or transferred within the terms of the agreement, the consultant asserts and retains all Copyright, and other intellectual Property Rights in and over the Report and its contents.

1.0 SUMMARY TEXT

1.1 Summary and Infiltration Test Results

1.1.1 Peter Baxter Associates (PBA) were commissioned by the Client: KP Holding Group Ltd, to carry out six infiltration tests on their proposed development site at Hurst, School Road Reading, to the procedure detailed in BRE365 (1). These pits were conducted as follows, for INFL01 and INFL02, the pits were excavated to a depth of 2 meters; for INFL03 to INFL06, the pits were 0.6 to 0.7m deep.

Trial pits locations were specified by the Client's advisers. The subsoils was found to be a clayey sand and a gravely sand, which was consistent with geological maps of the Site. The test locations are shown in Figure 1, and the pits logs are presented in Appendix B1.

1.1.2 The infiltration tests are denoted on the table below:

Reference	Test depth (m)	Infiltration rates		
		Cycle 1	Cycle 2	Cycle 3
INFL01	2	1.8×10^{-6}	2.4×10^{-6}	-
INFL02	2	No soakaway, groundwater rose in the pit		
INFL03	0.7	2.4×10^{-6}	-	-
INFL04	0.65	7.8×10^{-7}	-	-
INFL05	0.5	1.2×10^{-5}	5.9×10^{-6}	9.9×10^{-6}
INFL06	0.75	2.1×10^{-6}	2.1×10^{-6}	-

Table 1: infiltration test summary

The test reports are presented in Appendix B 2.

1.2 Site Location, Description, and Geology

1.2.1 The Site is a 1.2 ha plot of land situated at Hurst, School Road, in Reading. The postcode of the Site is RG10 0DB, and the National Grid coordinates of the centroid of the Site are 479650, 173370.

1.2.2 The Site is a green field that appeared to have been used as a pasture. The area was flat, grassed, with occasional mature trees. It is surrounded to the three sides by houses, and to the east by a primary school.

The site is illustrated in photos in APPENDIX C 1 **Photographs**. It is proposed to develop the Site for housing with 23 units.

- 1.2.3 Geological maps obtained from Reference (2) indicated that the Site geology in the areas of the infiltration tests was Kempton Park Gravel Member over Lambeth Group in the north of the site and London Clay to the south. Geological maps are included in Appendix A1.

1.3 Test Dates, Locations and Methodology

- 1.3.1 The tests were started on 21st May 2025 and completed on 22nd May 2025.
- 1.3.2 The test's locations and depth were specified with the Client's engineer and are shown in Figure 1. The locations were set out with a GPS using a mobile phone app from a sketch provided by the client.
- 1.3.3 Each location pit was excavated to specified depth with a minidigger and flooded with mains water. The water level was recorded with time at each pit. The pits were fenced with safety fencing and backfilled on completion of the tests. Due to the low permeability only one cycle of flooding was carried out at some of the pits. The infiltration rates were calculated as defined in BRE365 (1).

1.4 Results and Comparison with Reference Values

- 1.4.1 The infiltration tests, denoted INFL01, INFL03, INFL04, INFL05 and INFL06, gave lowest infiltration rates of 1.8×10^{-6} m/s, 2.4×10^{-6} m/s, 2.4×10^{-6} m/s, 7.8×10^{-7} m/s, 1.2×10^{-5} m/s, and 2.1×10^{-6} m/s, respectively. The test reports are presented in Appendix B 2.
- 1.4.2 These infiltrations were within the range of 1×10^{-5} m/s to 1×10^{-7} quoted in literature for fine sands and coarse silts and are therefore considered representative of the geology tested.
- 1.4.3 At location INFL02, the water level in the pit rose due to groundwater ingress.

Peter Baxter MSc BEng CEng MICE (Director)


For and on behalf of Peter Baxter Associates Ltd

2.0 REFERENCES

1. BRE. *BRE 365 Soakaway Design*. 2016.
2. *British Geological Survey*.

FIGURES

Figure 1 Test Locations

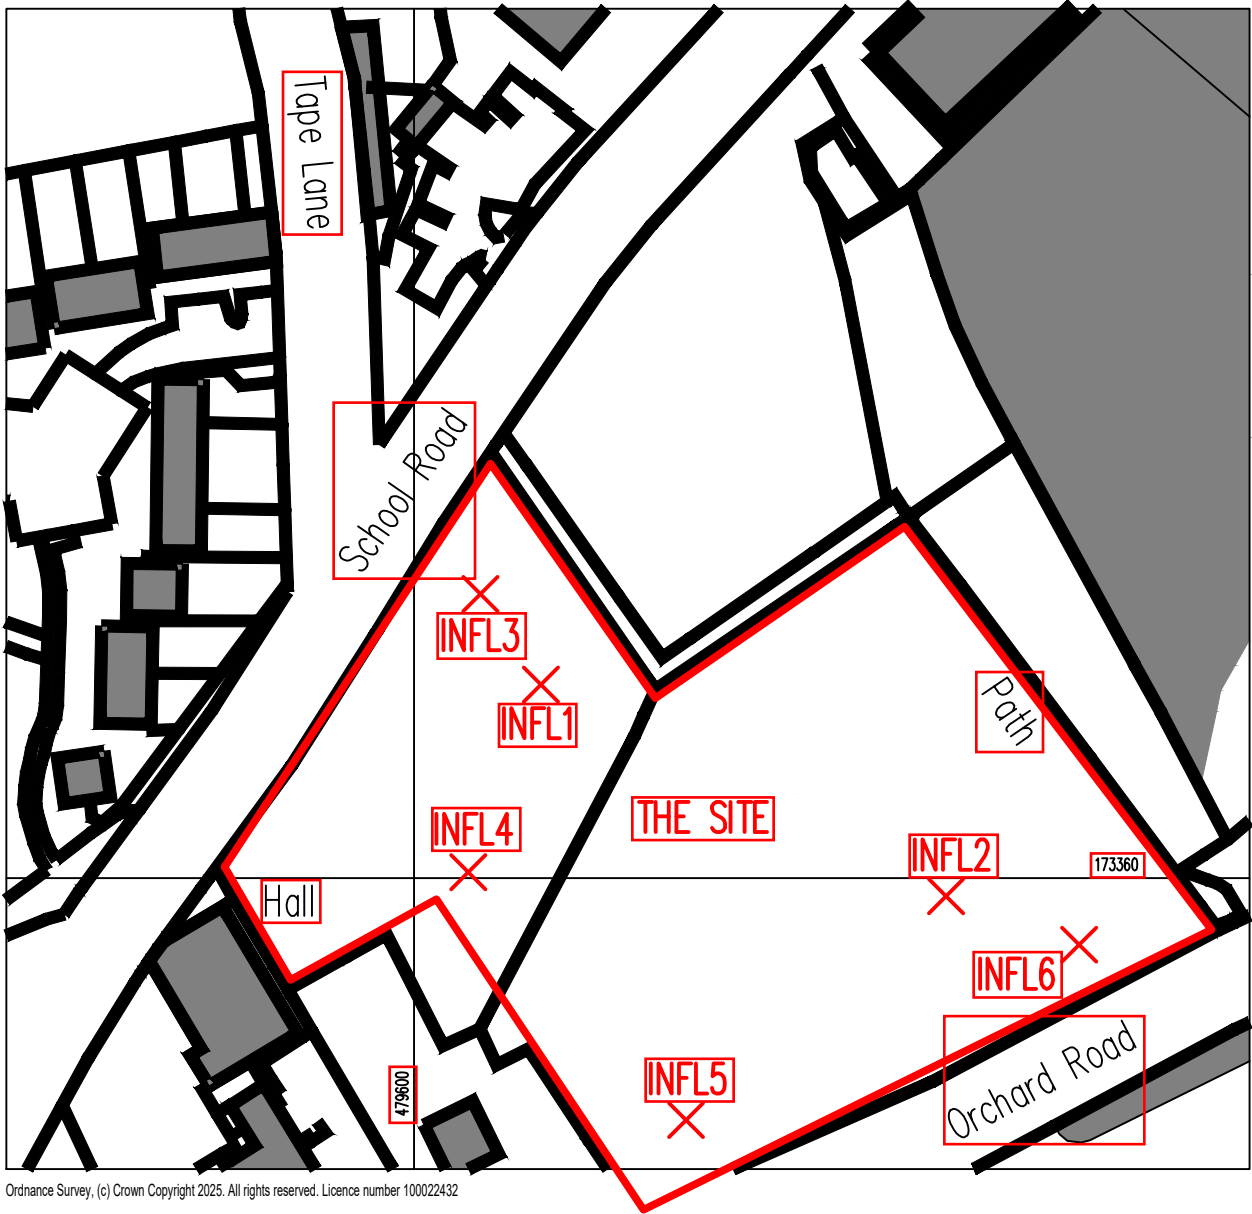

Location	Easting	Northing
INFL1	479621	173392
INFL2	479688	173357
INFL3	479611	173407
INFL4	479609	173361
INFL5	479645	173320
INFL6	479710	173349



Peter Baxter Associates Ltd, Kestner Works,
Bredgar Road, Gillingham, Kent ME8 6PL
Tel: 01634 717974

Client
KP Holding Group Ltd

Project
Hurst, School Road

Title
Test Location Plan

A	20.06.25	CD	PB	
Rev.	Date	Drn.	App.	Revision
Drawn CD			Checked PB	
Size A3	Scale 1:1250		Status Information	
Drawing No. 1753/Fig 1				Rev. A

APPENDICES

APPENDIX A DESK STUDY DATA

Appendix A 1 Geological Maps

Geology 1:50,000 Maps Legends

Artificial Ground and Landslip

Map Colour	Lex Code	Rock Name	Rock Type	Min and Max Age
	WMGR	Infilled Ground	Artificial Deposit	Not Supplied - Holocene
	WGR	Worked Ground (Undivided)	Void	Not Supplied - Holocene

Superficial Geology

Map Colour	Lex Code	Rock Name	Rock Type	Min and Max Age
	ALV	Alluvium	Clay, Silt, Sand and Gravel	Not Supplied - Holocene
	T1T2	River Terrace Deposits, 1 to 2	Sand and Gravel	Not Supplied - Holocene
	KPGR	KEMPTON PARK GRAVEL MEMBER	Sand and Gravel	Not Supplied - Devensian
	RTD3	River Terrace Deposits, 3	Sand and Gravel	Not Supplied - Quaternary
	RTD2	River Terrace Deposits, 2	Sand and Gravel	Not Supplied - Quaternary
	RTD4	River Terrace Deposits, 4	Sand and Gravel	Not Supplied - Quaternary
	RTD5	River Terrace Deposits, 5	Sand and Gravel	Not Supplied - Quaternary

Bedrock and Faults

Map Colour	Lex Code	Rock Name	Rock Type	Min and Max Age
	LC	London Clay Formation	Clay, Silt and Sand	Not Supplied - Ypresian
	LMBE	Lambeth Group	Clay, Silt and Sand	Not Supplied - Thanetian
	SNCK	Seaford Chalk Formation and Newhaven Chalk Formation (Undifferentiated)	Chalk	Not Supplied - Coniacian
		Faults		

Envirocheck®

LANDMARK INFORMATION GROUP®

Geology 1:50,000 Maps


This report contains geological map extracts taken from the BGS Digital Geological map of Great Britain at 1:50,000 scale and is designed for users carrying out preliminary site assessments who require geological maps for the area around the site. This mapping may be more up to date than previously published paper maps.

The various geological layers - artificial and landslip deposits, superficial geology and solid (bedrock) geology are displayed in separate maps, but superimposed on the final 'Combined Surface Geology' map. All map legends feature on this page. Not all layers have complete nationwide coverage, so availability of data for relevant map sheets is indicated below.

Geology 1:50,000 Maps Coverage

Map ID:	1
Map Sheet No:	268
Map Name:	Reading
Map Date:	2000
Bedrock Geology:	Available
Superficial Geology:	Available
Artificial Geology:	Available
Faults:	Not Supplied
Landslip:	Not Available
Rock Segments:	Not Supplied

Geology 1:50,000 Maps - Slice A

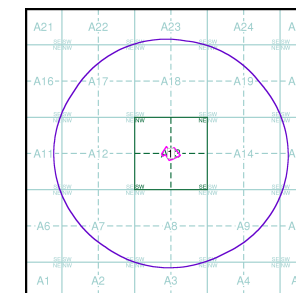

Order Details:


Order Number:	379526341_1_1
Customer Reference:	1753
National Grid Reference:	479650, 173370
Slice:	A
Site Area (Ha):	1.2
Search Buffer (m):	1000

Site Details:

Central Convenience Stores, The Street, Hurst, READING, RG10 0DB

Landmark®
LANDMARK INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

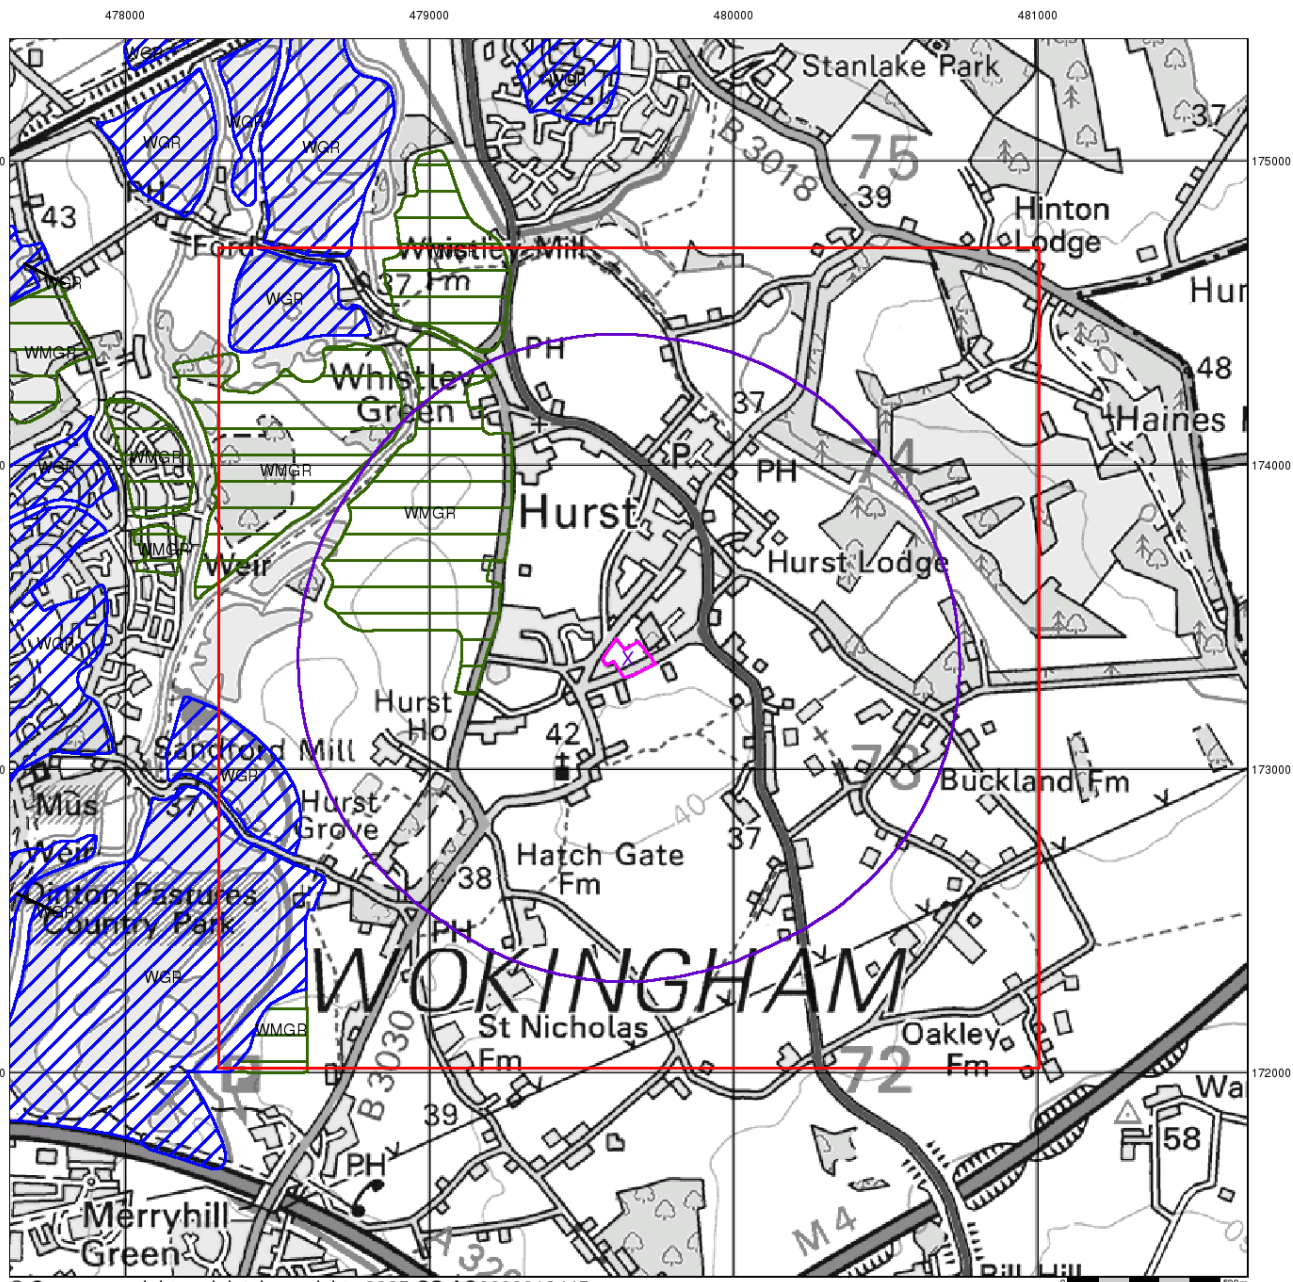

© Crown copyright and database rights 2025 OS AC0000813445

Envirocheck®

LANDMARK INFORMATION GROUP®

Artificial Ground and Landslip


Artificial ground is a term used by BGS for those areas where the ground surface has been significantly modified by human activity. Information about previously developed ground is especially important, as it is often associated with potentially contaminated material, unpredictable engineering conditions and unstable ground.

Artificial ground includes:

- Made ground - man-made deposits such as embankments and spoil heaps on the natural ground surface.
- Worked ground - areas where the ground has been cut away such as quarries and road cuttings.
- Infilled ground - areas where the ground has been cut away then wholly or partially backfilled.
- Landscaped ground - areas where the surface has been reshaped.
- Disturbed ground - areas of ill-defined shallow or near surface mineral workings where it is impracticable to map made and worked ground separately.

Mass movement (landslip) deposits on BGS geological maps are primarily superficial deposits that have moved down slope under gravity to form landslips. These affect bedrock, other superficial deposits and artificial ground. The dataset also includes foundered strata, where the ground has collapsed due to subsidence.

Artificial Ground and Landslip Map - Slice A

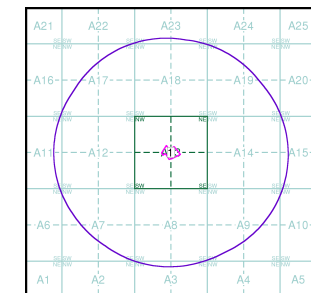

Order Details:

Order Number: 379526341_1_1
 Customer Reference: 1753
 National Grid Reference: 479650, 173370
 Slice: A
 Site Area (Ha): 1.2
 Search Buffer (m): 1000

Site Details:


Central Convenience Stores, The Street, Hurst, READING, RG10 0DB

Landmark®
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

v15.0 19-Jun-2025

Page 2 of 5

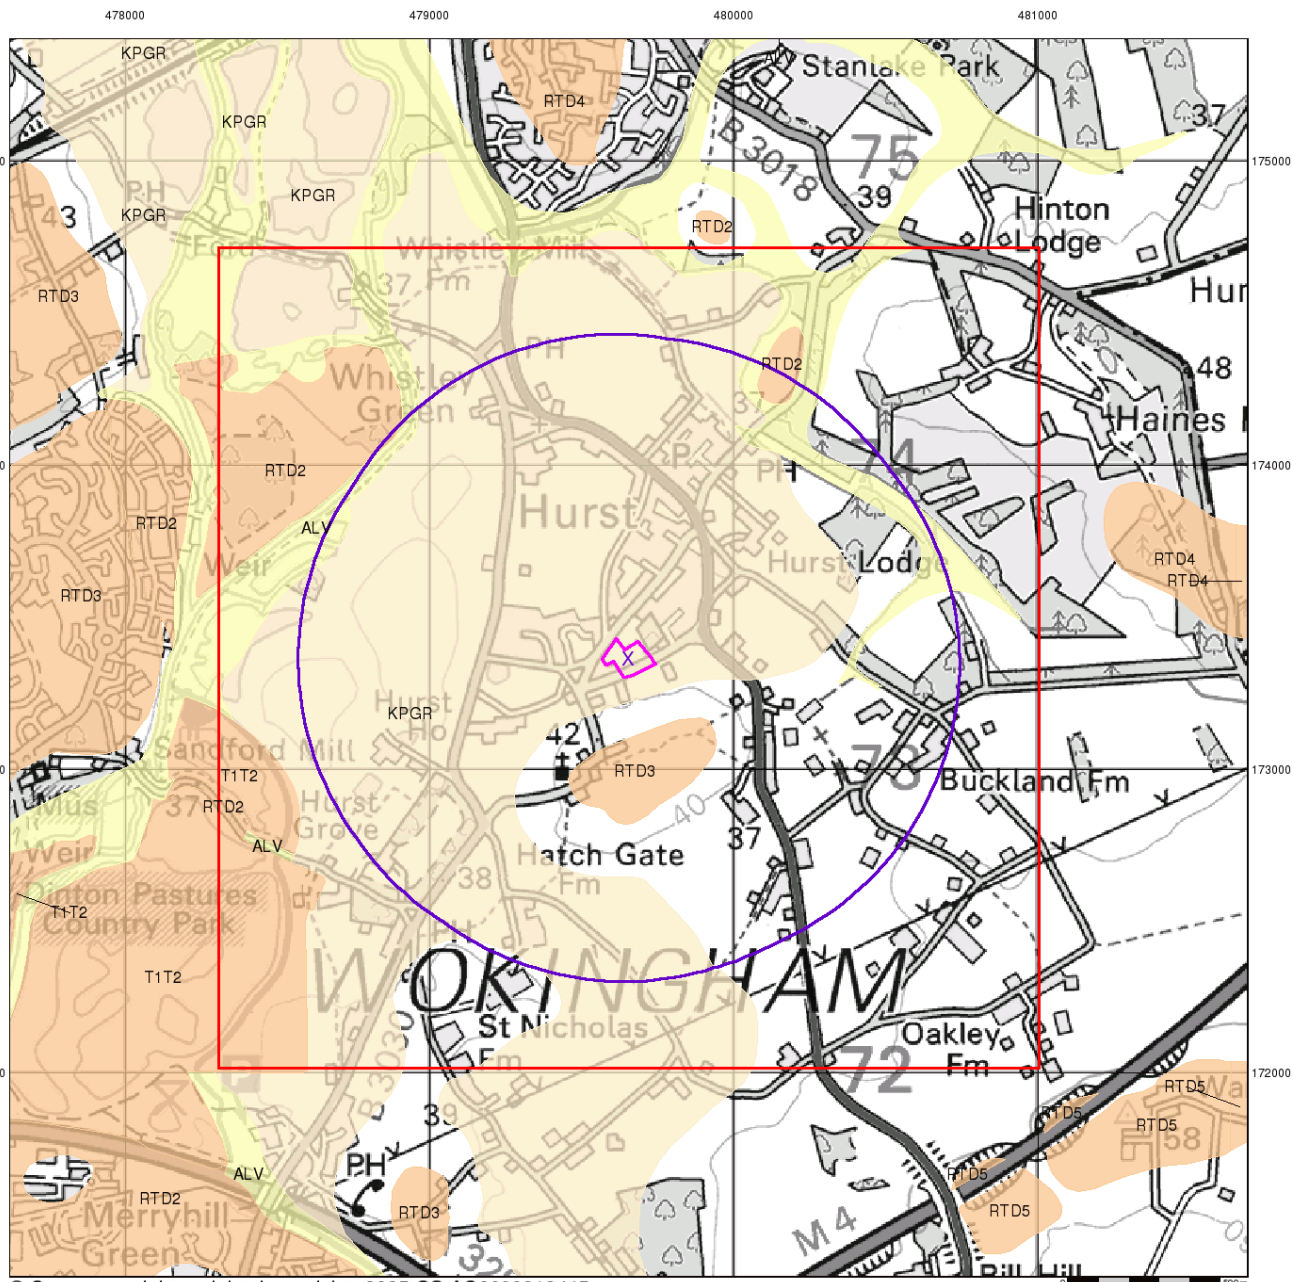

© Crown copyright and database rights 2025 OS AC0000813445

Envirocheck®

● LANDMARK INFORMATION GROUP®


Superficial Geology

Superficial Deposits are the youngest geological deposits formed during the most recent period of geological time, the Quaternary, which extends back about 1.8 million years from the present.

They rest on older deposits or rocks referred to as Bedrock. This dataset contains Superficial deposits that are of natural origin and 'in place'. Other superficial strata may be held in the Mass Movement dataset where they have been moved, or in the Artificial Ground dataset where they are of man-made origin.

Most of these Superficial deposits are unconsolidated sediments such as gravel, sand, silt and clay, and onshore they form relatively thin, often discontinuous patches or larger spreads.

Superficial Geology Map - Slice A

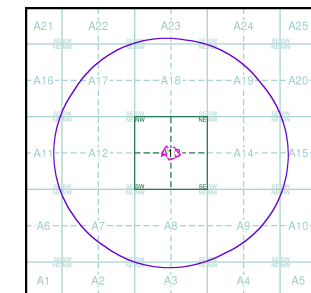

Order Details:

Order Number: 379526341_1_1
Customer Reference: 1753
National Grid Reference: 479650, 173370
Slice: A
Site Area (Ha): 1.2
Search Buffer (m): 1000

Site Details:


Central Convenience Stores, The Street, Hurst, READING, RG10 0DB

Landmark®
● LANDMARK INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

v15.0 19-Jun-2025

Page 3 of 5

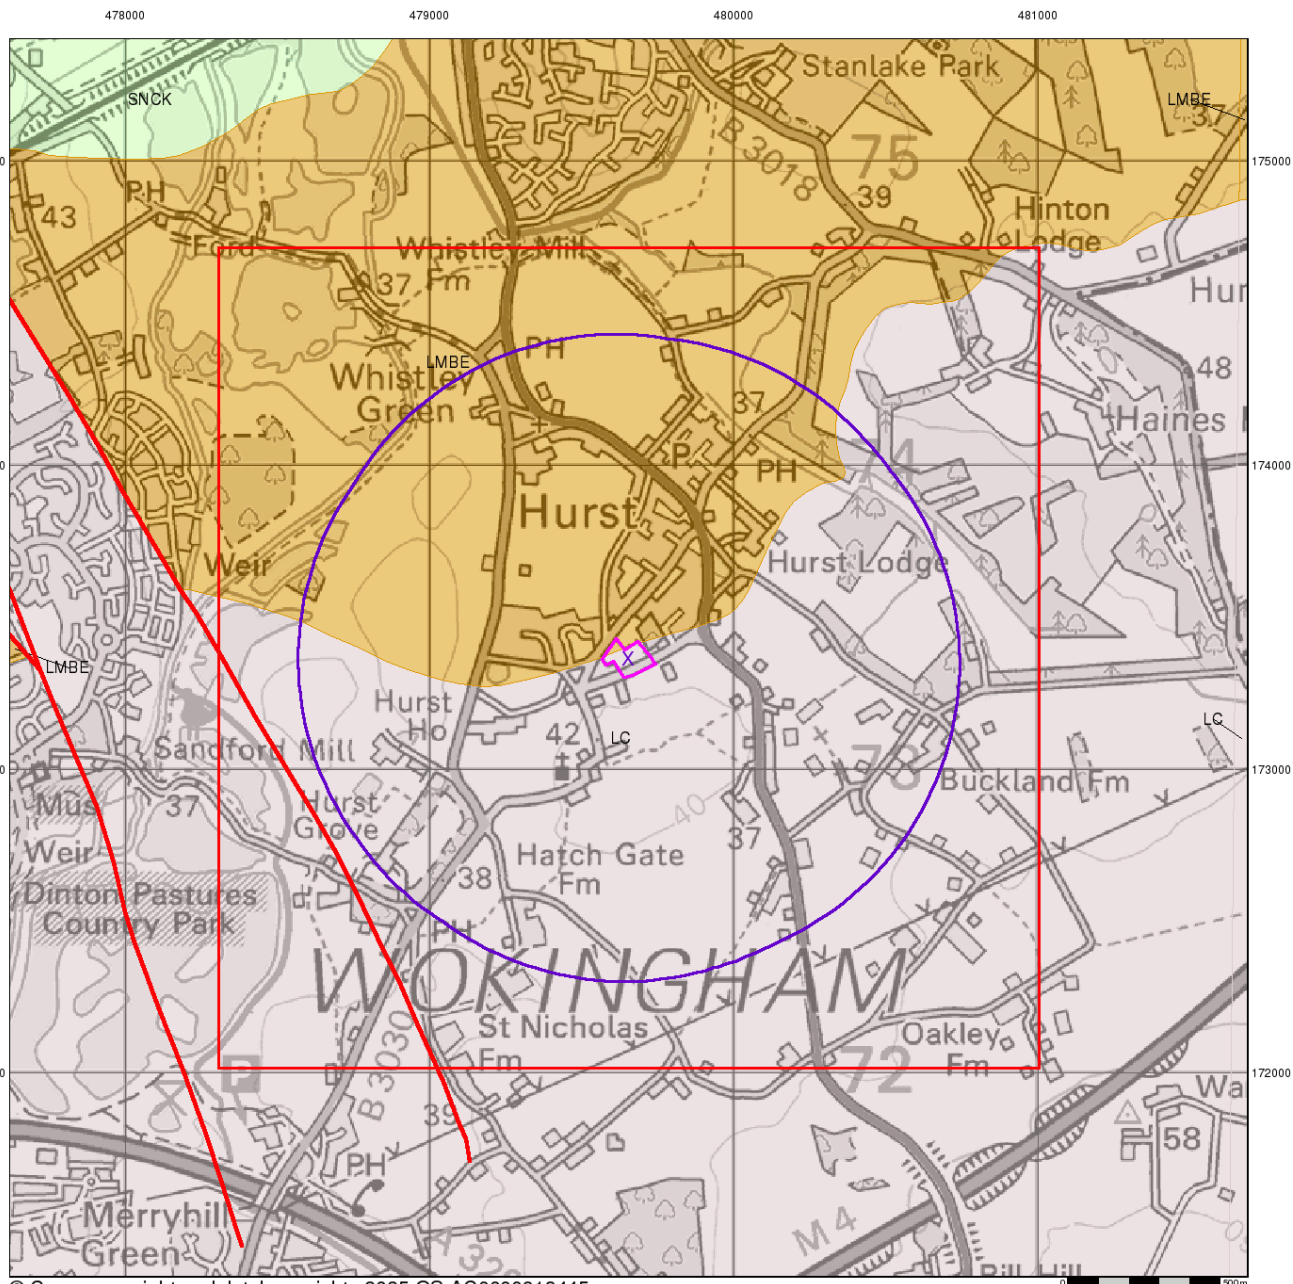

© Crown copyright and database rights 2025 OS AC0000813445

Envirocheck®

LANDMARK INFORMATION GROUP®

Bedrock and Faults


Bedrock geology is a term used for the main mass of rocks forming the Earth and are present everywhere, whether exposed at the surface in outcrops or concealed beneath superficial deposits or water.

The bedrock has formed over vast lengths of geological time ranging from ancient and highly altered rocks of the Proterozoic, some 2500 million years ago, or older, up to the relatively young Pliocene, 1.8 million years ago.

The bedrock geology includes many lithologies, often classified into three types based on origin: igneous, metamorphic and sedimentary.

The BGS Faults and Rock Segments dataset includes geological faults (e.g. normal, thrust), and thin beds mapped as lines (e.g. coal seam, gypsum bed). Some of these are linked to other particular 1:50,000 Geology datasets, for example, coal seams are part of the bedrock sequence, most faults and mineral veins primarily affect the bedrock but cut across the strata and post date its deposition.

Bedrock and Faults Map - Slice A

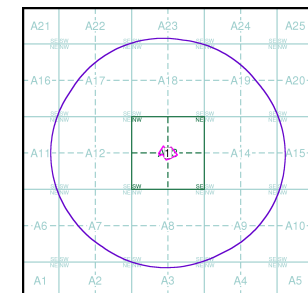

Order Details:

Order Number: 379526341_1_1
Customer Reference: 1753
National Grid Reference: 479650, 173370
Slice: A
Site Area (Ha): 1.2
Search Buffer (m): 1000

Site Details:


Central Convenience Stores, The Street, Hurst, READING, RG10 0DB

Landmark®
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

v15.0 19-Jun-2025

Page 4 of 5

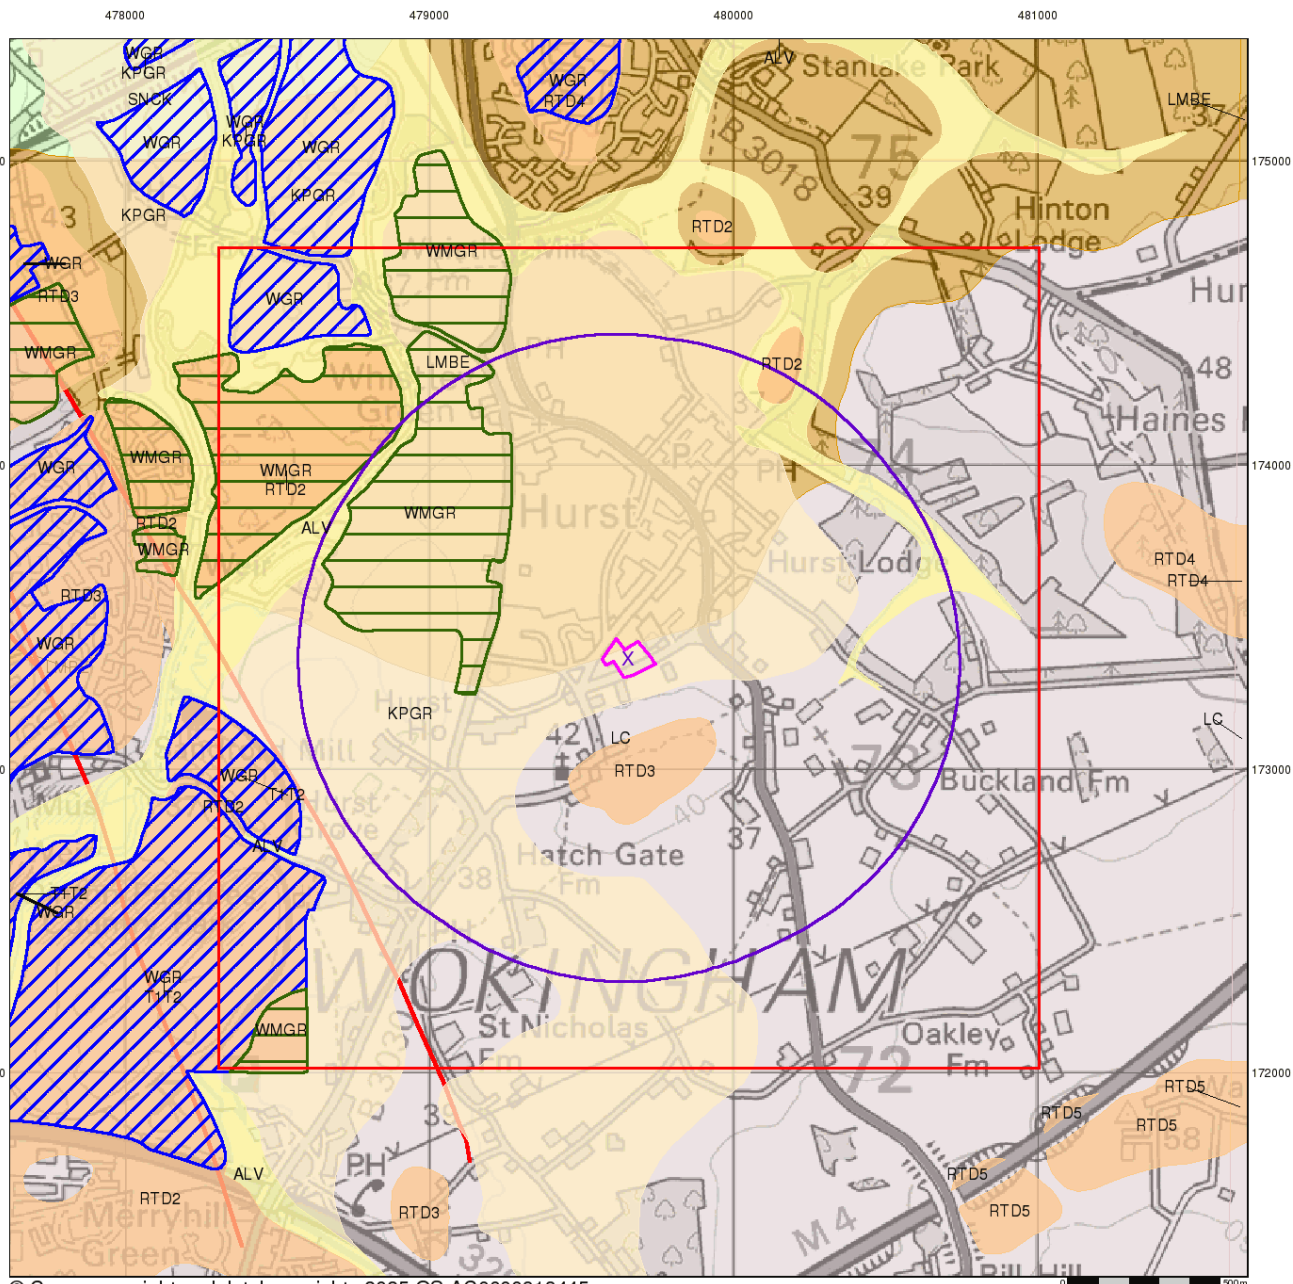

© Crown copyright and database rights 2025 OS AC0000813445

Envirocheck®

LANDMARK INFORMATION GROUP®

Combined Surface Geology

The Combined Surface Geology map combines all the previous maps into one combined geological overview of your site.

Please consult the legends to the previous maps to interpret the Combined "Surface Geology" map.


Additional Information

More information on 1:50,000 Geological mapping and explanations of rock classifications can be found on the BGS website. Using the LEX Codes in this report, further descriptions of rock types can be obtained by interrogating the 'BGS Lexicon of Named Rock Units'. This database can be accessed by following the 'Information and Data' link on the BGS website.

Contact

British Geological Survey
Kingsley Dunham Centre
Keyworth
Nottingham
NG12 5GG
Telephone: 0115 936 3143
Fax: 0115 936 3276
email: enquiries@bgs.ac.uk
website: www.bgs.ac.uk

Combined Geology Map - Slice A

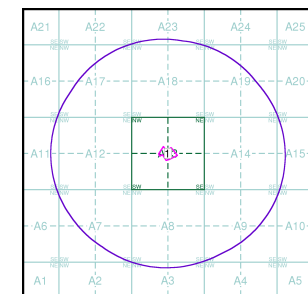

Order Details:

Order Number:	379526341_1_1
Customer Reference:	1753
National Grid Reference:	479650, 173370
Slice:	A
Site Area (Ha):	1.2
Search Buffer (m):	1000

Site Details:

Central Convenience Stores, The Street, Hurst, READING, RG10 0DB

Landmark®
INFORMATION GROUP

Tel: 0844 844 9952
Fax: 0844 844 9951
Web: www.envirocheck.co.uk

v15.0 19-Jun-2025

Page 5 of 5




APPENDIX B

FIELD DATA


Appendix B 1 Trial Pit Logs





Project Name: Hurst School Road					Client: KP Holding Group Ltd			Date: 21/05/2025			
Location: Land South of School Road, Hurst, Berkshire RG10 0DB					Contractor: CK Drilling			Co-ords: E479688.00 N173357.00			
Project No. : 1753					Crew Name:			Equipment: Minidigger			
Location Number INFL2		Location Type TP		Level 39.30m AoD		Logged By PB		Scale 1:10		Page Number Sheet 1 of 1	
Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description			
		Depth (m)	Type	Results							
					0.50	38.80		Topsoil			
					1.10	38.20		Orange brown gravelly SAND		1	
					2.00	37.30		Orange brown sandy GRAVEL		2	
								End of Borehole at 2.000m			
Dimensions				Trench Support and Comment				Pumping Data			
Pit Length		Pit Width		Pit Stability	Shoring Used	Remarks		Date	Rate	Remarks	
1.30		0.30		Stable	None						
Remarks											
Groundwater seepage. Ground level interpolated from client's PDF survey											



Project Name: Hurst School Road					Client: KP Holding Group Ltd				Date: 21/05/2025			
Location: Land South of School Road, Hurst, Berkshire RG10 0DB					Contractor: CK Drilling				Co-ords: E479611.00 N173407.00			
Project No. : 1753					Crew Name:				Equipment: Minidigger			
Location Number INFL3		Location Type TP		Level 39.00m AoD		Logged By PB		Scale 1:10		Page Number Sheet 1 of 1		
Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description				
		Depth (m)	Type	Results								
					0.50	38.50		Topsoil with rootlets				
								Yellow brown clayey fine SAND				
								0.70	38.30			
1 -												
2 -												
Dimensions				Trench Support and Comment				Pumping Data				
Pit Length		Pit Width		Pit Stability		Shoring Used		Remarks		Date	Rate	Remarks
1.30		0.30		Stable		None						
Remarks												
No groundwater. Ground level interpolated from client's PDF survey												
												



Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
					0.40	38.10		Topsoil with rootlets	1
								Brown very clayey medium SAND	
								End of Borehole at 0.650m	
					0.65	37.85			2




Remarks	
No groundwater. Ground level interpolated from client's PDF survey	





Trial Pit Log


Project Name: Hurst School Road		Client: KP Holding Group Ltd		Date: 21/05/2025	
Location: Land South of School Road, Hurst, Berkshire RG10 0DB		Contractor: CK Drilling		Co-ords: E479710.00 N173349.00	
Project No. : 1753		Crew Name:		Equipment: Minidigger	
Location Number INFL6	Location Type TP	Level 39.50m AoD	Logged By PB	Scale 1:10	Page Number Sheet 1 of 1

Well	Water Strikes	Sample and In Situ Testing			Depth (m)	Level (m)	Legend	Stratum Description	
		Depth (m)	Type	Results					
					0.30	39.20		Topsoil	1
								Orange brown clayey SAND	
					0.50	39.00		Orange brown sandy GRAVEL	
					0.75	38.75		End of Borehole at 0.750m	
									2

Dimensions		Trench Support and Comment			Pumping Data		
Pit Length	Pit Width	Pit Stability	Shoring Used	Remarks	Date	Rate	Remarks
1.20	0.30	Stable	None				

Remarks	
No groundwater. Ground level interpolated from client's PDF survey	

Appendix B 2 Infiltration Test Reports



Location: INFL1

Time (mins)	Dip (mBGL)
0	1.52
20	1.50
40	1.55
60	1.57
80	1.58
100	1.61
150	1.64
200	1.68
250	1.73
1250	1.98

1.8E-06

Remarks:




Project: Hurst School Road
Client: KP Holding Group Ltd

Job No. 1753
Date: 22/05/2025

Soakaway Test Cycle 2

Location: INFL1

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	2.00	1.30	0.30	0.20		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
1.5						
75% Full				1.63		
25% Full				1.88		
Volume Outflowing	0.0975					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	1.19			0 1 3 4 5 10 20 30 60 120 180 240 extrapolated 1000 1.50 1.51 1.52 1.52 1.52 1.54 1.54 1.55 1.57 1.60 1.64 1.68 2.00		
Time (mins) 75% full	180					
Time (mins) 25% full	740					

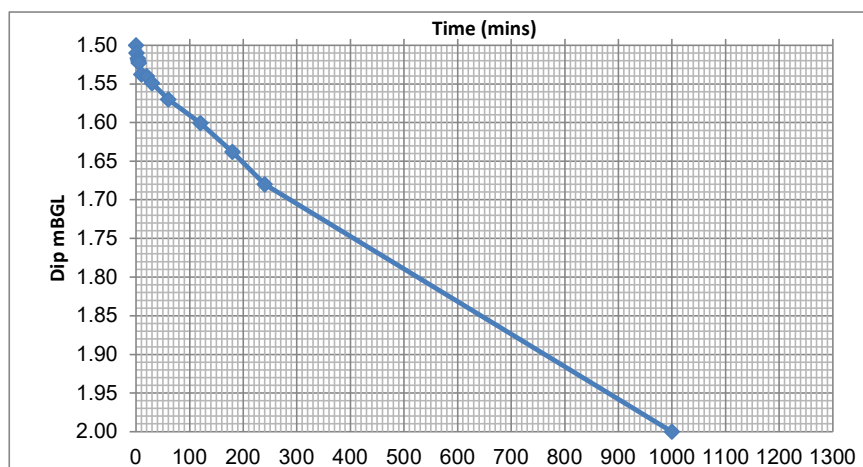

Soil Infiltration Rate F (m/s)

2.4E-06

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 1

Location: INFL3

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.70	1.30	0.30	0.16		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.29						
75% Full				0.39		
25% Full				0.60		
Volume Outflowing	0.07995					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	1.046			0 1 3 4 5 10 20 30 60 120 180 extrapolated 900 0.29 0.29 0.31 0.31 0.31 0.33 0.34 0.35 0.38 0.42 0.47 0.70		
Time (mins) 75% full	60					
Time (mins) 25% full	600					

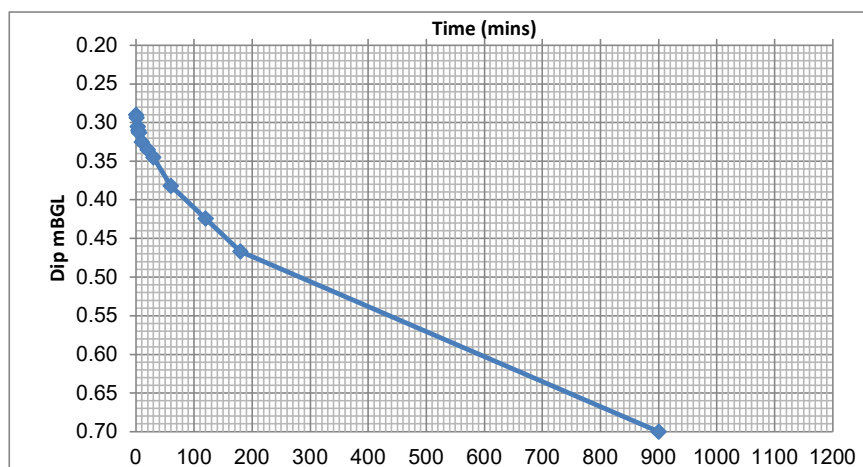

Soil Infiltration Rate F (m/s)

2.4E-06

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 1

Location: INFL4

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.65	1.50	0.30	0.16		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.3						
75% Full	0.118125			0.39		
25% Full	0.039375			0.56		
Volume Outflowing	0.07875					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	1.08			0 1 3 4 5 10 20 30 60 120 180 extrapolated 2400		
Time (mins) 75% full	450			0.30 0.30 0.31 0.31 0.32 0.34 0.34 0.34 0.35 0.36 0.36 0.60		
Time (mins) 25% full	2000					

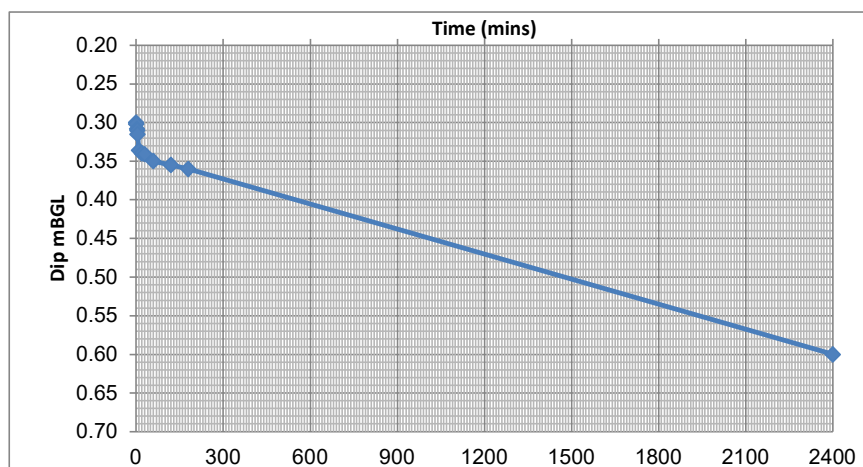

Soil Infiltration Rate F (m/s)

7.8E-07

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 21/05/2025

Soakaway Test Cycle 1

Location: INFL5

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.50	1.30	0.30	0.08		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.3						
75% Full				0.35		
25% Full				0.45		
Volume Outflowing	0.039					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	0.71			0 0.30		
Time (mins) 75% full	10			1 0.31		
				3 0.32		
Time (mins) 25% full	85			4 0.32		
				5 0.33		
				10 0.35		
				20 0.36		
				30 0.37		
				60 0.41		
			120 0.50			

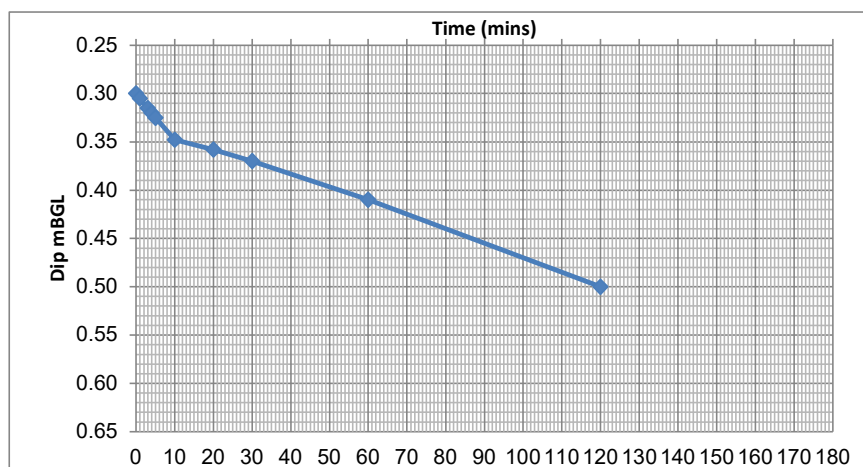

Soil Infiltration Rate F (m/s)

1.2E-05

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 2

Location: INFL5

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.50	1.30	0.30	0.08		
Minimum dip to water (mbgl)	Volume (m3)		Depth (m)			
0.29						
75% Full	0.061425		0.34			
25% Full	0.020475		0.45			
Volume Outflowing	0.04095					
	Area (m2)		Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)	
Mean surface Area	0.726		0 0.29			
			1 0.29			
			3 0.29			
Time (mins) 75% full	20		4 0.29			
			5 0.29			
			10 0.32			
Time (mins) 25% full	180		20 0.34			
			30 0.35			
			60 0.39			
			120 0.44			
			Extrapolated	180	0.45	

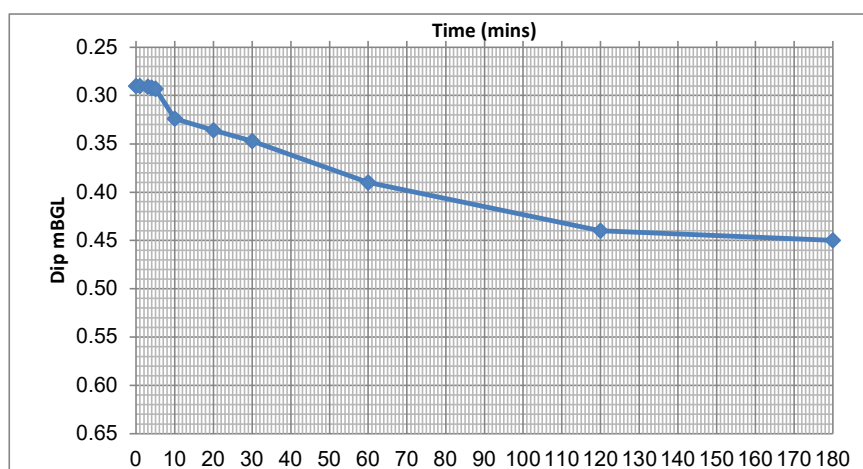

Soil Infiltration Rate F (m/s)

5.9E-06

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 3

Location: INFL5

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.50	1.30	0.30	0.08		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.29						
75% Full	0.061425			0.34		
25% Full	0.020475			0.45		
Volume Outflowing	0.04095					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	0.726			0 0.29		
Time (mins) 75% full	20			1 0.29		
				3 0.30		
				4 0.31		
				5 0.31		
				10 0.33		
Time (mins) 25% full	115			20 0.34		
				30 0.37		
				60 0.43		
				240 0.50		

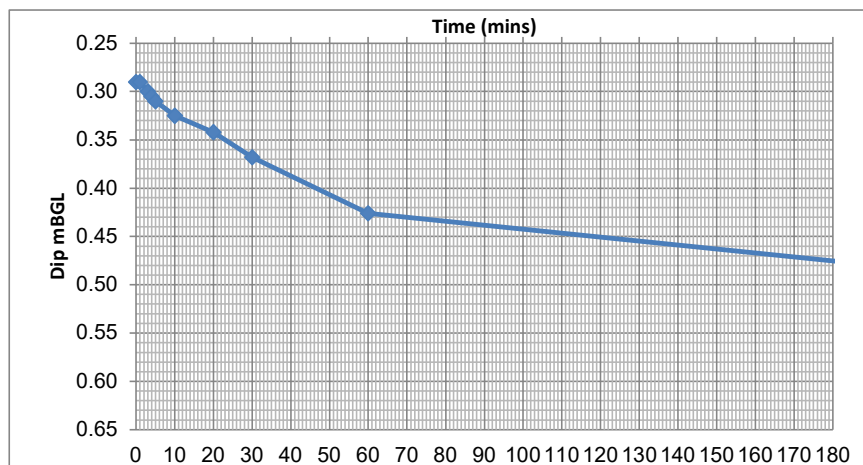

Soil Infiltration Rate F (m/s)

9.9E-06

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 1

Location: INFL6

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.75	1.20	0.30	0.15		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.34						
75% Full	0.1107			0.44		
25% Full	0.0369			0.65		
Volume Outflowing	0.0738					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	0.975			0 1 3 4 5 10 20 30 60 120 180 extrapolated 900 0.34 0.35 0.36 0.36 0.37 0.37 0.38 0.40 0.45 0.50 0.55 0.70		
Time (mins) 75% full	50					
Time (mins) 25% full	650					

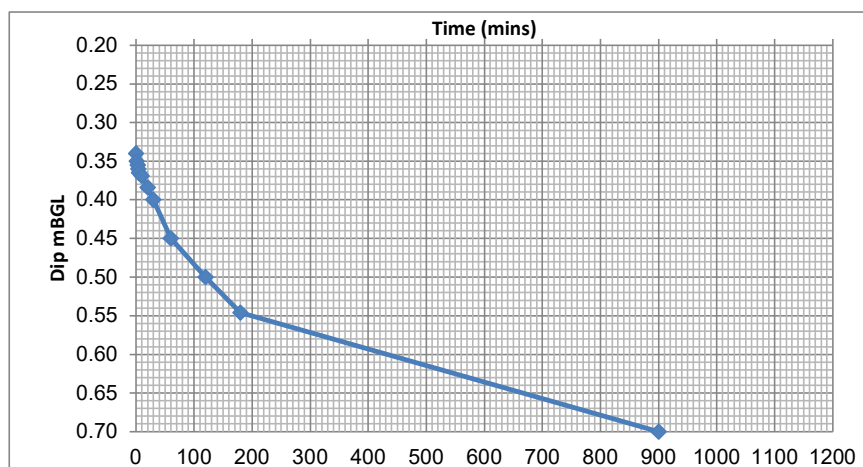

Soil Infiltration Rate F (m/s)

2.1E-06

Remarks:



Project: Hurst School Road

Job No. 1753


Client: KP Holdings Ltd

Date: 22/05/2025

Soakaway Test Cycle 2

Location: INFL6

<u>Trial Pit Details</u>	Depth (m)	Length (m)	Width (m)	Effective Storage Volume 2.41617		
Dimensions	0.75	1.20	0.30	0.16		
Minimum dip to water (mbgl)	Volume (m3)			Depth (m)		
0.3						
75% Full	0.1215			0.41		
25% Full	0.0405			0.64		
Volume Outflowing	0.081					
	Area (m2)			Time (24hr)	Elapsed Time (mins)	Dip to water (mbGL)
Mean surface Area	1.035			00.30 01.31 03.31 04.32 05.32 10.35 20.36 30.37 60.39 120.42 180.46 extrapolated900.70		
Time (mins) 75% full	100					
Time (mins) 25% full	730					

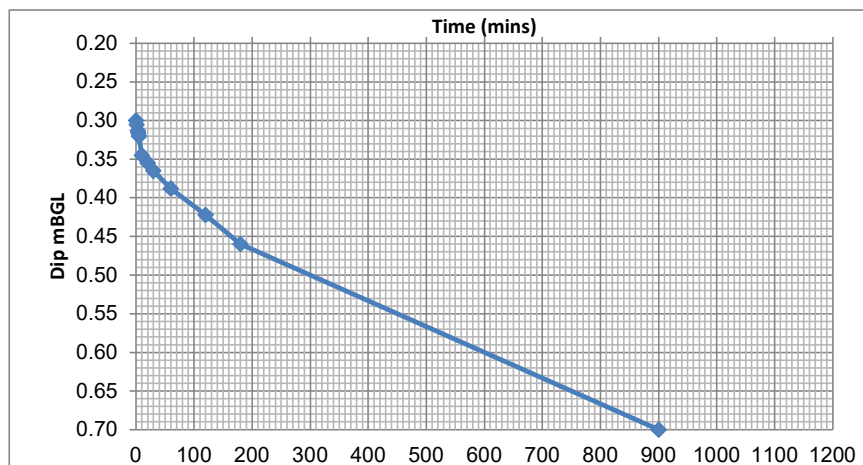

Soil Infiltration Rate F (m/s)

2.1E-06

Remarks:

APPENDIX C 1 Photographs



Excavation INFL1, top, view south to INFL5 bottom





View northeast to INFL1 top, view east to INFL2 bottom





View southwest to INFL5 top, view north along footpath bottom



00000



INFL 1



INFL2



INFL 3



INFL 4



INFL 5



INFL 6