



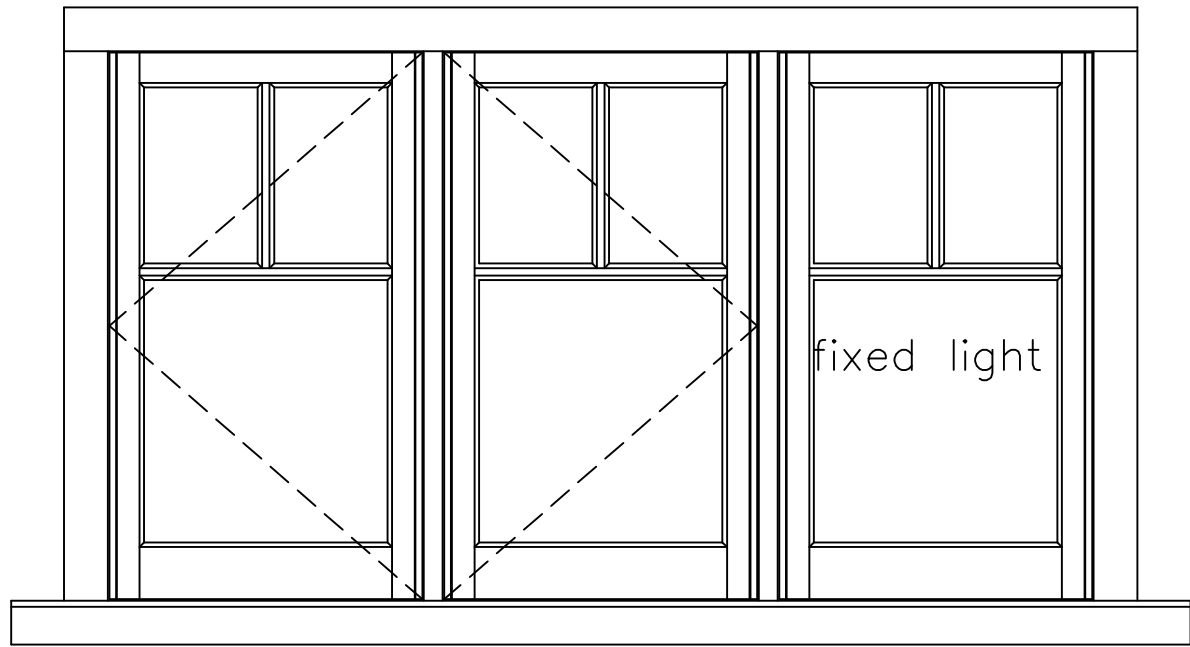


Window A External

Frame set back 60mm
into structural opening.
Cill nose projects 30mm from brickwork.
Cill is radiused and planted from previous
repair

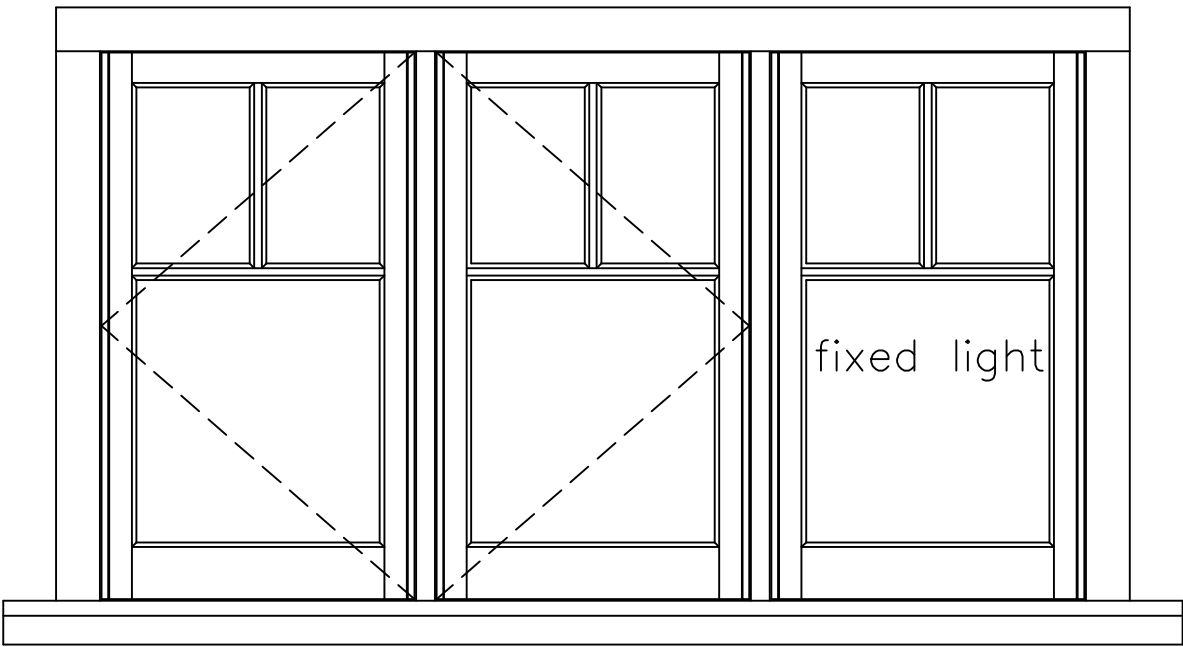


Window B External

Frame set back 60mm
into structural opening.
Cill nose projects 30mm from brickwork.
Cill is bull nosed and planted from
previous repair.

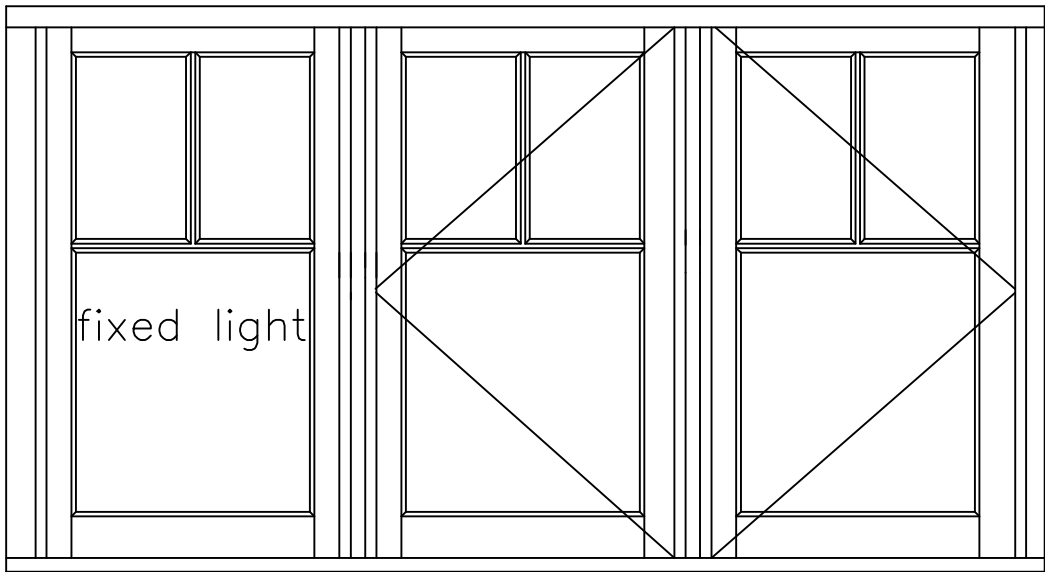


Window A Internal

Existing iron pear drop casement stays
and latch (with morticed keeps)
Pair of 5 knuckle hinges per opening light

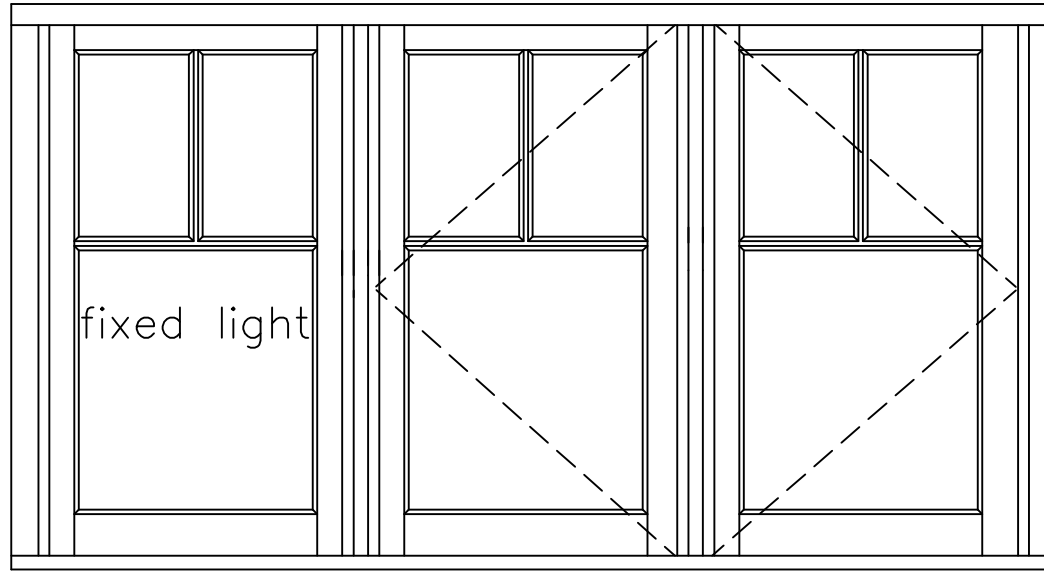


Window B Internal

Existing iron pear drop casement stays
and latch (with morticed keeps)
Pair of 5 knuckle hinges per opening light

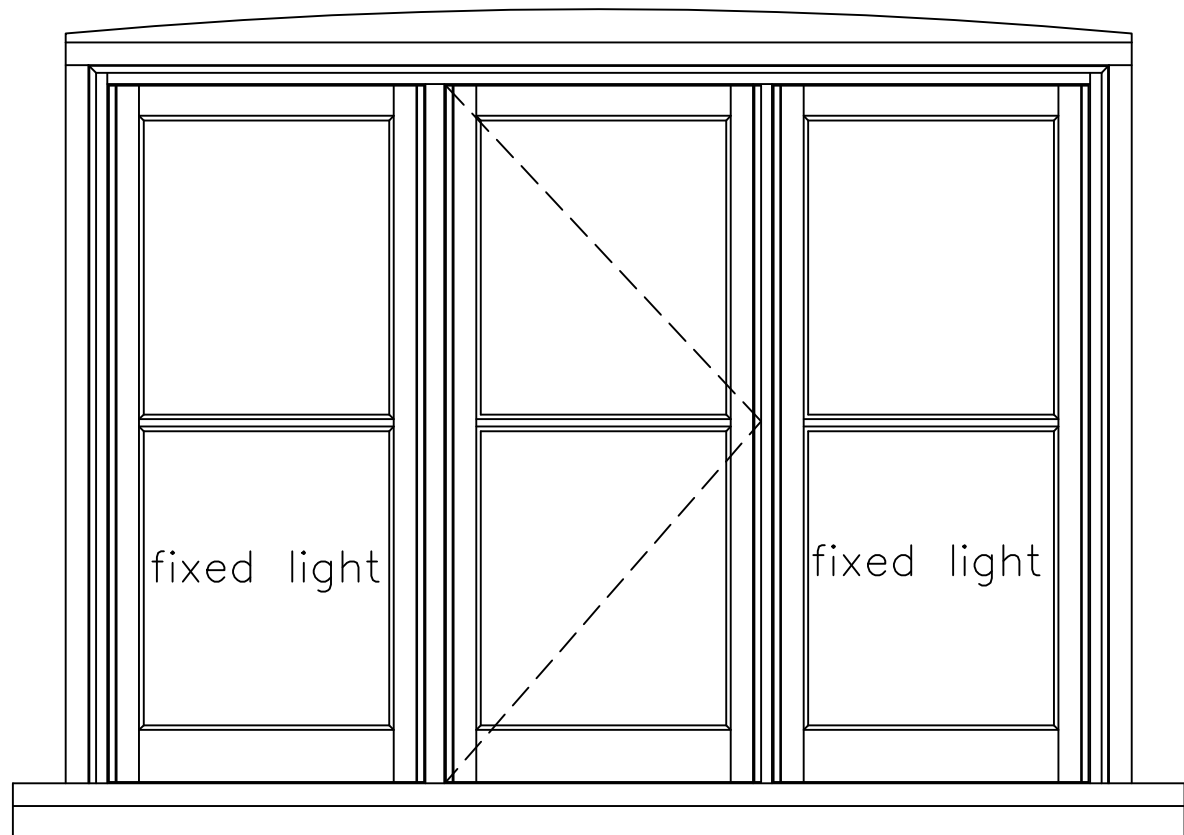


Window C External

Frame set back 6–10mm
into structural opening
Cill nose projects 60mm from brickwork.
Cill is bull nosed and planted from
previous repair

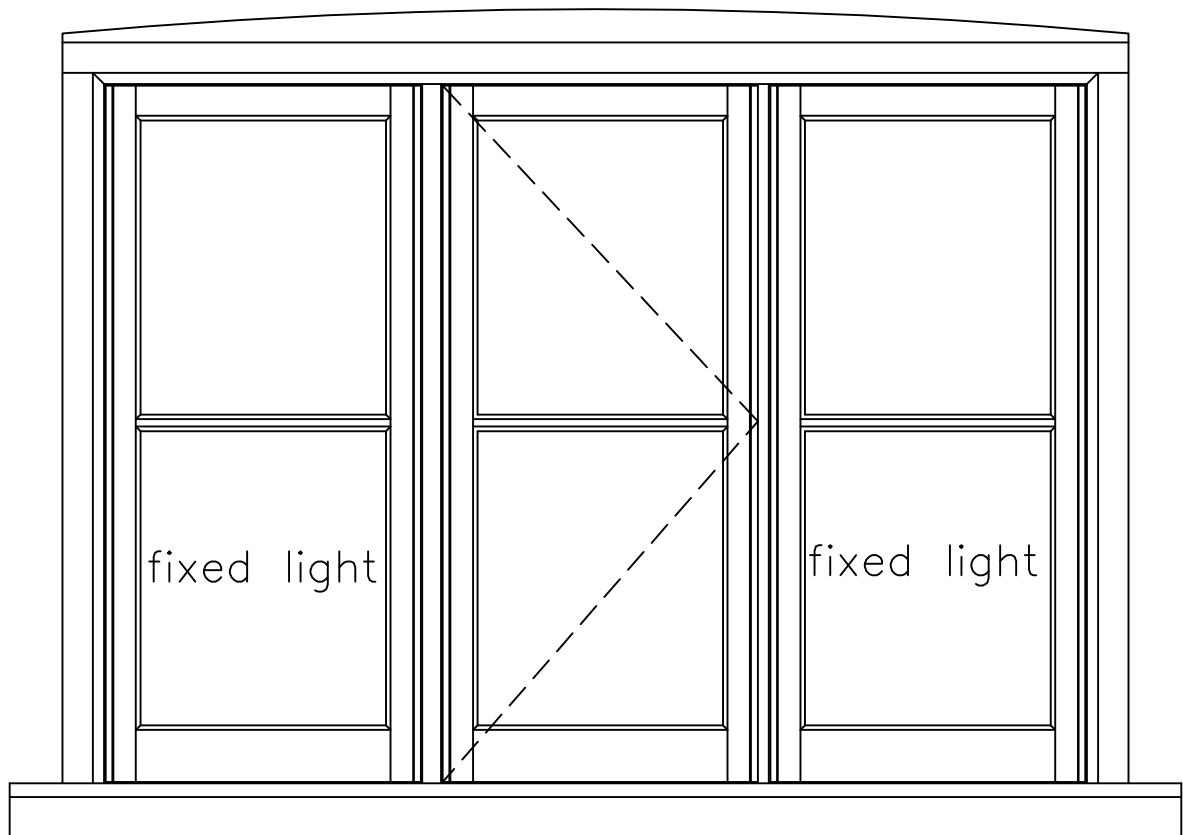


Window D External

Frame set back 6–10mm
into structural opening.
Cill projects 70mm from brickwork.
Cill is bull nosed and planted from
previous repair

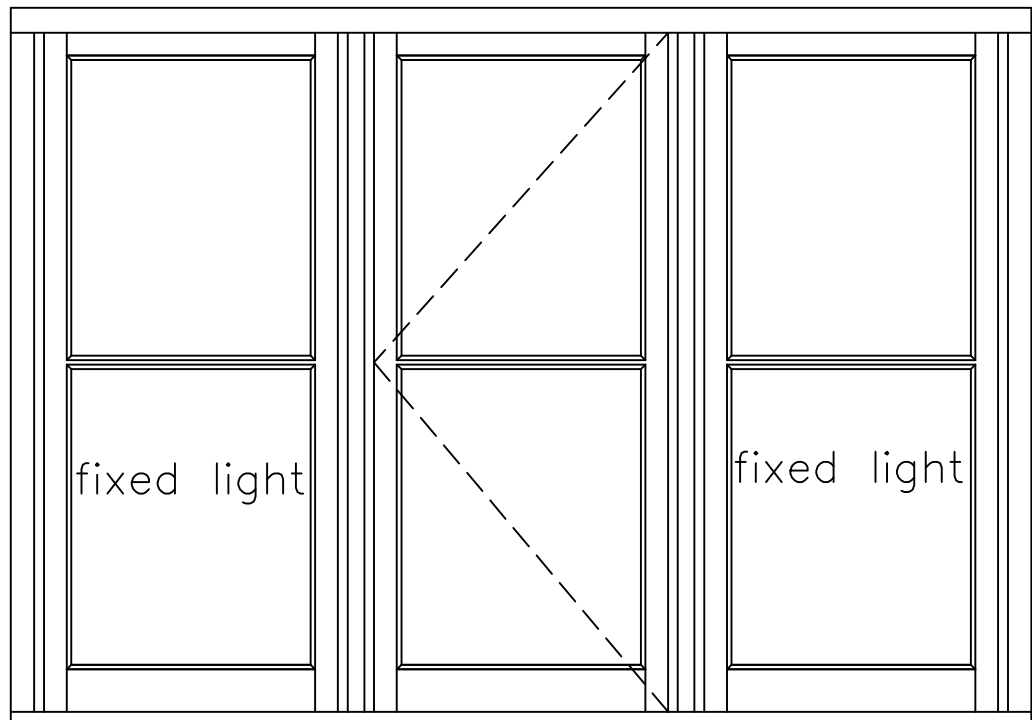


Window C Internal

Existing iron monkey tail casement stay
and latch (with morticed keeps)
Pair of 5 knuckle hinges per opening light

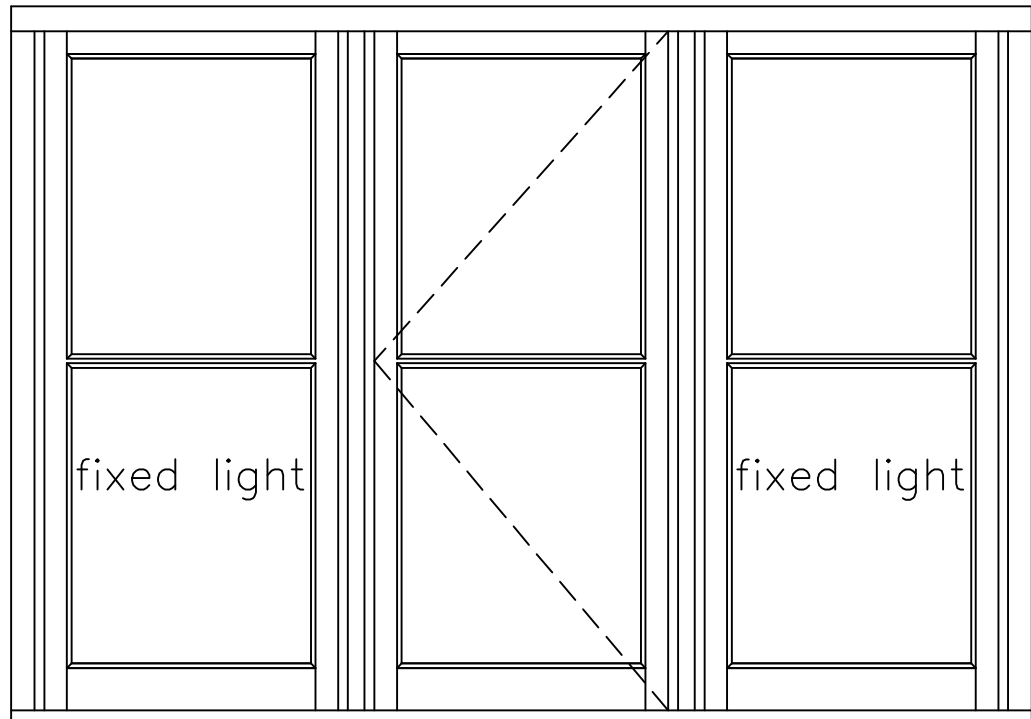

Window D Internal

Existing iron monkey tail casement stays
and latch (with morticed keeps)
Pair of 5 knuckle hinges per opening light.

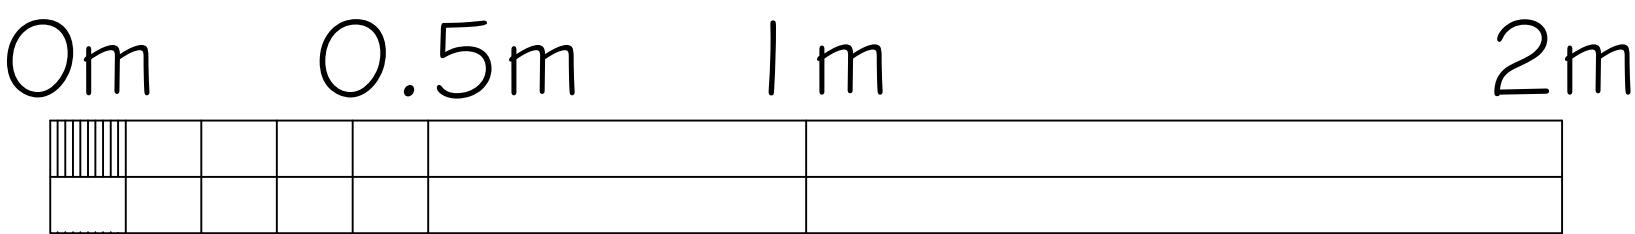


Measured Survey taken May 2025

11 HEADLEY ROAD
WOODLEY
BERKSHIRE
BERKS

HICKS DEVELOPMENTS

WINDOWS A TO D
EXISTING ELEVATIONS

SCALE 1:10 DATE 20.05.2025

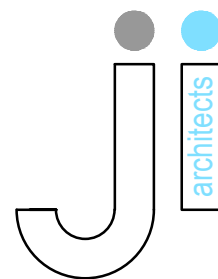

J I Architects
5 Butt Street
Minchinhampton
Gloucestershire GL6 9JP
01453 451 457
john@jiaarchitects.co.uk