

# HOGWOOD FARM, FINCHAMPSTEAD WOKINGHAM – LAND SOUTH OF P15

## Tree Survey Report and Arboricultural Impact Assessment



JSL2891\_791  
Tree Survey Report and  
Arboricultural Impact  
Assessment

04 October 2024

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

### Quality Management

| Version | Status   | Authored by | Reviewed by | Approved by | Review date |
|---------|----------|-------------|-------------|-------------|-------------|
| -       | Planning | RPS         | D. Cox      | D. Cox      | Oct 2024    |

### Approval for issue

David Cox

4.10 2024

### File/Model Location

**Document location:** P:\2800 Series\JSL2891 - Hogwood\Report

**Model / Appendices location:** P:\2800 Series\JSL2891 - Hogwood\Report

© Copyright RPS Group Plc. All rights reserved.

The report has been prepared for the exclusive use of our client and unless otherwise agreed in writing by RPS Group Plc, any of its subsidiaries, or a related entity (collectively 'RPS'), no other party may use, make use of, or rely on the contents of this report. The report has been compiled using the resources agreed with the client and in accordance with the scope of work agreed with the client. No liability is accepted by RPS for any use of this report, other than the purpose for which it was prepared. The report does not account for any changes relating to the subject matter of the report, or any legislative or regulatory changes that have occurred since the report was produced and that may affect the report. RPS does not accept any responsibility or liability for loss whatsoever to any third party caused by, related to or arising out of any use or reliance on the report.

RPS accepts no responsibility for any documents or information supplied to RPS by others and no legal liability arising from the use by others of opinions or data contained in this report. It is expressly stated that no independent verification of any documents or information supplied by others has been made. RPS has used reasonable skill, care and diligence in compiling this report and no warranty is provided as to the report's accuracy. No part of this report may be copied or reproduced, by any means, without the prior written consent of RPS.

Prepared by:

**RPS**

Prepared for:

**CALA Homes (Thames) Ltd**

Lakesbury House, Hiltingbury Road  
Hampshire SO53 5SS

**T:** +44 2380 810 440

**E:** rpsso@rps.tetrattech.com

CALA House, 54 The Causeway, Staines, TW18 3AX

**T:** 01784 225300

**E:**

## Contents

|   |                                       |    |
|---|---------------------------------------|----|
| 1 | INTRODUCTION.....                     | 1  |
| 2 | SITE LOCATION .....                   | 2  |
| 3 | SURVEY METHODOLOGY .....              | 4  |
| 4 | APPRAISAL AND RECOMMENDATIONS.....    | 5  |
| 5 | ARBORICULTURAL IMPACT ASSESSMENT..... | 7  |
| 6 | TREE WORKS.....                       | 10 |
| 7 | TREE PROTECTION MEASURES .....        | 11 |
| 8 | CONCLUSION .....                      | 13 |

## Tables

Table 1. Tree characteristics recorded during survey

## Appendices

- Appendix A Tree Constraints Plan JSL2891\_703, 708 and 714
- Appendix B Tree Protection and Removal Plan JSL2891\_783
- Appendix C Tree Survey Schedule JSL2891\_754\_P4\_P5
- Appendix E Example Tree Protection Barriers (BS5837:2012 Fig 2 & 3)
- Appendix F Construction Exclusion Zone (CEZ) Signage
- Appendix G Arboricultural Glossary

# 1 INTRODUCTION

- 1.1 This Tree Survey and Arboricultural Impact Assessment (AIA) has been prepared by RPS on behalf of CALA Homes (Thames) Ltd in respect of the development on land south of P15 at Hogwood Garden Village, Finchampstead, Wokingham, RG40 4RF.
- 1.2 This report refers to this land as part of the overall Hogwood Farm development scheme. The land parcel is located within the south-eastern section of the overall development site.
- 1.3 This report has been prepared in broad accordance with the requirements set out in BS5837:2010 'Trees in relation to design, demolition and construction – Recommendations.'<sup>1</sup>
- 1.4 The purpose of this report is to:
- Provide an assessment of the quality of the surveyed trees with reference to the categories and sub-categories listed within Table 1 - BS5837:2012.
  - Assess and quantify the arboricultural impact of the proposed development within the survey area, based on the proposed development layout.
  - Provide additional arboricultural information and advice in relation to the protection of trees throughout the development of the site.
  - Provide a Tree Protection and Removal Plan to detail the proposed protective measures to be taken in respect of the trees during development of the site.
- 1.5 The Tree Protection and Removal Plan included in Appendix B identifies the following:
- Trees to be retained
  - Trees to be removed
  - Alignment and design of protective fence
  - Root Protection Area (RPA) of trees
- 1.6 The Tree Protection and Removal Plan shall be made available to all relevant site operatives prior to and throughout the construction process, so they understand the scope and importance of the tree protection measures.
- 1.7 To minimise the potential for harm to occur to retained trees all works shall be carried out in accordance with the Tree Protection Measures and construction techniques detailed within this report.
- 1.8 In particular, the establishment of a Construction Exclusion Zone (CEZ) by erection of Tree Protection Fencing, will minimise the potential for harm to occur to retained trees.

---


<sup>1</sup> British Standards Institute. British Standard (BS5837) Trees in Relation to Design, Demolition and Construction - Recommendations. 2012.

## 2 SITE LOCATION

- 2.1 The survey covered a parcel of land comprising fields to the west of Hogwood Industrial Estate, Wokingham, RG40 4RF. The survey site is roughly centred on OS grid reference SU 76538 64185.
- 2.2 Wokingham is located within Berkshire in the south-east of England. The soilscape of the area in which the survey site is situated typically consists of 'slowly permeable, seasonally wet, slightly acid but base-rich loamy and clayey soils'<sup>2</sup>.

### Tree Preservation Orders\ Conservation Areas

- 2.3 A desktop investigation using the Wokingham Borough Council Interactive map<sup>3</sup> confirmed that there are a number of TPOs across the site, but that it does not fall within a conservation area, as shown below:

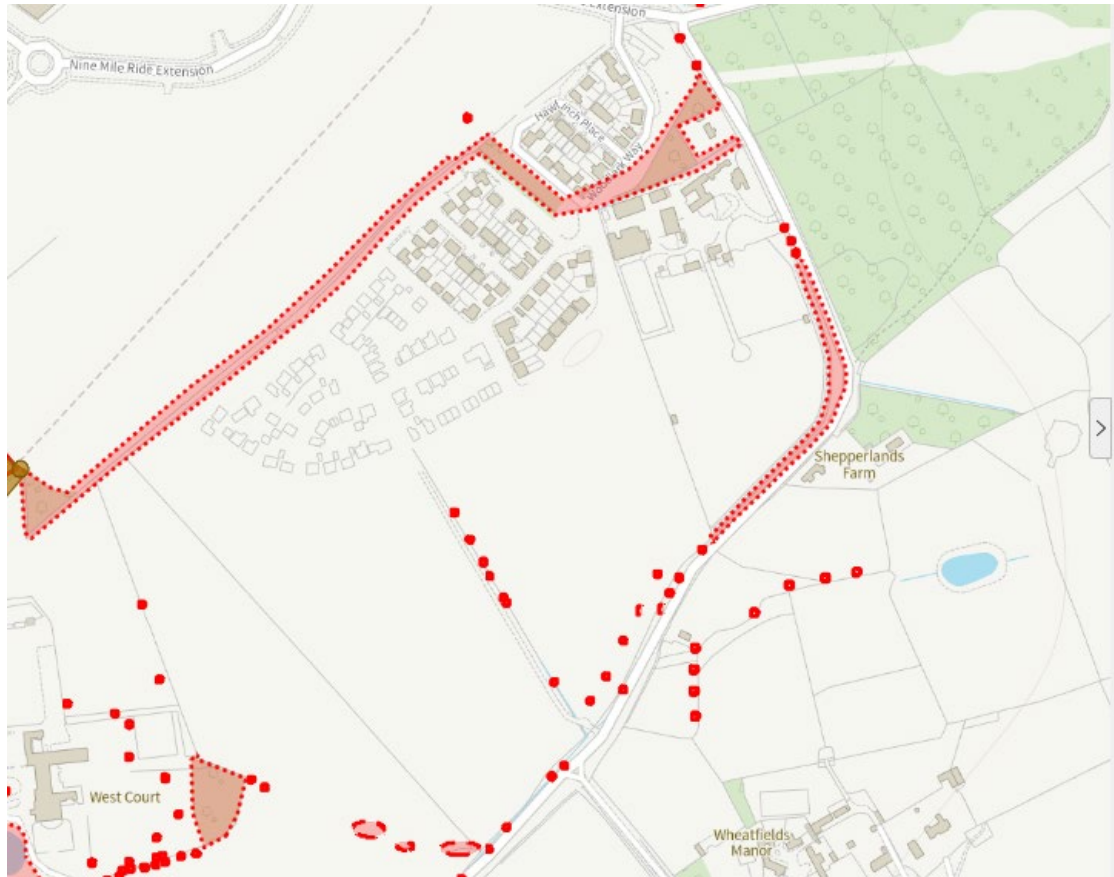


<sup>2</sup> <https://magic.defra.gov.uk/MagicMap.aspx>

<sup>3</sup> <https://wokingham.maps.arcgis.com/apps/webappviewer/index.html?id=19b3599d951e42dfaf32aa09568f5fcd>

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

- 2.4 A desktop investigation using Magic Map Application<sup>2</sup> confirmed that there are no Ancient Woodland located within or adjacent to this land.

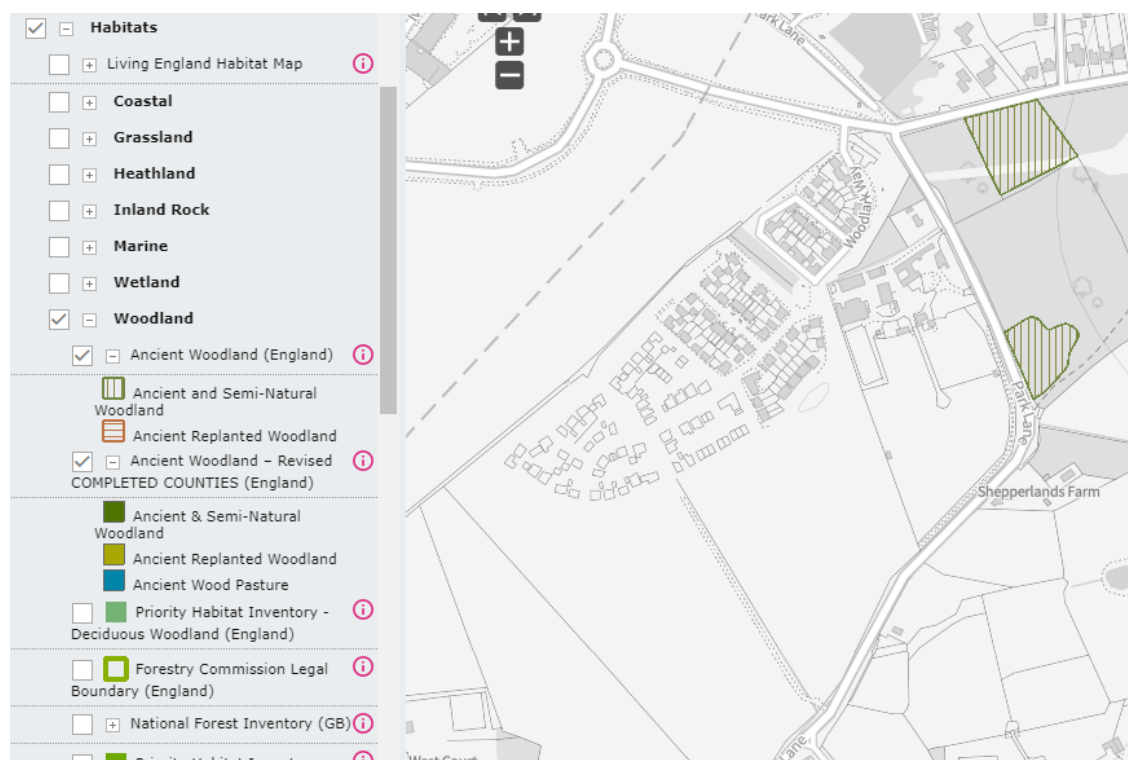

### Veteran Trees

- 2.5 The wider Hogwood tree survey identified five large oaks of great stature however, no Veteran trees were identified within this land.

### Tree Preservation Orders

- 2.6 A desktop investigation into the planning constraints on this site using the Wokingham Borough Council web map confirmed that there are several Tree Preservation Orders (TPOs) within close proximity to the site, albeit outside of the redline boundary. These orders have been plotted on the tree survey plan with the respective TPO reference and date.

TPO's in relation to The Site:

- 2.7 Individual order – Wokingham Borough Council reference –
- T14-1444-2012, RPS Tree Constraints Plan Reference – T2
  - T15-1444-2012, RPS Tree Constraints Plan Reference – T4
  - T16-1444-2012, RPS Tree Constraints Plan Reference – T5
- 2.8 'Individual' orders are applied to trees if they merit protection in their own right.
- 2.9 Trees covered by a Tree Preservation Order are protected under the Town and Country Planning Act 1990 (Trees Regulation 2012) and the local authority must be consulted and permission sought for any works that may affect them.

### 3 SURVEY METHODOLOGY

- 3.1 The report and survey were carried out in general accordance with the requirements set out in BS 5837:2012 "Trees in Relation to Design, Demolition and Construction – Recommendations".
- 3.2 The tree survey involved a visual inspection from the ground of individual specimens and groups of trees in order to record their amenity value, management recommendations and dimensions. Where observed, the general condition of all the trees has been noted. The survey does not constitute a full arboricultural condition assessment involving the detailed inspection of trees in relation to their structural condition, decay, and any other physical and pathogenic defects.
- 3.3 The locations of the trees were based upon topographic survey (22890-500-01) produced by Brunel Surveys Ltd in March 2021.
- 3.4 The survey assesses individual trees and groups of trees for quality and benefits within the context of proposed development. The quality of each tree or group of trees has been recorded by allocating it to one of four categories as described in table 1. These categories have been differentiated in Appendix A & B by colour.
- 3.5 The survey information was recorded on the attached schedule (Appendix C) in general accordance with the guidance contained within Section 4 of BS 5837:2012 "Trees in Relation to Design, Demolition and Construction - Recommendations".
- 3.6 See Table 1 for a breakdown of the information recorded during the survey.

#### Limitations

- 3.7 The findings of this survey are not valid following adverse or unpredictable weather conditions or for any failure due to 'force majeure' or unpredictable events.
- 3.8 Trees were not climbed or inspected below ground level and inaccessible trees will have best estimates made about the location, physical dimensions and characteristics. Where direct access to trees was difficult a '#' denotes this within the Tree Survey Schedule (Appendix C).
- 3.9 Trees and woody vegetation were not assessed for their potential impact upon future construction issues such as foundation designs (re: NHBC chapter 4.2)<sup>4</sup>. Whilst this report may assist in assessing likely future impacts, it should not be classed as a comprehensive vegetation survey in relation to impact upon future designs.
- 3.10 It is recommended that further arboricultural assessments be undertaken in order to assess the full health and safety of all trees which may possess structural or pathogenic conditions.

---

<sup>4</sup> NHBC. 'Chapter 4.2- Building Near Trees'. NHBC Standards 2016. 2016.

## 4 APPRAISAL AND RECOMMENDATIONS

### Generally

- 4.1 No trees were identified within the redline of development of this land.
- 4.2 3r individual mature oak trees (T2, T4 and T5) located just outside the west boundary of the land parcel were identified as being potentially impacted by the development of this land.
- 4.3 No trees are proposed for removal to accommodate the development of this land.

### Planning considerations

- 4.4 Trees can offer many benefits, including the provision of visual amenity, softening, or complementing the effect of the built environment, adding maturity to new developments and by making places more comfortable in tangible ways e.g. contributing screening and shade, reducing wind speed and turbulence, intercepting snow and rainfall, and reducing glare.
- 4.5 New tree planting opportunities should be considered as part of any potential redevelopment; this will help to broaden the age diversity of the tree cover within the area. Sufficient space should be provided for species with significant stature to grow out into maturity.
- 4.6 Under the UK planning system, local authorities have a statutory duty to consider the protection and planting of trees when granting planning permission for proposed development. The potential effect of development on trees, whether statutorily protected (e.g. by a tree preservation order or by their inclusion within a conservation area) or not, is a material consideration that is taken into account when dealing with planning applications.
- 4.7 Trees covered by a Tree Preservation Order are protected under the Town and Country Planning Act 1990 (Trees Regulation 2012). The local authority must be consulted, and permission sought for any works that may affect them.

### Design and Site Layout Considerations

- 4.8 A tree constraints plan defines the Root Protection Area (RPA) for each tree shown as a circle. This area may be adjusted should physical constraints or topographical features limit root activity in a particular area, however the total area should remain the same. Prior to any adjustment of the trees RPA zones the changes should be assessed by an arboriculturist. During any site planning exercises the current and future growth potential of the trees should be considered.
- 4.9 The RPA for single stem trees broadly equates to a radius 12 times the stem diameter of the tree at 1.5m above ground level or the extent of canopy spread, whichever is the greater. For multi-stemmed, low branching trees or those with trunks with an irregular girth the point of stem diameter measurement is adjusted in consideration of these factors and in accordance with the illustrations in BS5837:2012 (Annex C).
- 4.10 The RPA should become an exclusion zone during construction works and for any development. It should be fenced-off and protected in accordance with BS5837:2012. The canopy is likewise susceptible to damage during construction work and requires similar protection.
- 4.11 No activities that result in excavations, changes in level or soil compaction should take place within the RPA of any retained trees, especially older mature trees. This would include the

- storage of materials, any construction work, trafficking by vehicles or even excessive trafficking by pedestrians.
- 4.12 If some form of construction must take place within the RPA, then certain measures need to be adopted to avoid disturbance or damage to the roots and to maintain moisture infiltration and gaseous diffusion into the soil.

## Services

- 4.13 Services likewise should be routed outside the existing or potential root zone of trees. Where it is unavoidable, then certain measures should be employed to avoid damage to the tree's larger roots.
- 4.14 The location and siting of new facilities near trees should consider the potential impact on and conflict with both tree roots and canopy. This should consider the ultimate size of existing young and middle-aged trees at maturity. Conversely the impact of the tree on the activities should also be considered regarding obstruction, shading, leaf fall and root action. These are problems that can be managed provided sufficient space is allowed for.
- 4.15 Any new services should avoid the RPAs of any retained tree. Where it is unavoidable, then the route of the services must be designed by an Engineer in consultation with an Arboriculturist.
- 4.16 Further advice can be found in NJUG Volume 4- "Guidance for the planning, installation and maintenance of utility services in proximity of trees".<sup>5</sup>

## Trees and Management of Health and Safety

- 4.17 It is recommended that a programme of periodic arboricultural assessments be undertaken in order to regularly assess the full health and safety of all trees both in full leaf and bare stemmed. The assessments should prioritize areas based on levels of access and presence of target (i.e. exposure of people to hazard) and accord with arboricultural advice, taking account of relevant factors (where known) that affect safety such as the age class, condition, size and species of the trees.

---

<sup>5</sup> N.J.U.G. 4: Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees. 2007

## 5 ARBORICULTURAL IMPACT ASSESSMENT

### Introduction

- 5.1 Trees have finite energy reserves, developed each year throughout the growing season, which are utilised for biological processes such as growth and defence against pests or diseases throughout the following year.
- 5.2 Any development in proximity to trees has the potential to cause harm to those trees unless control measures are identified and acted upon; as such it is essential to consider the relationship between the proposed development and the retained trees to identify what precautions are necessary, proportionate and appropriate.
- 5.3 Development has the potential to impact upon the above ground and below ground parts of trees. Whilst some damage that can occur, such as physical damage to the trees stems and branches from machinery movements, is clearly visible, the impact from other aspects of work common on development sites, which can have a significant effect upon the continued health of trees, are not always immediately evident.
- 5.4 Damage that is not immediately evident, but which can cause long term harm to retained trees, includes things such as damage to the soil structure by compaction causing root damage and levels changes altering the water table and affecting moisture availability.
- 5.5 To minimise the potential for harm to occur to retained trees all works must be carried out with regard to the Tree Protection measures detailed within this report.
- 5.6 In general, it can be seen that, by adopting appropriate methods of working, precautionary and protective measures, significant harm to retained trees can be avoided.
- 5.7 In particular the establishment of a Construction Exclusion Zone (CEZ) by erection of Tree Protection Fencing will minimise the potential for harm to occur to retained trees.
- 5.8 The retention and protection of significant trees and vegetation will assist in assimilating the proposed development into the wider landscape and offer long term tree cover.
- 5.9 Furthermore, redevelopment of the site may offer an excellent opportunity to actively manage any retained vegetation and accordingly we recommend restorative tree works be undertaken as appropriate. This will further improve the amenity value and landscape setting of the site and increase the useful life of any retained trees.

### Brief Description of Proposed Development

- 5.10 This document relates to the development of the land of the wider Hogwood Development, involving:
- The construction of multiple new houses.
  - The construction of associated accesses.
  - The installation of required utility infrastructure.
  - Earth modelling to create development plateaus.

## Proposed Tree Removal and Works

- 5.11 No trees are required to be removed to facilitate the development of this parcel although the crown of 3nr mature oak trees overhang the western boundary of the land parcel. The location of the trees is shown on the Tree Protection and Removal Plan (Appendix B).

## Root Protection Areas

- 5.12 Following the erection of tree protective fencing, all of the proposed development will take place outside of the RPA of trees to be retained.
- 5.13 This includes the proposed earthworks, required to form development plateau in both parcels.

## Ancient Woodland

- 5.14 There is no Ancient Woodland within, or abutting, this land.

## Outline methodology within Root Protection Areas

- 5.15 All new (and existing re-routed) services shall be routed outside the existing or potential RPA of retained trees. Where it is unavoidable, then hand excavation shall be employed to avoid damage to the larger roots and the services slid through or below the root system. Ducting shall be used to carry cables. Reference shall be made to the recommendations included within Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees (NJUG 4)<sup>6</sup>.
- 5.16 Details of Tree Protection Fencing and ground protection are detailed in section 7 of this document.
- 5.17 The RPA should become an exclusion zone during construction works and for any development. It should be fenced-off and protected in accordance with BS5837:2012. The canopy is likewise susceptible to damage during construction work and requires similar protection.
- 5.18 No activities that result in excavations, changes in level or soil compaction should take place within the RPA of any retained trees, especially older mature trees. This would include the storage of materials, any construction work, trafficking by vehicles or even excessive trafficking by pedestrians.
- 5.19 The location and siting of new facilities near trees should consider the potential impact on and conflict with both tree roots and canopy. This should take into account the ultimate size of existing young and middle-aged trees at maturity. Conversely the impact of the tree/s on end user activities should also be considered with regard to obstruction, shading, leaf fall and root action. These are problems that can be managed provided sufficient space is allowed for.
- 5.20 Where works within the RPA are unavoidable works must be undertaken by hand and the soil levels should be carefully reduced by hand to avoid damage to the bark of larger roots directly beneath and adjacent to the excavation. Where these become exposed, they should be further protected from drying out. Where root pruning is unavoidable it should be made at a suitable place within the root system, avoiding damage to surrounding tissue in accordance with BS

---

<sup>6</sup> <http://streetworks.org.uk/wp-content/uploads/V4-Trees-Issue-2-16-11-2007.pdf>

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

---

- 3998:2010<sup>7</sup>. Final pruning cuts shall be made at right angles to the axis of the root and the final cut wound should be smooth and as small as possible, free from ragged torn ends.
- 5.21 To minimise harm occurring as a result of the works existing hardstanding should be reused. Any necessary hard surface removal within the Root Protection Area (RPA) shall be carried out by low impact handheld pneumatic tools. Removal of the surface shall occur in strips working from the undisturbed surface, working in a retreating manner away from the retained trees. Subsequent removal of arisings / debris shall also be carried out by hand.

---

<sup>7</sup> British Standards Institute. British Standard (BS3998) Trees Work - Recommendations. 2010.

## 6 TREE WORKS

### Standard of Work

- 6.1 All tree works shall be carried out in accordance with BS3998:2010 and latest arboricultural best practice.
- 6.2 All tree work shall be carried out by suitably qualified, competent and insured arboricultural contractors in accordance with Arboricultural Association Standard Conditions of Contract and Specifications for Tree Works (2008) Edition and BS 3998:2010 Tree Work.
- 6.3 All green and woody waste generated by the tree works shall be removed from site and disposed of in an environmentally sustainable manner.
- 6.4 When a branch is removed at its point of attachment, injury of the wood and bark of the parent stem or branch above the cut shall be avoided. If a branch collar is visible, the final cut shall be just outside it and care shall be taken to avoid tearing retained wood and bark when the cut is made. Preliminary cuts shall be made, if necessary, so as to remove weight, before a final cut is made. Care shall be taken to prevent falling branches from harming other parts of the tree (including its roots), its surroundings, people or property. Heavy branches shall be removed in sections and, where necessary, shall be lowered with ropes.
- 6.5 Prior to the commencement of any tree works an appropriate risk assessment shall be produced to describe the measures required to fulfil the statutory safety obligations. It shall aim to identify and prioritise the necessary control measures and precautions.
- 6.6 Following the works, it is recommended that the trees are monitored on a regular basis to ensure their ongoing vitality and health. These inspections shall be completed by a suitably qualified and experienced person.

### Timing of Works

- 6.7 Any tree works required shall be completed prior to any construction and enabling works on the site.
- 6.8 All works shall be timed to have regard to the phenological cycles of protected species that are associated with trees; notably birds and bats.
- 6.9 Nesting birds are protected by law and any removal / tree works should not be carried out during the bird nesting season (March-August inclusive). Should any vegetation be outlined for removal during this period, then an ecological inspection would be required to check that no nesting birds are present. Should checks reveal nesting birds the vegetation must remain until September or until an ecologist has certified that the fledglings have left the nest. A visual inspection for bats shall also be carried on mature / ivy clad trees prior to commencing operations.

## 7 TREE PROTECTION MEASURES

### Construction Exclusion Zone

- 7.1 The protective fence line defines the Construction Exclusion Zone (CEZ) and the fencing shall not be moved or taken down at any time. Within the Construction Exclusion Zone there must be no mechanical digging or scraping; no alteration to existing ground levels including soil stripping; no earthworks; and no handling or discharge of any chemical substance, concrete washings or of any fuels.
- 7.2 Furthermore, vehicular or pedestrian access and the storage of any materials is prohibited within the Construction Exclusion Zone.
- 7.3 Additionally, no materials that may contaminate the soil such as concrete mixings, diesel oil and vehicle washings shall be discharged within 10m of the stem of any tree and no fires shall be lit within 10m of the maximum extent of a trees crown.

### Tree Protection Fencing

- 7.4 Unless otherwise agreed in writing with the Arboricultural Consultant and/or LPA Tree Officer, the fencing system to be utilised shall be in accordance with Appendix E and compliant with BS5837:2012.
- 7.5 The tree protection fence shall be erected as shown on the Tree Protection and Removal Plan (Appendix B) included with is report.
- 7.6 In the main, the tree protection fence has been aligned to respect the position of the proposed earthworks. The fences follow closely the bottom (BOB) of the proposed banking. No earthworks or changes in level should occur beyond this point, closer to the trees.
- 7.7 The fence line shown is the minimum required and the length of the fence shall be extended or adjusted on site as agreed with the Arboricultural Consultant to ensure satisfactory protection of all retained trees and RPAs.
- 7.8 Where proposed (permanent) construction site-hoarding provides the same level of protection to the retained trees and RPAs as the proposed tree protection fence, subject to agreement with the Arboricultural Consultant, the hoarding may serve as the tree protection fence. Notwithstanding, depending on the form and alignment of the construction site- hoarding it may be necessary to provide additional tree protection fence to ensure adequate protection of retained trees and RPAs as shown on the Tree Protection and Removal Plan.
- 7.9 Once the protective barrier is in place it must remain in situ throughout the course of the development until the completion of development, other than to facilitate agreed tree removal; see below.
- 7.10 Where necessary, tree protection fencing may be temporarily re-aligned in order to facilitate tree removal. Fencing is to be re-instated immediately following removal in a manner that encompasses the remaining trees and their respective RPAs.
- 7.11 During tree removal, no wheeled or tracked machinery is to enter the area previously encompassed by tree protective fencing as shown in the Tree Protection and Removal Plan.

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

---

- 7.12 Copies of the Tree Protection and Removal Plan shall be placed in the site office for reference by all site staff.
- 7.13 Signs detailing the purpose of the protective barrier shall be attached to the barriers at 10m intervals. Such signs should be weatherproof and shall be substantially in the form of the specimen provided at Appendix F. Signs must be replaced as necessary should they be removed or become illegible.
- 7.14 Following erection of the protective barriers and prior to commencement of the development it is recommended that an inspection of the site, by either the Council's Tree Officer or the Arboricultural Consultant, is arranged to confirm fencing has been installed in accordance with the Tree Protection and Removal Plan and that any relevant arboreal conditions attached to the planning consent have been met.

### Site Compounds and Materials Stores

- 7.15 Activities related to the establishment of a temporary site compound have the potential to impact upon retained trees by various means. In particular the storage and mixing of chemicals and materials such as concrete can have a damaging effect on tree health if precautions are not taken.
- 7.16 To prevent harm occurring to trees, provision for materials storage, deliveries and other related activities shall be made available in areas away from retained trees.
- 7.17 Under no circumstances shall materials or plant be stored beneath the canopy or within or abutting the Root Protection Zone of any retained trees/hedges, whether fenced or not.

### Monitoring

- 7.18 Following erection of the protective fencing and prior to commencement of the construction Parcel, an inspection of the site by either the Council's Tree Officer or the Arboricultural Consultant should be arranged to confirm fencing has been installed in accordance with the Tree Protection and Removal Plan (Appendix B).
- 7.19 It is also recommended that further monitoring visits be carried out following commencement of the works on site, ideally on at least a monthly basis to ensure ongoing functionality of the CEZ and to check on tree condition.

### Reporting

- 7.20 Should any arboricultural issues become apparent during the works the site manager should immediately contact the Arboricultural Consultant or the Council's Tree Officer for advice upon how to proceed.

## 8 CONCLUSION

- 8.1 A comprehensive tree survey has been completed on the site and its immediate surroundings. The survey was completed in accordance with BS5837:2012.
- 8.2 The proposed development of the area is the building of residential housing and its associated works.
- 8.3 A desktop investigation using the Wokingham Borough Council Interactive map confirmed that a number of TPOs fall inside of the red line boundary of this land, but that the site does not fall within a conservation area.
- 8.4 There no Veteran Trees within the development parcel.
- 8.5 No trees are required to be removed to facilitate development of this land.
- 8.6 Tree Protection Fence is required to protect 3nr mature oak trees (also covered by a TPO) located outside the land parcel redline along the western boundary.
- 8.7 Following the erection of tree protective fencing, the majority of the proposed development will take place outside of the RPA of off-plot trees to be retained. The tree protection fence has been aligned to respect the position of the proposed earthworks. No earthworks or changes in level should occur beyond this point, closer to the trees.
- 8.8 If any arboricultural issues relating from works being carried out occurs, then they should be reported to the Arboricultural Consultant or Tree Officer immediately.


## APPENDICES

**Table 1. Tree characteristics recorded during survey**

|                                                      |                                                                                                                                                                                                                                                                     |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
|------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------|--------------|--------------------------------------|
| Tree Ref No:                                         | Sequential reference number of trees or groups of trees. Avenues, woodlands and hedgerows were also recorded on the tree constraints plan.<br># - denotes inaccessible trees (best estimates are made about the location, physical dimensions and characteristics.) |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Species                                              | Species listed by common name, with scientific names ( <i>italic lettering</i> ).                                                                                                                                                                                   |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Height (m)                                           | Estimated height of canopy to nearest metre.                                                                                                                                                                                                                        |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Branch Spread                                        | branch spread, taken as a minimum at the four cardinal points, to derive an accurate representation of the crown                                                                                                                                                    |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Stem diameter @ 1.5 m (m)                            | Estimated diameter of trunk at 1.5 m above ground level in metres unless otherwise indicated, multi-stemmed trees being measured in accordance with Annex C: BS5837                                                                                                 |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Existing height above ground level                   | To inform on ground clearance, crown/stem ratio and shading the estimated height of the first significant branch and direction of growth and canopy above ground level.                                                                                             |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Stem No.                                             | Number of stems (if necessary) of individual tree.                                                                                                                                                                                                                  |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Life Stage                                           | Expressed as:-                                                                                                                                                                                                                                                      | Y<br>SM<br>EM<br>M                                                                                                                                                                                                                                                                                                                       | (Young)<br>(Semi-mature)<br>(Early-mature)<br>(Mature) | OM<br>V<br>D | (Over-mature)<br>(Veteran)<br>(Dead) |
| Physical Condition                                   | Apparent condition expressed as the following categories, based upon a brief visual inspection from the ground only:-                                                                                                                                               |                                                                                                                                                                                                                                                                                                                                          |                                                        |              | Good<br>Fair<br>Poor<br>Dead         |
| Comments / Management Recommendations                | General observations, particularly of structural and/or physiological condition (e.g. the presence of any decay and physical defect), and/or preliminary management recommendations and potential for wildlife habitats (not exhaustive).                           |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Estimated remaining contribution (years)             | Estimated remaining contribution, in years (<10, 10+,20+,40+)                                                                                                                                                                                                       |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Tree Quality Assessment Value: <u>Category</u>       | Criteria grading with regards to Table 1: BS 5837:2012, expressed as:-                                                                                                                                                                                              | <b>A</b> (Trees/Vegetation of high quality and value)<br><b>B</b> (Vegetation of moderate quality and value)<br><b>C</b> (Trees/Vegetation of low quality and value)<br><b>U*</b> (Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years) |                                                        |              |                                      |
|                                                      | * Category U trees can have existing or potential conservation value which might be desirable to preserve.                                                                                                                                                          |                                                                                                                                                                                                                                                                                                                                          |                                                        |              |                                      |
| Tree Quality Assessment Value: <u>Sub - Category</u> | Criteria grading with regards to Table 1: BS 5837:2012, expressed as:-                                                                                                                                                                                              | <b>1</b> (Trees with mainly <i>arboricultural</i> value)<br><b>2</b> (Trees with mainly <i>landscape</i> value)<br><b>3</b> (Trees with mainly <i>cultural / conservation</i> value)                                                                                                                                                     |                                                        |              |                                      |

## Appendix A

### Tree Constraints Plan

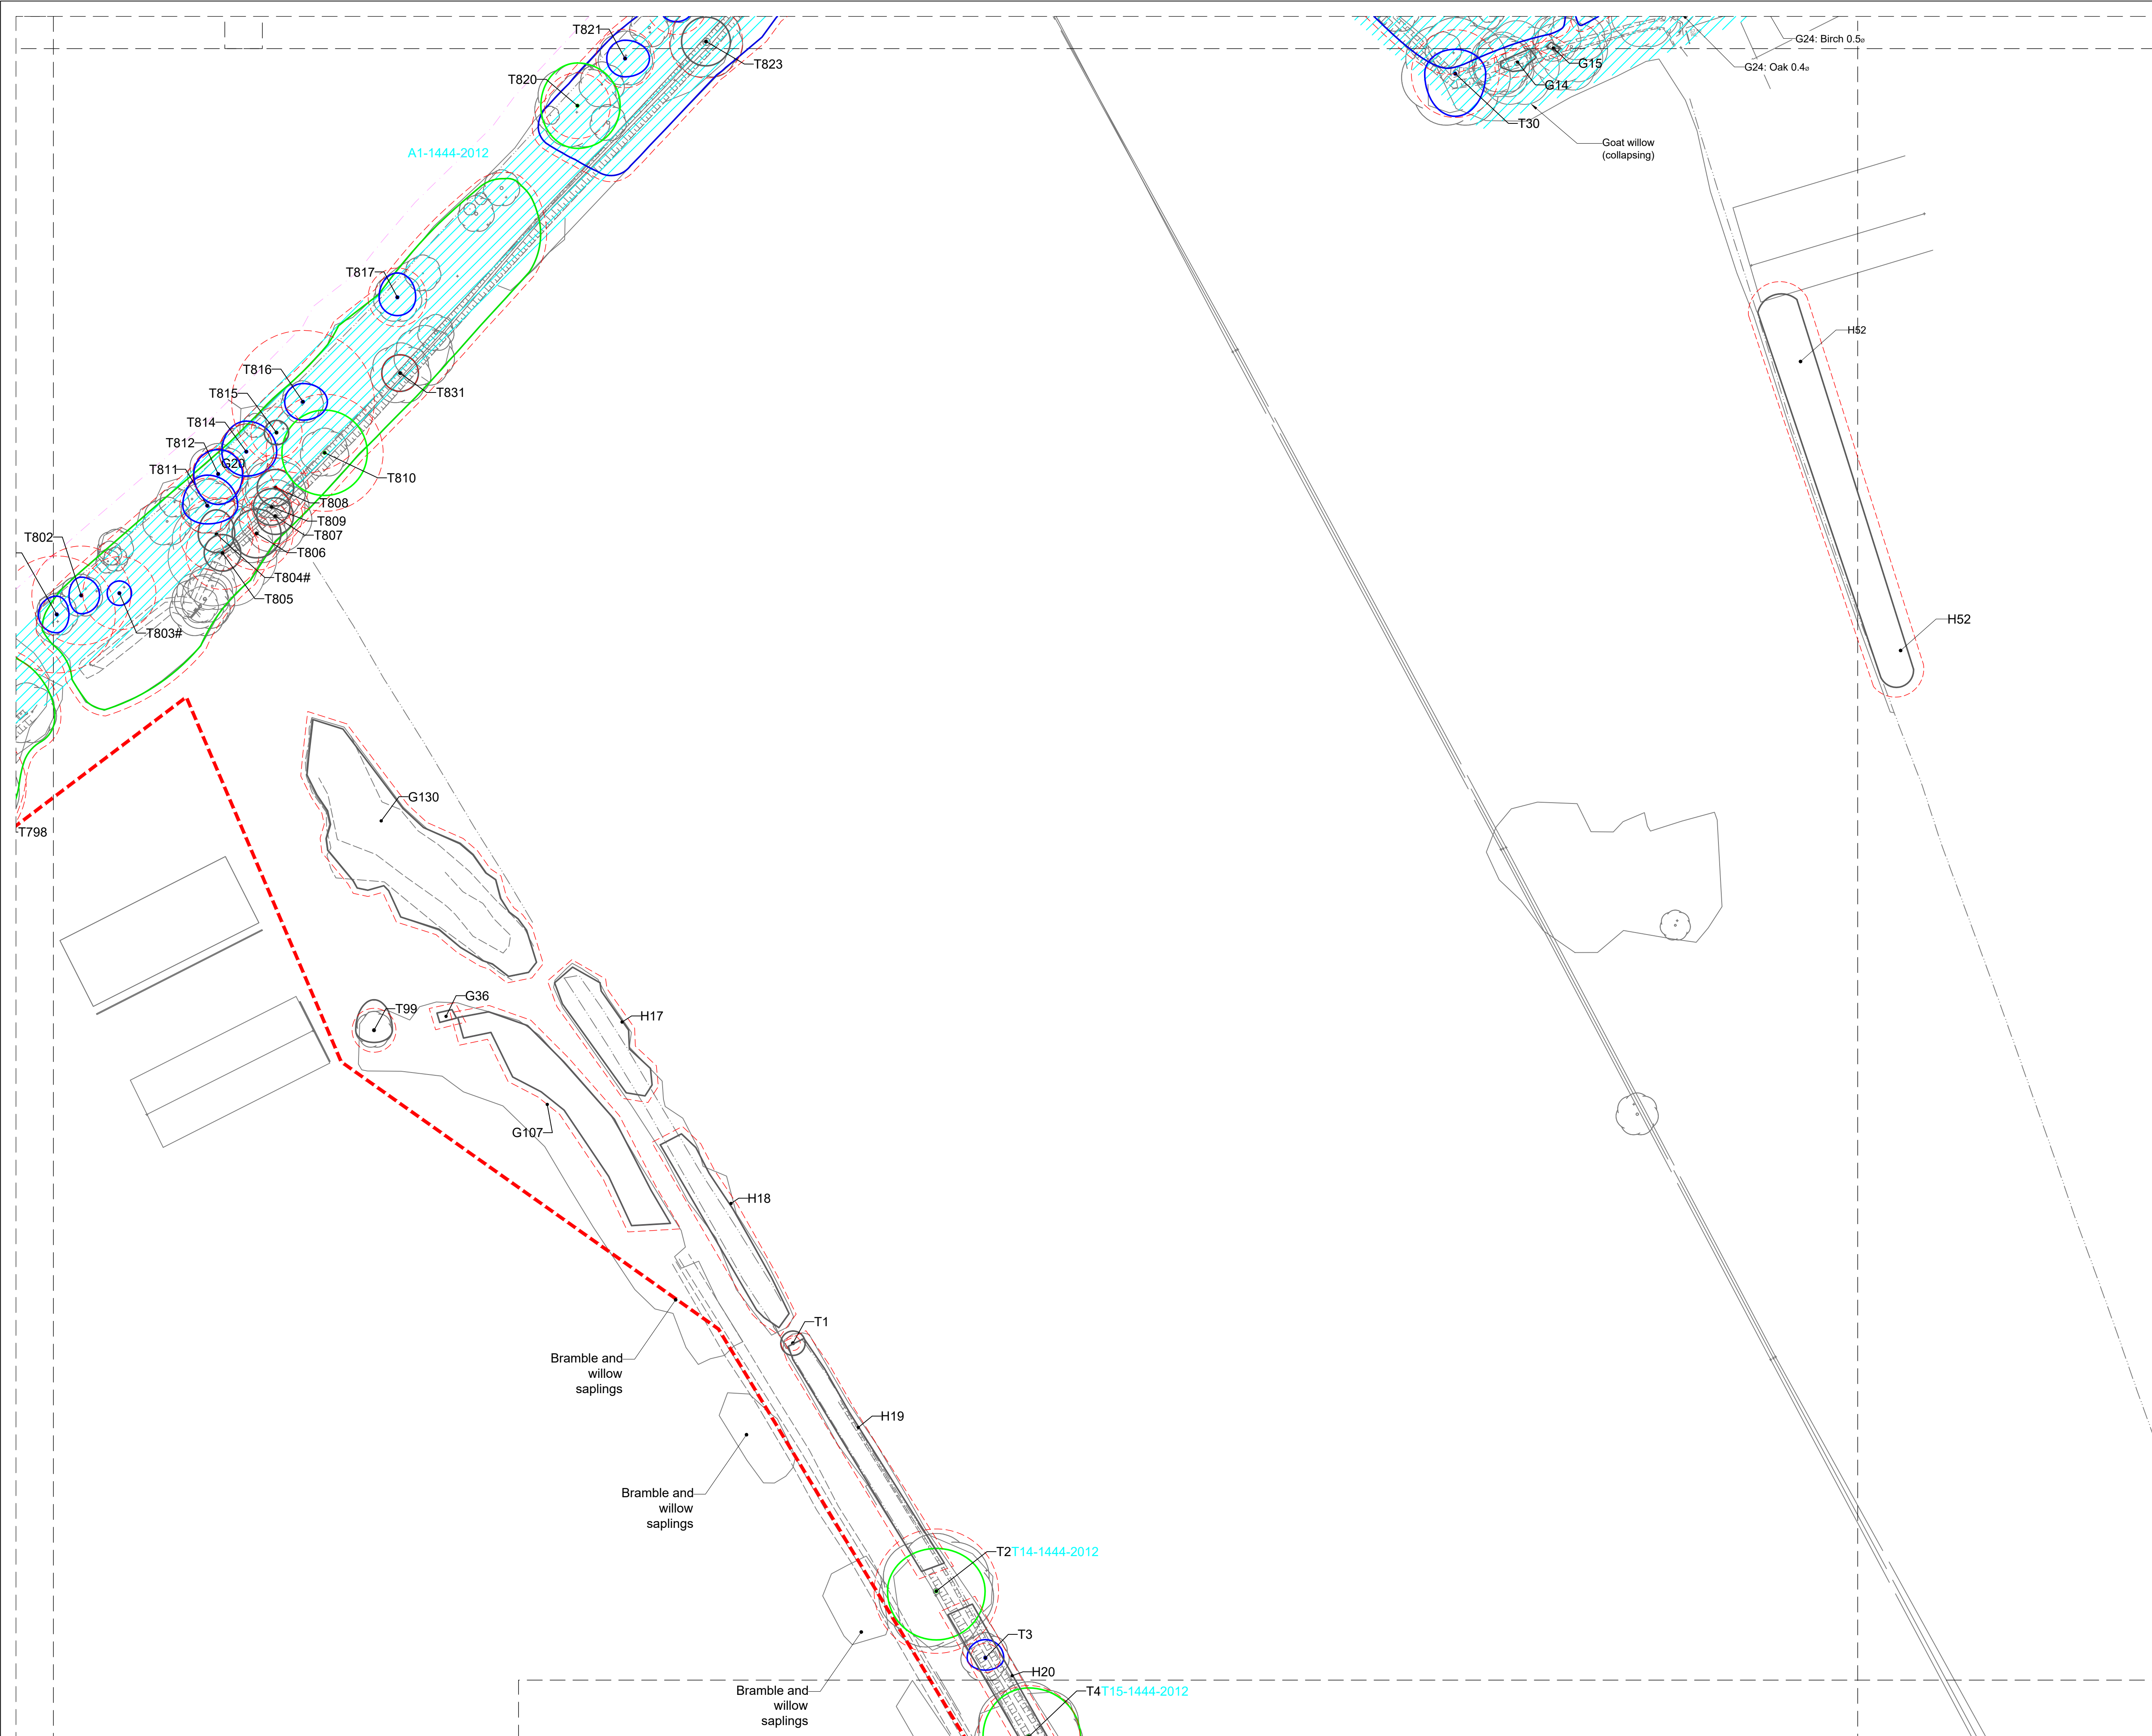

© 2019 RPS Group

Notes

- This drawing has been prepared in accordance with the scope of RPS's appointment with its client and is subject to the terms and conditions of that appointment. RPS accepts no liability for any use of this document other than by its client and only for the purposes for which it was prepared and provided.
- If received electronically it is the recipients responsibility to print to correct scale. Only written dimensions should be used.
- Where applicable Ordnance Survey (c) Crown Copyright 2019  
All rights reserved. Licence number 0100031673

KEY PLAN (NTS)

**Key**

- Survey boundary.
- Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.
- Tree (location estimated) with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Tree off-site with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group with numbered reference. Canopy extents and BS5837:2012 tree quality category as shown below.
- Hedge with numbered reference. Width and BS5837:2012 tree quality category as shown below.

BS 5837:2012 Tree Quality Categories - Table 1

- Category A - High quality
- Category B - Moderate quality
- Category C - Low quality
- Category U - Unsuitable for retention

- Tree protected by Tree Preservation Order issued by Wokingham District Council number reference relates to the various TPO Schedules.
- Root protection area (RPA) Calculated in accordance with Section 4.6 - BS5837:2012
- Ancient Woodland (© Natural England Copyright 2018)
- 15m Offset from Ancient Woodland (line taken from Natural England GIS Database)
- 15m Offset from suggested Aged Woodland
- Veteran Tree
- 5m offset from hedgerow edge (measured from edge of canopy)

NOTES:

- Refer to RPS Tree Survey Report & Schedule for further details.
- Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.
- Plan produced in accordance with recommendations set out in BS 5837:2012 - 'Trees in Relation to design, demolition and construction'.
- Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period; generally, although not restricted to, March - August inclusive.
- Survey based upon topographic survey produced by in 2017

|     |                     |          |         |         |
|-----|---------------------|----------|---------|---------|
| C   | Updated tree survey | 13/09/23 | RC      | DC      |
| B   | Updated tree survey | 06/08/21 | AB      | DC      |
| A   | First Issue         | 22/12/17 | SH      | DC      |
| Rev | Description         | Date     | Initial | Checked |

**MAKING COMPLEX EASY**

Lakesbury House, Hittingbury Road, Chandlers Ford, Hampshire SO53 5SS  
T: 02380 810 440 E: rpsso@rpsgroup.com

Client **CALA Homes**

Project **Hogwood Farm Finchampstead**


Title **Tree Survey**

Status **Planning** Drawn By **SH** PM/Checked by **DC**


Job Ref **JSL2891** Scale @ A1 **1:500** Date Created **Dec 2017**

Drawing Number **711** Rev **C**

[rpsgroup.com](http://rpsgroup.com)

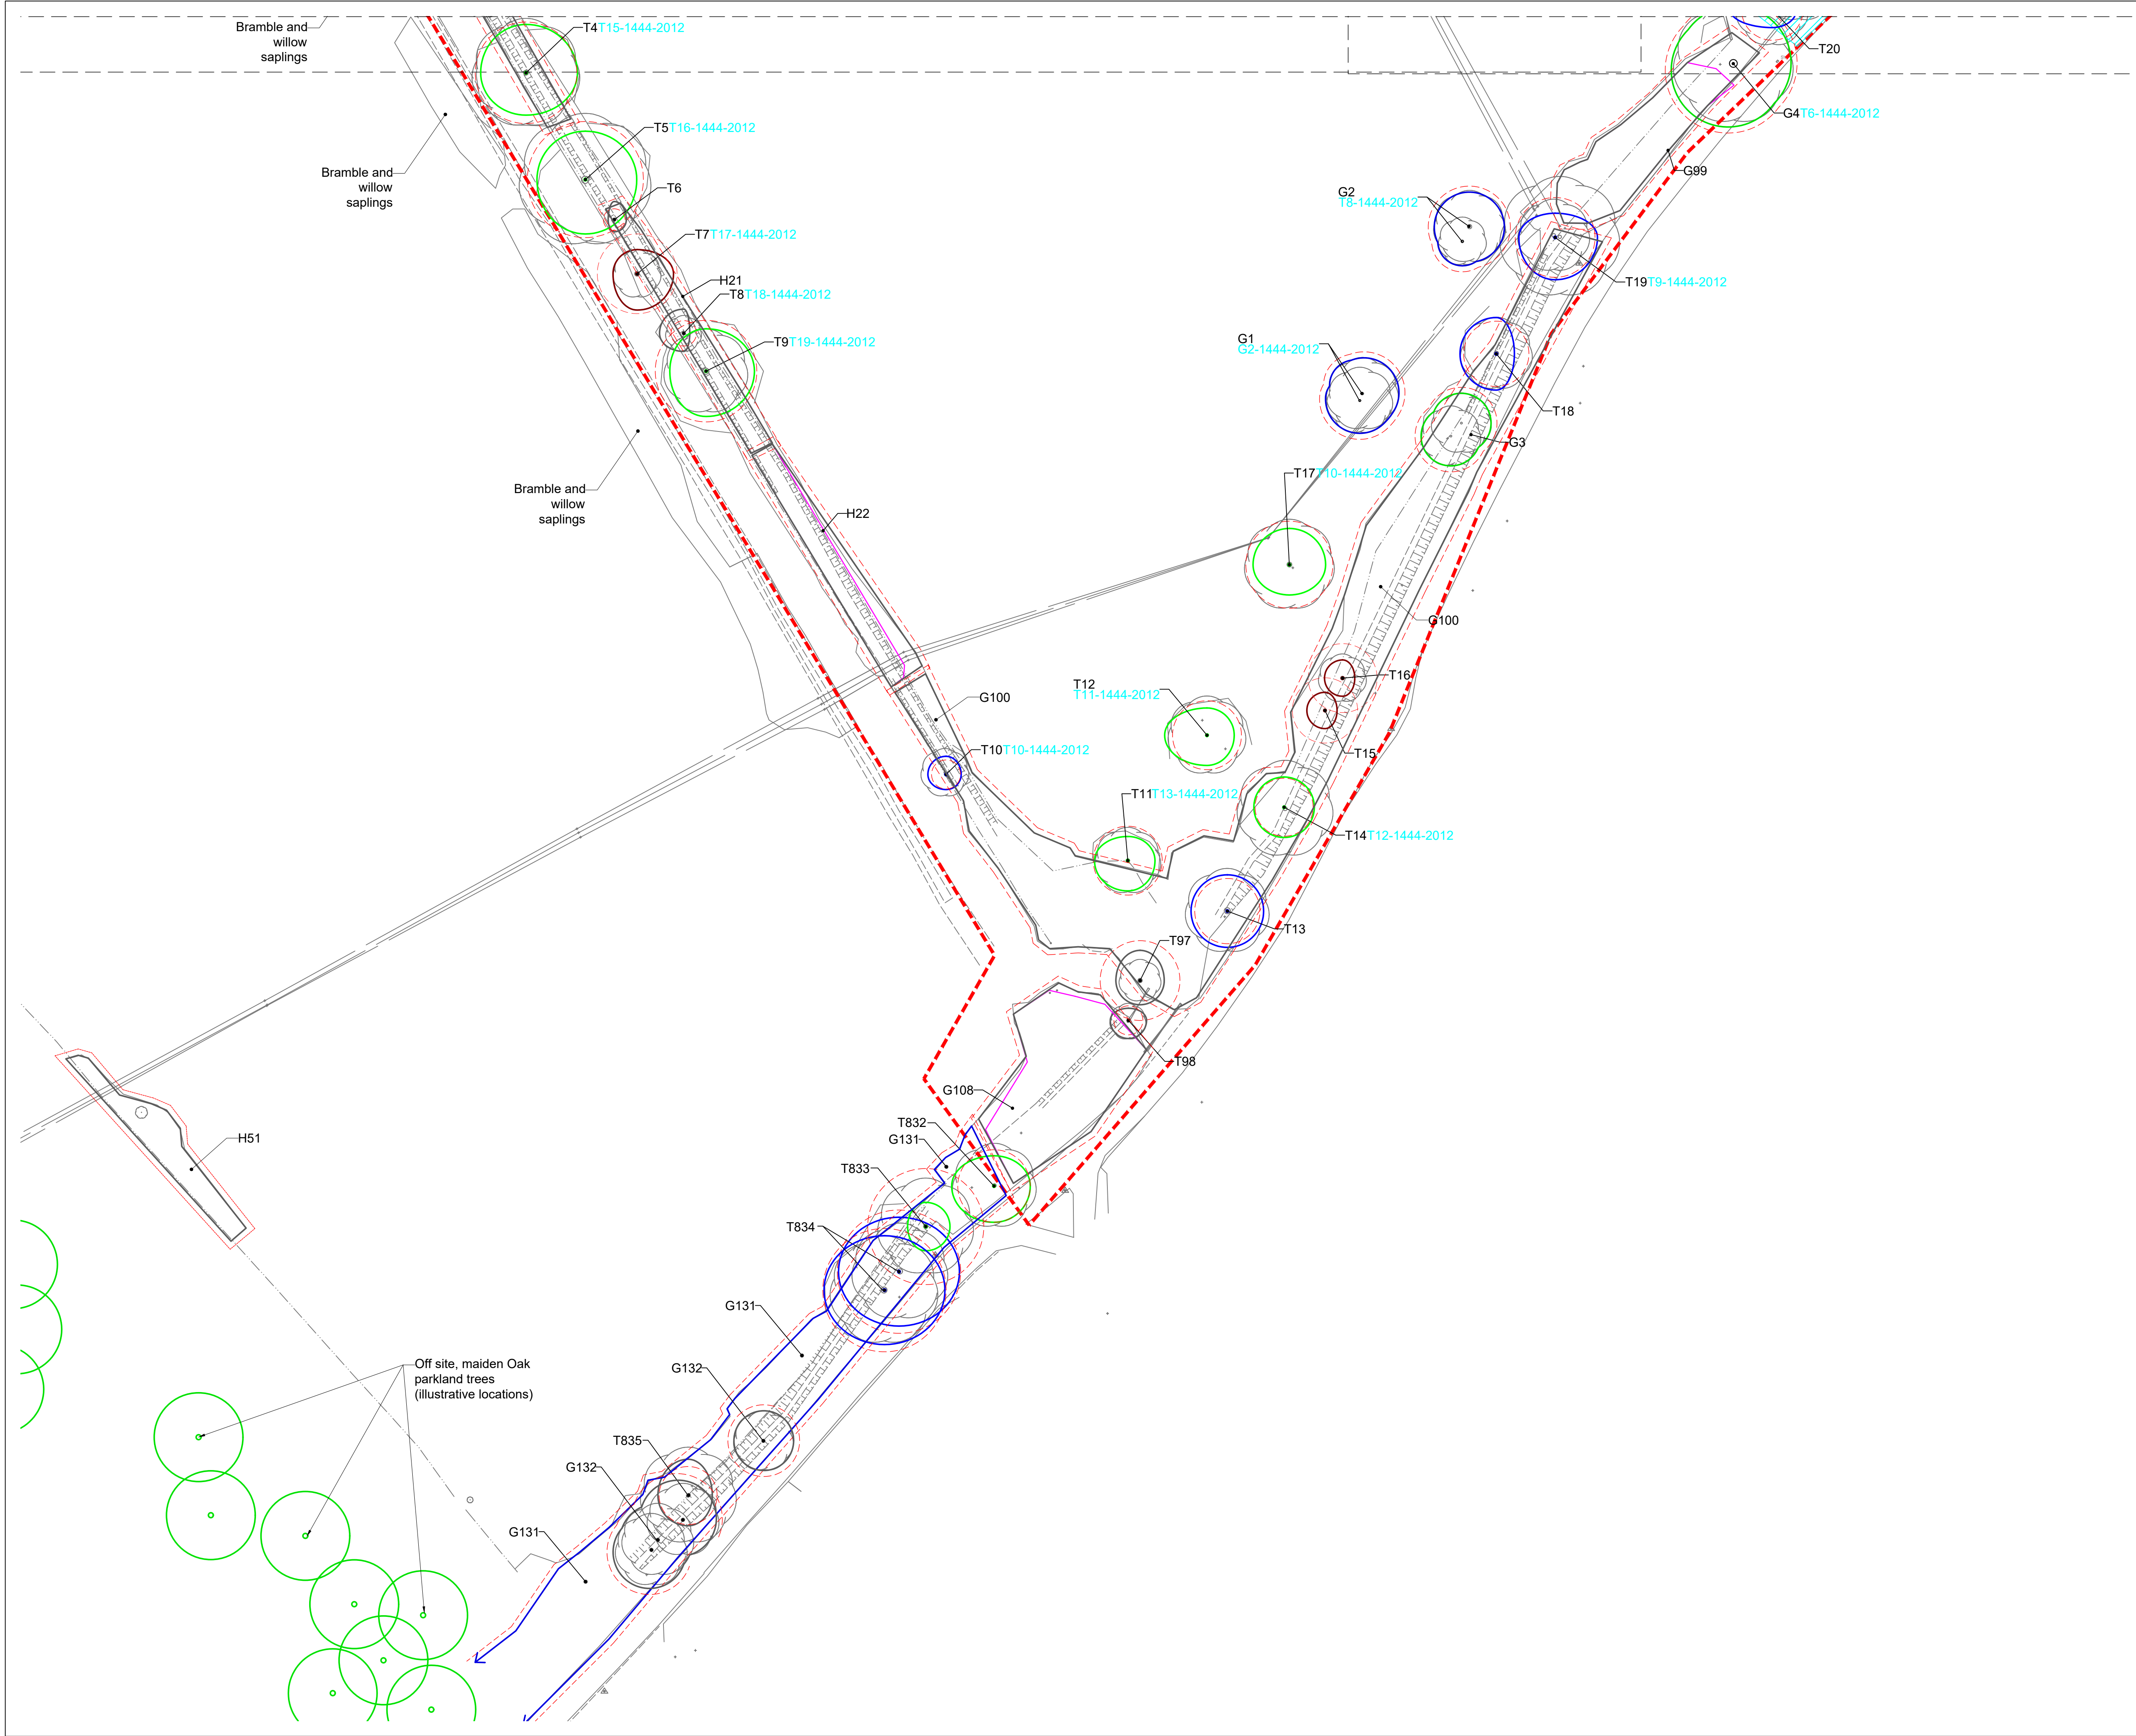

© 2019 RPS Group  
Notes  
1. This drawing has been prepared in accordance with the scope of RPS's appointment with its client and is subject to the terms and conditions of that appointment. RPS accepts no liability for any use of this document other than by its client and only for the purposes for which it was prepared and provided.  
2. If received electronically it is the recipients responsibility to print to correct scale. Only written dimensions should be used.  
3. Where applicable Ordnance Survey (c) Crown Copyright 2019  
All rights reserved. Licence number 0100031673

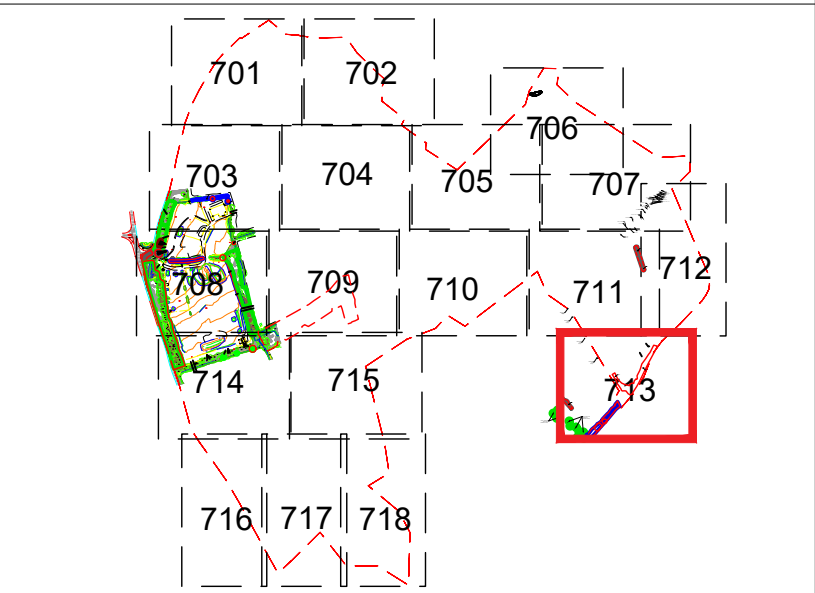

**KEY PLAN (NTS)**

**Key**

- Survey boundary.
- Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.
- Tree (location estimated) with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Tree off-site with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group with numbered reference. Canopy extents and BS5837:2012 tree quality category as shown below.
- Hedge with numbered reference. Width and BS5837:2012 tree quality category as shown below.

BS 5837:2012 Tree Quality Categories - Table 1

- Category A - High quality
- Category B - Moderate quality
- Category C - Low quality
- Category U - Unsuitable for retention

- Tree protected by Tree Preservation Order issued by Wokingham District Council number reference relates to the various TPO Schedules.
- Root protection area (RPA) Calculated in accordance with Section 4.6 - BS5837:2012
- Ancient Woodland (© Natural England Copyright 2018)
- 15m Offset from Ancient Woodland (line taken from Natural England GIS Database)
- 15m Offset from suggested Aged Woodland
- Veteran Tree
- 5m offset from hedgerow edge (measured from edge of canopy)

NOTES:

- Refer to RPS Tree Survey Report & Schedule for further details.
- Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.
- Plan produced in accordance with recommendations set out in BS 5837:2012 - 'Trees in Relation to design, demolition and construction'.
- Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period; generally, although not restricted to, March - August inclusive.
- Survey based upon topographic survey produced by in 2017

|     |                     |         |         |         |
|-----|---------------------|---------|---------|---------|
| B   | Tree survey updated | 02 / 24 | DC      | DC      |
| A   | First Issue         | 02/2018 | SH      | DC      |
| Rev | Description         | Date    | Initial | Checked |

**rps** MAKING COMPLEX EASY

Lakesbury House, Hittingbury Road, Chandlers Ford, Hampshire SO53 5SS  
T: 02380 810 440 E: rpsso@rpsgroup.com

Client **Legal & General Homes**

Project **Hogwood Farm Finchampstead**

Title **Tree Survey**

|          |          |               |
|----------|----------|---------------|
| Status   | Drawn By | PM/Checked by |
| Planning | SH       | DC            |


|         |            |              |
|---------|------------|--------------|
| Job Ref | Scale @ A1 | Date Created |
| JSL2891 | 1:500      | Dec 2017     |

|                |     |
|----------------|-----|
| Drawing Number | Rev |
| 713            | B   |

[rpsgroup.com](http://rpsgroup.com)

## Appendix B

### Tree Protection and Removal Plan

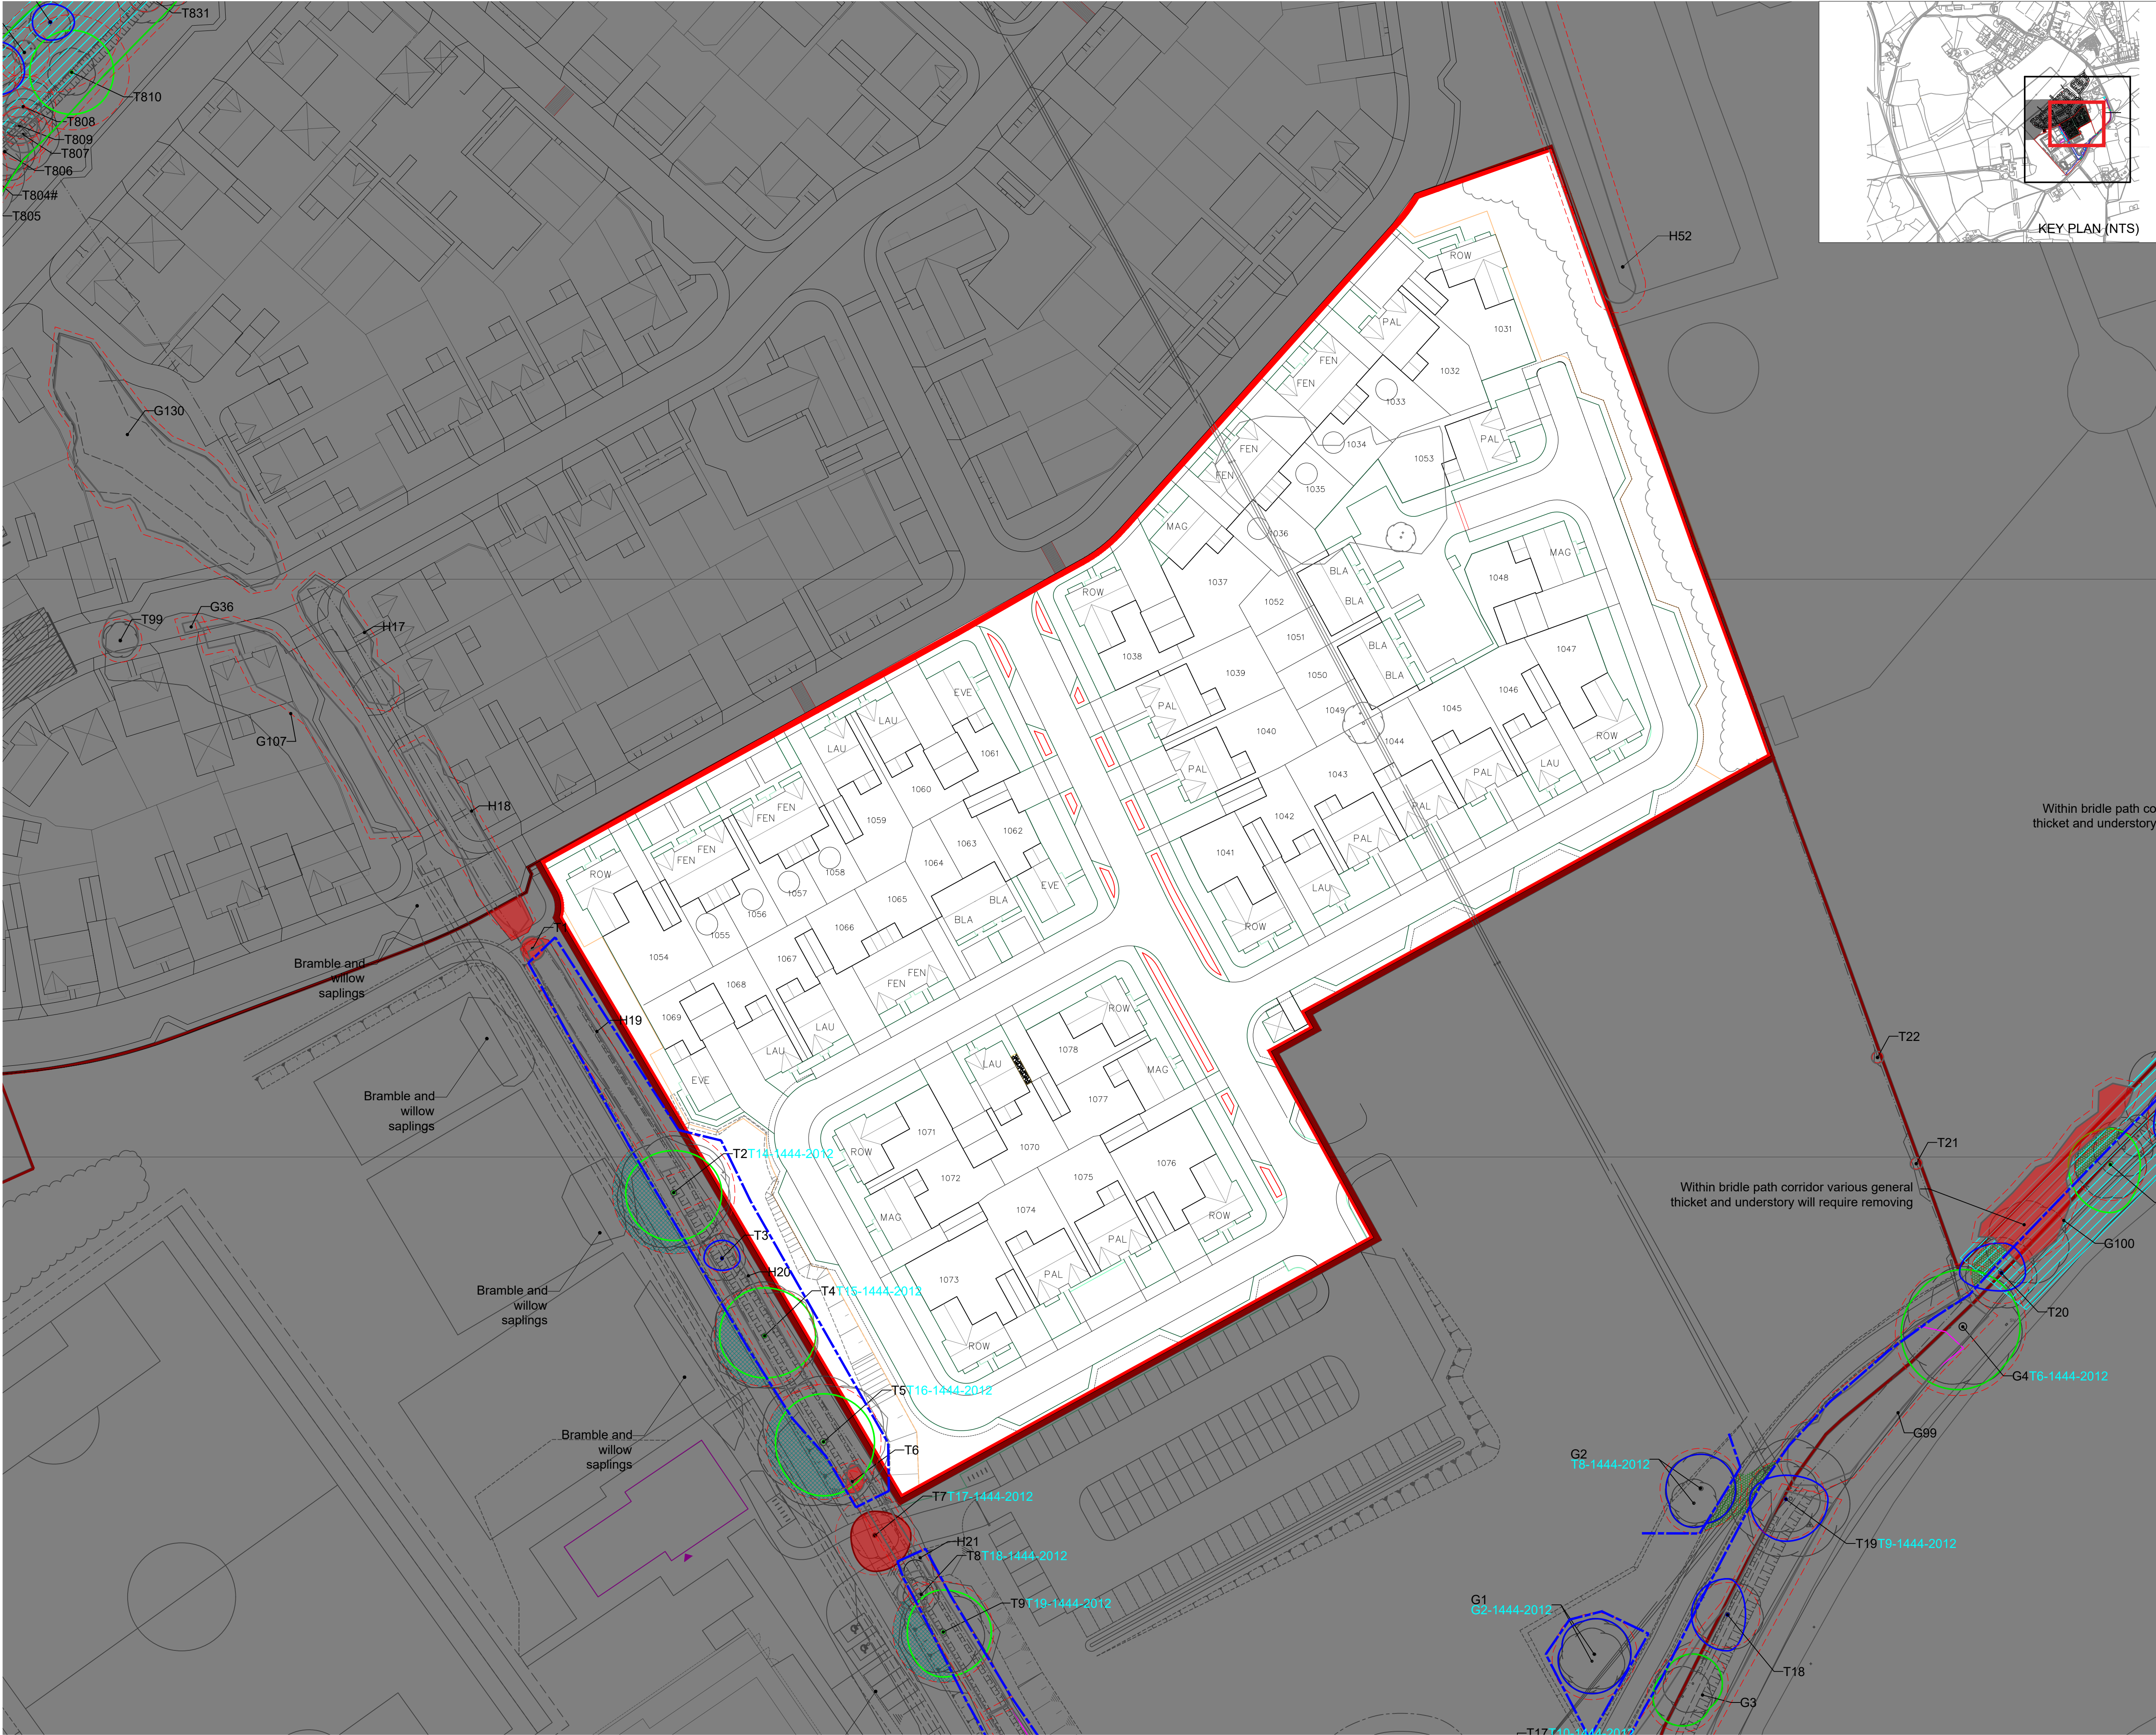

© 2019 RPS Group  
Notes  
1. This drawing has been prepared in accordance with the scope of RPS's appointment with its client and is subject to the terms and conditions of that appointment. RPS accepts no liability for any use of this document other than by its client and only for the purposes for which it was prepared and provided.  
2. If received electronically it is the recipients responsibility to print to correct scale. Only written dimensions should be used.  
3. Where applicable Ordnance Survey (c) Crown Copyright 2019  
All rights reserved. Licence number 0100031673

## Key

- Survey boundary.
- Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.
- Tree (location estimated) with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Tree off-site with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group with numbered reference. Canopy extents and BS5837:2012 tree quality category as shown below.
- Hedge with numbered reference. Width and BS5837:2012 tree quality category as shown below.
- BS 5837:2012 Tree Quality Categories - Table 1
  - Category A - High quality
  - Category B - Moderate quality
  - Category C - Low quality
  - Category U - Unsuitable for retention
- Tree protected by Tree Preservation Order No.xxx, xx xxxx. Bracketed number reference relates to the TPO Schedule.
- Root protection area (RPA) Calculated in accordance with Section 4.6 - BS5837:2012
- Tree to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Vegetation group or hedge to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.
- Temporary protective fencing in accordance with Section 6.2 - BS5837:2012. See inset details for example barriers.
- Above ground construction requiring "No-dig" design principles; where new surfacing is proposed within area of existing building/ hard surfacing the new construction to utilise existing levels, reusing sub-base and wearing courses within new construction, all in accordance with the Arboricultural Method Statement.
- Above ground construction requiring "No-dig" design principles in accordance with APN12.

NOTES:  
• Refer to RPS Tree Survey Report & Schedule for further details.  
• Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.  
• Plan produced in accordance with recommendations set out in BS 5837:2012 - 'Trees in Relation to design, demolition and construction'.  
• Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period; generally, although not restricted to, March - August inclusive.  
• Survey based upon topographic survey produced in 2017.  
• Pedestrian/ vehicular emergency access routes to be maintained at all times.  
• All protective fencing to be completed and approved by LPA / CA prior to commencement of any site works.  
• All works to conform with requirements of:  
BS 3098:2010 - Tree Works  
BS 5837:2012 - Trees in relation to design, demolition and construction

| Rev | Description | Date | Initial | Checked |
|-----|-------------|------|---------|---------|
|     |             |      |         |         |



Lakesbury House, Hittingbury Road, Chandlers Ford, Hampshire SO53 5SS  
T: 02380 810 440 E: rpsso@rpsgroup.com

Client **CALA Homes**

Project **Land south of P15  
Hogwood Farm  
Finchampstead**

Title **Tree Removal and Protection  
Plan**

Status **Planning** Drawn By **SH** PM/Checked by **DC**

Job Ref **JSL2891** Scale @ A1 **1:500** Date Created **Dec 2017**

Drawing Number **783** Rev **-**

**rpsgroup.com**

## Appendix C

### Tree Survey Schedule

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                   |                                          |                                |
| T1       | Quercus robur - Pedunculate Oak | 4          | 2                | 2   | 2   | 2   | 110            | 1                | 1.5                           | NW          | Y         | Good                 | Good                    | Restricted inspection due to vegetation.                                                                                                                          | 40+                                      | C1                             |
| T2       | Quercus robur - Pedunculate Oak | 14         | 7                | 8   | 8   | 8   | 850            | 1                | 2                             | North       | M         | Good                 | Good                    | Deadwood in the crown of moderate extent. Restricted inspection due to vegetation. Recommend crown is deadwooded.                                                 | 40+                                      | A2                             |
| T3       | Quercus robur - Pedunculate Oak | 6          | 3                | 2   | 3   | 3   | 200            | 1                | 1                             | North       | Y         | Good                 | Good                    | Restricted inspection due to vegetation.                                                                                                                          | 20-40                                    | B2                             |
| T4       | Quercus robur - Pedunculate Oak | 13         | 8.0              | 7.0 | 8.5 | 7.5 | 700            | 1                | 3.0                           | North       | M         | Fair                 | Fair                    | Deadwood in the crown of major extent. Previous branch failures noted. Restricted inspection due to vegetation. Recommend crown is deadwooded.                    | 40+                                      | A2                             |
| T5       | Quercus robur - Pedunculate Oak | 14         | 8.0              | 9   | 8.5 | 8   | 800            | 1                | 3                             | NW          | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to vegetation.                                                   | 40+                                      | A2                             |
| T6       | Quercus robur - Pedunculate Oak | 6          | 3                | 2   | 2   | 1   | 140            | 1                | 2                             | NE          | Y         | Fair                 | Good                    | Heavily suppressed crown. Deadwood in the crown of minor extent. Restricted inspection due to vegetation.                                                         | 10-20                                    | C2                             |
| T7       | Quercus robur - Pedunculate Oak | 10         | 4.0              | 6.0 | 6.0 | 4.0 | 550            | 1                | 3.0                           | West        | EM        | Dead                 | Dead                    | Restricted inspection due to vegetation. Dead oak within hedgerow with major deadwood sections. Recommend reducing deadwood sections and leaving stem as habitat. | <10                                      | U                              |
| T8       | Quercus robur - Pedunculate Oak | 6          | 4                | 3   | 1   | 4.0 | 170            | 1                | 1                             | North       | Y         | Fair                 | Good                    | Heavily suppressed crown. Restricted inspection due to vegetation. Recommend reducing deadwood sections and leaving stem as habitat.                              | 10-20                                    | C2                             |
| T9       | Quercus robur - Pedunculate Oak | 16         | 7                | 7.5 | 8   | 6   | 700            | 1                | 2                             | South       | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Recommend reducing deadwood sections and leaving stem as habitat.                 | 40+                                      | A2                             |
| T10      | Quercus robur - Pedunculate Oak | 8          | 3                | 2.5 | 2.5 | 3.0 | 210            | 1                | 1.5                           | NE          | Y         | Good                 | Good                    | Restricted inspection due to vegetation.                                                                                                                          | 20-40                                    | B2                             |
| T11      | Quercus robur - Pedunculate Oak | 13         | 4                | 5   | 4.5 | 5.5 | 480            | 1                | 2                             | East        | EM        | Good                 | Good                    | The tree has a minor basal cavity. Including wire fence in stem bark.                                                                                             | 40+                                      | A1                             |
| T12      | Quercus robur - Pedunculate Oak | 13         | 4.5              | 5.0 | 4.5 | 7.0 | 480            | 1                | 2.0                           | West        | EM        | Good                 | Good                    | Restricted inspection due to ivy.                                                                                                                                 | 40+                                      | A1                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                    | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                            |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                           |                                          |                                |
| T13      | Salix cinera - Goat Willow                 | 12         | 6                | 6   | 6   | 6   | 450            | 1                | 0.5                           | NW          | EM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation.                                                                                                                                           | 20-40                                    | B2                             |
| T14      | Quercus robur - Pedunculate Oak            | 12         | 5                | 5   | 5   | 5   | 410            | 1                | 2                             | SW          | EM        | Good                 | Good                    | Hard surface located in RPA. Located adjacent road on field boundary.                                                                                                                                                     | 40+                                      | A2                             |
| T15      | Populus x canadensis - Hybrid Black Poplar | 18         | 3                | 3   | 2   | 3   | 450            | 1                | 3                             | NW          | EM        | Poor                 | Fair                    | Included main stem union. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Hard surface located in RPA. Recommend tree is removed. Located adjacent road on field boundary. Decay at fork. | <10                                      | U                              |
| T16      | Populus x canadensis - Hybrid Black Poplar | 18         | 3.0              | 3.0 | 2.0 | 3.0 | 480            | 1                | 3                             | South       | EM        | Poor                 | Poor                    | Deadwood in the crown of minor extent. Hanging branches in the crown. Previous branch failures noted. Recommend tree is removed. Located adjacent road on field boundary. Major crown failure through lost leader.        | <10                                      | U                              |
| T17      | Quercus robur - Pedunculate Oak            | 13         | 6                | 5   | 6   | 6   | 610            | 1                | 2                             | West        | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Crossing branches in crown.                                                                                                                                                        | 40+                                      | A1                             |
| T18      | Quercus robur - Pedunculate Oak            | 9          | 6                | 6   | 3   | 6   | 450            | 1                | 1.5                           | NE          | EM        | Fair                 | Fair                    | Deadwood in the crown of minor extent. Branch dieback of minor extent. Restricted inspection due to ivy. Hard surface located in RPA.                                                                                     | 20-40                                    | B2                             |
| T19      | Quercus robur - Pedunculate Oak            | 13         | 4                | 7   | 7   | 6   | 550            | 1                | 2.5                           | NE          | M         | Fair                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Hard surface located in RPA. Utility pruned.                                                                                                              | 20-40                                    | B2                             |
| T20      | Betula pubescens - Downy Birch             | 13         | 5                | 3   | 4   | 7   | 430            | 1                | 2                             | SW          | EM        | Good                 | Good                    | Restricted inspection due to vegetation. Growing adjacent road within field boundary vegetation.                                                                                                                          | 20-40                                    | B2                             |
| T21      | Quercus robur - Pedunculate Oak            | 4          | 1                | 1   | 1   | 1   | 70             | 1                | 2                             | SE          | Y         | Poor                 | Good                    | Growing through fence.                                                                                                                                                                                                    | 10-20                                    | C1                             |
| T22      | Crataegus monogyna - Common Hawthorn       | 3          | 1.0              | 1.0 | 1.0 | 1.0 | 70             | 1                | 0.5                           | North       | Y         | Poor                 | Good                    | Growing through fence.                                                                                                                                                                                                    | 10-20                                    | C1                             |
| T23      | Quercus robur - Pedunculate Oak            | 14         | 6                | 8   | 5   | 7   | 500            | 1                | 2                             | SE          | EM        | Good                 | Good                    | Restricted inspection due to ivy and vegetation. Located adjacent road within field boundary vegetation.                                                                                                                  | 40+                                      | A2                             |
| T24      | Ilex aquifolium - Common Holly             | 10         | 2                | 2   | 2   | 2   | 400            | 1                | 1                             | North       | EM        | Fair                 | Good                    | Heavily suppressed crown. Restricted inspection due to vegetation. Located adjacent road within field boundary vegetation.                                                                                                | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                             | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                |                                          |                                |
| T25      | Ilex aquifolium - Common Holly  | 11         | 4.0              | 4.0 | 4.0 | 4.0 | 400            | 1                | 1.0                           | North       | EM        | Fair                 | Good                    | Restricted inspection due to vegetation. Located adjacent road within field boundary vegetation.                                                                                                               | 20-40                                    | B2                             |
| T26      | Quercus robur - Pedunculate Oak | 13         | 5                | 5   | 5.5 | 5.5 | 500            | 1                | 3                             | SE          | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to vegetation. Located outside field boundary fence line.                                                     | 40+                                      | A2                             |
| T27      | Salix cinerea - Grey Willow     | 9          | 5.0              | 8.0 | 5.0 | 8.0 | 550, 350, 280  | 3.00             | 0.5                           | South       | M         | Poor                 | Good                    | moderate stem cavity. Splits and cracks to stem. Pruning wounds to stem and crown. Old grey willow with historic fracture to main stem. Subsiding limbs with layering. Willow bracket fungus growing on stems. | 20-40                                    | B3                             |
| T28      | n/a                             |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                |                                          |                                |
| T29      | n/a                             |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                |                                          |                                |
| T30      | Quercus robur - Pedunculate Oak | 10         | 4                | 7   | 5   | 5   | 600            | 1                | 3                             | SW          | M         | Good                 | Fair                    | The tree has a moderate basal cavity. Deadwood in the crown of minor extent. Branch dieback of minor extent. Located adjacent ditch.                                                                           | 20-40                                    | B2                             |
| T31      | Quercus robur - Pedunculate Oak | 16         | 7                | 7.0 | 6   | 7   | 700            | 1                | 3.5                           | SW          | M         | Good                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Located adjacent ditch.                                                                                                                        | 40+                                      | A2                             |
| T32      | Quercus robur - Pedunculate Oak | 8          | 2                | 4   | 3   | 4   | 260            | 1                | 1.5                           | SE          | SM        | Good                 | Good                    | Deadwood in the crown of minor extent. Located adjacent ditch.                                                                                                                                                 | 20-40                                    | B2                             |
| T33      | Fraxinus excelsior - Common Ash | 8          | 2.0              | 2.0 | 2.0 | 2.0 | 150            | 1                | 0.5                           | West        | Y         | Fair                 | Good                    | Growing adjacent ditch.                                                                                                                                                                                        | 20-40                                    | C1                             |
| T34      | Quercus robur - Pedunculate Oak | 14         | 5                | 4   | 4.0 | 7   | 550            | 1                | 3.5                           | SE          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Growing adjacent ditch.                                                                                                                 | 40+                                      | A2                             |
| T35      | Malus sylvestris - Wild Apple   | 8          | 3                | 2.5 | 4   | 3   | 200, 200       | 2.00             | 1.5                           | NE          | M         | Poor                 | Fair                    | Stem wounds are present. Included main stem union. Fungal Fruiting bodies noted on crown. Deadwood in the crown of minor extent. Previous branch failures noted.                                               | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                   | Height (m) | Crown spread (m) |      |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------|------------|------------------|------|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                           |            | N                | E    | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                               |                                          |                                |
| T38      | Salix cinerea - Grey Willow               | 7          | 3.0              | 1    | 2   | 2   | 180            | 1                | 0.5                           | North       | SM        | Poor                 | Fair                    | The tree is leaning at a 30 degree angle in a North direction. Pruning wounds to crown. Restricted inspection due to vegetation. General poor form to tree.                                   | 10-20                                    | C2                             |
| T39      | Salix cinerea - Grey Willow               | 13         | 4                | 5    | 3   | 4   | 20             | 6                | 0.5                           | NE          | M         | Poor                 | Good                    | Included main stem union. Pruning wounds to crown. Restricted inspection due to vegetation. Multi stemmed specimen.                                                                           | 10-20                                    | C2                             |
| T40      | Quercus robur - Pedunculate Oak           | 13         | 6                | 5    | 5   | 5   | 550            | 1                | 1                             | SW          | EM        | Fair                 | Good                    | Originally twin stemmed but stems have fused over time forming natural brace.                                                                                                                 | 20-40                                    | B2                             |
| T41      | Fraxinus excelsior - Common Ash           | 19         | 3.0              | 7.0  | 5.0 | 6.0 | 450            | 1                | 3.5                           | South       | EM        | Fair                 | Good                    | Restricted inspection due to vegetation. Hard surface located in RPA. Located adjacent road within field boundary vegetation.                                                                 | 20-40                                    | B2                             |
| T42      | Quercus robur - Pedunculate Oak           | 13         | 5                | 7    | 7   | 7   | 700            | 1                | 2.5                           | SW          | M         | Good                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Hard surface located in RPA. Located adjacent road within field boundary vegetation. | 40+                                      | A2                             |
| T43      | Populus nigra 'Italica' - Lombardy Poplar | 11         | 0.5              | 0.5  | 0.5 | 0.5 | 150            | 1                | 3                             | SW          | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Located within field boundary vegetation.                                                                                                            | 20-40                                    | C2                             |
| T44      | Quercus robur - Pedunculate Oak           | 9          | 4                | 4    | 3   | 3   | 250            | 1                | 2                             | SW          | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. Hard surface located in RPA. Located adjacent road within field boundary vegetation.                                                                 | 20-40                                    | B2                             |
| T45      | Quercus robur - Pedunculate Oak           | 13         | 4                | 5    | 6   | 6   | 500            | 1                | 4                             | SW          | EM        | Fair                 | Good                    | Restricted inspection due to ivy and vegetation. Hard surface located in RPA. Located adjacent road within field boundary vegetation.                                                         | 40+                                      | A2                             |
| T46      | Quercus robur - Pedunculate Oak           | 15         | 7                | 7    | 6   | 9   | 820            | 1                | 1.00                          | South       | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Good open-grown specimen.                                                                                                                              | 40+                                      | A1                             |
| T47      | Quercus robur - Pedunculate Oak           | 15         | 9                | 10.0 | 7   | 8   | 1150           | 1                | 4                             | South       | M         | Fair                 | Good                    | Deadwood in the crown of moderate extent. Previous branch failures noted. Restricted inspection due to ivy. Good specimen. Locally Notable                                                    | 40+                                      | A3                             |
| T48      | Fraxinus excelsior - Common Ash           | 9          | 2.0              | 2    | 2   | 2   | 150            | 1                | 4                             | SE          | Y         | Good                 | Good                    | Restricted inspection due to vegetation. Growing adjacent pill-box in field boundary vegetation.                                                                                              | 20-40                                    | C2                             |
| T49      | Quercus robur - Pedunculate Oak           | 11         | 3                | 7    | 6   | 5   | 350            | 1                | 2                             | South       | SM        | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Hard surface located in RPA. Growing adjacent road in field boundary vegetation.                              | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                   | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                           |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                             |                                          |                                |
| T50      | Quercus robur - Pedunculate Oak           | 8          | 2                | 4.0 | 3   | 3   | 200            | 1                | 2.0                           | South       | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | B2                             |
| T51      | Quercus robur - Pedunculate Oak           | 8          | 2.0              | 4.0 | 3.0 | 3.0 | 200            | 1                | 1                             | West        | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | B2                             |
| T52      | Quercus robur - Pedunculate Oak           | 15         | 5                | 4.0 | 5   | 5   | 600            | 1                | 3                             | SW          | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Hard surface located in RPA. Growing adjacent road in field boundary vegetation.            | 40+                                      | A2                             |
| T53      | Fraxinus excelsior - Common Ash           | 9          | 1                | 2   | 2   | 2   | 140            | 1                | 2                             | South       | Y         | Poor                 | Good                    | Growing in field boundary vegetation. Height / form potential hindered by suppression from large oak.                                                                       | 10-20                                    | C2                             |
| T54      | Fraxinus excelsior - Common Ash           | 9          | 1.0              | 2.0 | 2.0 | 1   | 140            | 1                | 2                             | South       | Y         | Poor                 | Good                    | Growing in field boundary vegetation. Height / form potential hindered by suppression from large oak.                                                                       | 10-20                                    | C2                             |
| T55      | Quercus robur - Pedunculate Oak           | 14         | 5                | 7   | 5.5 | 6   | 400            | 1                | 2                             | SE          | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Hard surface located in RPA. Growing adjacent road in field boundary vegetation.                                                     | 40+                                      | A2                             |
| T56      | Quercus robur - Pedunculate Oak           | 13         | 4                | 5   | 4   | 6   | 500            | 1                | 6                             | South       | EM        | Fair                 | Good                    | Deadwood in the crown of moderate extent. Restricted inspection due to ivy and vegetation. Hard surface located in RPA. Growing adjacent road in field boundary vegetation. | 40+                                      | A2                             |
| T57      | Fraxinus excelsior - Common Ash           | 10         | 2                | 2   | 2   | 2   | 150            | 1                | 2                             | SE          | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | C2                             |
| T58      | Populus nigra 'Italica' - Lombarby Poplar | 15         | 1                | 1   | 1   | 1   | 150            | 1                | 3                             | SE          | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | C2                             |
| T59      | Populus nigra 'Italica' - Lombarby Poplar | 16         | 1.0              | 1.0 | 1.0 | 1.0 | 170            | 1                | 3                             | West        | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | B2                             |
| T60      | Quercus robur - Pedunculate Oak           | 13         | 4                | 5   | 6   | 4   | 500            | 1                | 3                             | South       | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation. Hard surface located in RPA. Growing adjacent road in field boundary vegetation.    | 40+                                      | A2                             |
| T61      | Populus nigra 'Italica' - Lombarby Poplar | 15         | 1                | 1   | 1   | 1   | 160            | 1                | 3                             | South       | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                              | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                   | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                           |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                           |                                          |                                |
| T62      | Populus nigra 'Italica' - Lombardy Poplar | 15         | 1.0              | 1.0 | 1.0 | 1.0 | 160            | 1                | 1                             | SE          | Y         | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                                                            | 20-40                                    | B2                             |
| T63      | Quercus robur - Pedunculate Oak           | 11         | 3                | 8   | 7   | 6   | 550            | 1                | 3                             | SE          | EM        | Fair                 | Fair                    | Pruning wounds to crown. Restricted inspection due to ivy and vegetation. Not plotted on land survey plan. Growing adjacent road in field boundary vegetation. Utility pruned.                            | 20-40                                    | B2                             |
| T64      | Quercus robur - Pedunculate Oak           | 12         | 4                | 4   | 4   | 3   | 300            | 1                | 2                             | SE          | SM        | Good                 | Good                    | Restricted inspection due to ivy and vegetation. Not plotted on land survey plan. Growing adjacent road in field boundary vegetation.                                                                     | 20-40                                    | B2                             |
| T65      | Quercus robur - Pedunculate Oak           | 12         | 3                | 5   | 4.5 | 2.5 | 300            | 1                | 2                             | SW          | SM        | Good                 | Good                    | Restricted inspection due to ivy and vegetation. Not plotted on land survey plan. Growing adjacent road in field boundary vegetation.                                                                     | 20-40                                    | B2                             |
| T66      | Quercus robur - Pedunculate Oak           | 15         | 5                | 7   | 7   | 6   | 600            | 1                | 2                             | SE          | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation. Hard surface located in RPA. Not plotted on land survey plan. Growing adjacent road in field boundary vegetation. | 40+                                      | A2                             |
| T67      | Fraxinus excelsior - Common Ash           | 6          | 0                | 2   | 2   | 2   | 150            | 1                | 1                             | South       | Y         | Poor                 | Good                    | Pruning wounds to crown. Heavily suppressed crown. Not plotted on land survey plan. Growing in field boundary vegetation.                                                                                 | 10-20                                    | C2                             |
| T68      | Fraxinus excelsior - Common Ash           | 6          | 0.0              | 2.0 | 2.0 | 2.0 | 150            | 1                | 1                             | SE          | Y         | Poor                 | Good                    | Pruning wounds to crown. Heavily suppressed crown. Not plotted on land survey plan. Growing in field boundary vegetation.                                                                                 | 10-20                                    | C2                             |
| T69      | Fraxinus excelsior - Common Ash           | 10         | 2                | 2.0 | 1   | 2.0 | 200            | 1                | 2                             | South       | SM        | Fair                 | Good                    | Pruning wounds to crown. Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                                   | 20-40                                    | B2                             |
| T70      | Fraxinus excelsior - Common Ash           | 10         | 2.0              | 2.0 | 1.0 | 2.0 | 220            | 1                | 2                             | SW          | SM        | Fair                 | Good                    | Pruning wounds to crown. Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                                   | 20-40                                    | B2                             |
| T71      | Populus nigra 'Italica' - Lombardy Poplar | 15         | 1                | 1   | 1.0 | 1   | 230            | 1                | 1.5                           | SE          | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                                                            | 20-40                                    | B2                             |
| T72      | Acer campestre - Field Maple              | 9          | 2                | 1.0 | 2   | 2   | 150, 230       | 2.00             | 1                             | South       | SM        | Fair                 | Good                    | Included main stem union. Pruning wounds to crown. Restricted inspection due to vegetation. General poor form to tree. Growing in field boundary vegetation.                                              | 10-20                                    | C2                             |
| T73      | Populus nigra 'Italica' - Lombardy Poplar | 16         | 1                | 1.0 | 1   | 1   | 230            | 1                | 2                             | SW          | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. Growing in field boundary vegetation.                                                                                                                            | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                    | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                           | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                            |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                              |                                          |                                |
| T74      | Acer campestre - Field Maple               | 5          | 1.0              | 0.5 | 1.0 | 1.0 | 110            | 1                | 1                             | West        | Y         | Fair                 | Fair                    | Pruning wounds to crown. Growing in field boundary vegetation.                                                                                                               | 10-20                                    | C2                             |
| T75      | Quercus robur - Pedunculate Oak            | 11         | 4                | 6   | 4   | 6   | 500            | 1                | 2                             | South       | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation. Hard surface located in RPA. Located adjacent road within field boundary vegetation. | 40+                                      | A2                             |
| T76      | Fraxinus excelsior - Common Ash            | 5          | 1                | 1.0 | 1.0 | 1.0 | 90             | 1                | 3                             | SE          | Y         | Fair                 | Good                    | Restricted inspection due to off site.                                                                                                                                       | 10-20                                    | C2                             |
| T77      | Fraxinus excelsior - Common Ash            | 12         | 4                | 4   | 4   | 4   | 220            | 1                | 2.5                           | East        | SM        | Good                 | Good                    | Restricted inspection due to off site.                                                                                                                                       | 20-40                                    | B2                             |
| T78      | Fraxinus excelsior - Common Ash            | 4          | 2                | 0.5 | 0.5 | 0.5 | 90, 60, 50     | 3.00             | 0.5                           | North       | Y         | Poor                 | Good                    | General poor form to tree.                                                                                                                                                   | 10-20                                    | C2                             |
| T79      | Fraxinus excelsior - Common Ash            | 8          | 2.5              | 2.5 | 2.5 | 2.5 | 230            | 1                | 0.5                           | East        | SM        | Fair                 | Good                    | Growing adjacent wire fence with bark contact.                                                                                                                               | 10-20                                    | C2                             |
| T80      | Acer pseudoplatanus - Sycamore             | 8          | 3.0              | 3.0 | 1.0 | 3.0 | 160            | 1                | 1.5                           | North       | Y         | Poor                 | Good                    | Growing through fence with stem damage.                                                                                                                                      | 10-20                                    | C1                             |
| T81      | x Cupressocyparis leylandii - Guelder Rose | 9          | 2                | 2   | 2   | 2   | 250            | 1                | 0.5                           | North       | SM        | Good                 | Good                    | Restricted inspection due to off site.                                                                                                                                       | 20-40                                    | B2                             |
| T82      | Prunus domestica - Plum                    | 9          | 5                | 4   | 4   | 3   | 180, 150, 150  | 3.00             | 0.5                           | North       | EM        | Poor                 | Good                    | Included main stem union. General poor form to tree.                                                                                                                         | 10-20                                    | C2                             |
| T83      | Fraxinus excelsior - Common Ash            | 5          | 2                | 2   | 2   | 2   | 140            | 1                | 2                             | East        | Y         | Good                 | Good                    | Restricted inspection due to vegetation.                                                                                                                                     | 20-40                                    | C1                             |
| T84      | Fraxinus excelsior - Common Ash            | 13         | 7                | 7   | 7   | 5   | 600            | 1                | 0.5                           | SE          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation. General poor form to tree.                                                           | 20-40                                    | B2                             |
| T85      | Fraxinus excelsior - Common Ash            | 16         | 5                | 4   | 5   | 5   | 300, 250, 200  | 3.00             | 2                             | NE          | M         | Poor                 | Good                    | Included main stem union. Deadwood in the crown of minor extent. Fused limb/branches.                                                                                        | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                             | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                |                                          |                                |
| T86      | Quercus robur - Pedunculate Oak | 15         | 4                | 4.0 | 7   | 5   | 500            | 1                | 4                             | NE          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent.                                                                                                                                                                                         | 40+                                      | A2                             |
| T87      | Fraxinus excelsior - Common Ash | 15         | 4.0              | 4.0 | 5.5 | 5.0 | 480, 300       | 2.00             | 4                             | East        | M         | Fair                 | Good                    | Included main stem union. Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                                                                             | 20-40                                    | B2                             |
| T88      | Quercus robur - Pedunculate Oak | 16         | 5                | 5   | 6   | 5.0 | 600            | 1.00             | 2                             | NW          | M         | Good                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent.                                                                                                                                                                | 40+                                      | A2                             |
| T89      | Quercus robur - Pedunculate Oak | 18         | 6                | 6   | 7   | 6   | 920            | 1                | 4                             | East        | M         | Poor                 | Good                    | Deadwood in the crown of moderate extent. Restricted inspection due to ivy. Decay column opening at base with Fistulina hepatica brackets. Potential future veteran.                                                           | 20-40                                    | A3                             |
| T90      | Acer campestre - Field Maple    | 14         | 10               | 4   | 7   | 6   | 650            | 1                | 2                             | NE          | M         | Fair                 | Good                    | The tree is leaning at a 20 degree angle in a North direction. Restricted inspection due to ivy and vegetation. Large old maple. Potential future veteran.                                                                     | 20-40                                    | B3                             |
| T91      | Quercus robur - Pedunculate Oak | 16         | 6                | 7   | 6   | 6.0 | 700            | 1                | 2                             | SW          | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation.                                                                                                                                        | + 40                                     | A2                             |
| T92      | Acer campestre - Field Maple    | 10         | 7                | 3   | 4   | 2   | 350            | 1                | 4                             | South       | M         | Poor                 | Good                    | The tree is leaning at a 20 degree angle in a NE direction. major stem cavity. Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                        | 10-20                                    | C2                             |
| T93      | Quercus robur - Pedunculate Oak | 16         | 7.0              | 7   | 7   | 6   | 900            | 1                | 1.5                           | North       | M         | Fair                 | Good                    | Included main stem union. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Large "ears" either side of included union signifying internal decay.                                                | 20-40                                    | B2                             |
| T94      | Quercus robur - Pedunculate Oak | 9          | 6                | 6   | 7   | 7   | 550            | 1                | 3                             | North       | M         | Fair                 | Good                    | Lost leader in past resulting in squat form.                                                                                                                                                                                   | 40+                                      | B2                             |
| T95      | Acer campestre - Field Maple    | 10         | 3                | 3   | 3   | 2   | 350            | 1                | 2                             | SW          | EM        | Good                 | Good                    | Pruning wounds to crown. Restricted inspection due to vegetation.                                                                                                                                                              | 20-40                                    | B2                             |
| T96      | Acer campestre - Field Maple    | 9          | 3.0              | 3.0 | 3.0 | 3   | 200            | 1                | 1                             | North       | SM        | Poor                 | Good                    | Heavily suppressed crown. Restricted inspection due to vegetation. General poor form to tree. Not plotted on land survey plan.                                                                                                 | 10-20                                    | C2                             |
| T97      | Quercus robur - Pedunculate Oak | 9          | 5                | 4   | 4   | 4   | 550            | 1                | 2.5                           | East        | M         | Poor                 | Poor                    | moderate stem cavity. Deadwood in the crown of moderate extent. Branch dieback of major extent. Hard surface located in RPA. Recommend crown is deadwooded. In severe decline, possibly due to access associated hard surface. | 10-20                                    | C1                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                 |                                          |                                |
| T98      | Salix caprea - Goat Willow      | 9          | 2                | 3    | 3   | 3   | 200            | 1                | 2                             | South       | SM        | Poor                 | Good                    | Stem wounds are present. Large pruning wound where dual stem removed.                                                                                                                                                           | 10-20                                    | C1                             |
| T99      | Salix caprea - Goat Willow      | 9          | 5                | 2    | 3.0 | 3.0 | 250, 180       | 2.00             | 0.5                           | North       | EM        | Fair                 | Good                    | Pruning wounds to crown. Hard surface located in RPA.                                                                                                                                                                           | 10-20                                    | C1                             |
| T100     | Quercus robur - Pedunculate Oak | 18         | 10               | 5    | 10  | 7   | 7500           | 1                | 3                             | East        | M         | Good                 | Good                    | Deadwood in the crown of moderate extent. Larger than woodland trees surrounding it.                                                                                                                                            | 40+                                      | A2                             |
| T102     | Quercus robur - Pedunculate Oak | 10         | 3.5              | 4.5  | 4.5 | 4.5 | 450            | 1                | 2.5                           | West        | EM        | Good                 | Good                    | Deadwood in the crown of Minor extent. Recommend crown is deadwooded.                                                                                                                                                           | 40+                                      | C2                             |
| T103     | Quercus robur - Pedunculate Oak | 8          | 6.0              | 2.5  | 4.5 | 6.0 | 200, 150, 150  | 3.00             | 2.5                           | West        | EM        | Good                 | Fair                    | Asymmetric formed crown. Heavily suppressed crown. Multi stemmed stem formed at 1.5 metres. Deadwood in the crown of Minor extent. Recommend crown is deadwooded.tri stem at chest height.                                      | 40+                                      | C2                             |
| T104     | Quercus robur - Pedunculate Oak | 12         | 7.0              | 7.0  | 7.0 | 7.0 | 450            | 1                | 3.5                           | South       | M         | Good                 | Fair                    | Deadwood in the crown of Minor extent. Recommend crown is deadwooded.Lacks some vigour, deadwood snags.tri stem at chest height.                                                                                                | 40+                                      | B2                             |
| T105     | Quercus robur - Pedunculate Oak | 14         | 8.0              | 4.0  | 7.0 | 8.5 | 450            | 1                | 2.0                           | South       | M         | Good                 | Good                    | Low domed form, deadwood snags. Set adjacent to ditch.tri stem at chest height.                                                                                                                                                 | 40+                                      | B2                             |
| T106     | Quercus robur - Pedunculate Oak | 16         | 9.5              | 10.5 | 7.0 | 9.0 | 950            | 1                | 1.5                           | South       | M         | Good                 | Good                    | Minor stem cavity. Deadwood in the crown of Minor extent. Recommend conservation deadwooding.Fine oak. Set adjacent to ditch. Deadwood snags, broad form.tri stem at chest height.                                              | 40+                                      | A2                             |
| T107     | Quercus robur - Pedunculate Oak | 6          | 8.0              | 10.5 | 4.5 | 8.0 | 250, 400, 350  | 3.00             | 2.0                           | South       | M         | Fair                 | Good                    | Bifurcated stem formed at 0.5 metres. Deadwood in the crown of Minor extent. Branch dieback of Minor extent. Crown reduction recommended of 10 %.Recommend conservation deadwooding.Low, twisted form. Bough extends from base. | 40+                                      | B2                             |
| T108     | Fraxinus excelsior - Common Ash | 6          | 6.0              | 1.0  | 3.5 | 4.0 | 150, 180       | 2.00             | 2.0                           | East        | Y         | Good                 | Good                    | Asymmetric formed crown. Bifurcated stem formed at 0.0 metres. Twin stem from base.                                                                                                                                             | 20-40                                    | C2                             |
| T109     | Quercus robur - Pedunculate Oak | 6          | 8.0              | 8.5  | 8.0 | 8.0 | 950            | 1                | 2.0                           | North       | M         | Good                 | Good                    | Deadwood in the crown of Minor extent. Recommend crown is deadwooded.Fine maiden oak, set on boundary. Some hung deadwood, minor. Slight bias to south west in flute of bole.                                                   | 20-40                                    | A2                             |
| T110     | Quercus robur - Pedunculate Oak | 6          | 2.0              | 2.0  | 2.5 | 1.5 | 150, 170       | 2.00             | 2.5                           | SE          | Y         | Fair                 | Good                    | Some evidence of bark damage. Asymmetric formed crown. Bifurcated stem formed at 0.0 metres. Twisted form from ground level. Horse browse on stem.                                                                              | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                 | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                  | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                         |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                     |                                          |                                |
| T111     | Quercus robur - Pedunculate Oak         | 8          | 5.0              | 4.0 | 6.0 | 4.0 | 450            | 1                | 3.0                           | North       | EM        | Good                 | Good                    | The tree is leaning at a 25 degree angle in a NW direction. Asymmetric formed crown. Ivy on main bole, twisted stem , with bias to east.                                                                            | 40+                                      | C2                             |
| T112     | Quercus robur - Pedunculate Oak         | 6          | 4.0              | 3.0 | 3.0 | 3.5 | 200, 200       | 2.00             | 2.5                           | North       | Y         | Good                 | Good                    | Bifurcated stem formed at 1.5 metres. Young twin stem, with potential.                                                                                                                                              | 40+                                      | C2                             |
| T113     | Quercus robur - Pedunculate Oak         | 14         | 4.0              | 7.5 | 3.0 | 9.0 | 650            | 1.00             | 0.0                           | North       | OM        | Good                 | Good                    | Asymmetric formed crown. Deadwood in the crown of Minor extent. Restricted inspection due to ivy. Recommend crown is deadwooded.Recommend ivy is severed.Fine oak, dense ivy cover. <u>Major bough to west.</u>     | 40+                                      | C2                             |
| T114     | Corylus avellana - Common Hazel         | 5          | 4.0              | 3.5 | 4.5 | 3.5 | 100            | 6                | 1.0                           | North       | M         | Good                 | Good                    | Recommend conservation deadwooding.Pair of close hazel coppice stools. Some lapsed stems.Recoppice or manage failing stems.                                                                                         | 20-40                                    | C3                             |
| T115     | Populus canescens - Balsam poplar       | 7          | 2.0              | 1.0 | 1.0 | 1.0 | 650            | 1                | 2.0                           | North       | Y         | Good                 | Good                    | Asymmetric formed crown. Slight bias to northRecoppice or manage failing stems.                                                                                                                                     | 20-40                                    | C2                             |
| T116     | Fraxinus excelsior - Common Ash         | 13         | 3.5              | 3.5 | 3.5 | 3.5 | 200            | 1                | 2.0                           | North       | Y         | Good                 | Good                    | Recommend ivy is severed.Slight bias to north                                                                                                                                                                       | 20-40                                    | C2                             |
| T117     | Aesculus hippocastanum - Horse Chestnut | 9          | 3.0              | 3.0 | 3.0 | 3.5 | 170            | 1                | 1.5                           | NE          | Y         | Good                 | Good                    | Slight bias to north                                                                                                                                                                                                | 20-40                                    | C2                             |
| T118     | Salix caprea - Goat Willow              | 10         | 4.0              | 3.0 | 4.0 | 4.0 | 200            | 1                | 1.5                           | NW          | EM        | Fair                 | Good                    | The tree is leaning at a 10 degree angle in a NW direction. Bifurcated stem formed at 2.0 metres. Slight bias to north                                                                                              | 20-40                                    | C2                             |
| T119     | Fraxinus excelsior - Common Ash         | 10         | 3.0              | 3.0 | 4.0 | 4.0 | 200            | 1                | 2.5                           | West        | SM        | Fair                 | Good                    | Bifurcated stem formed at 3.0 metres.                                                                                                                                                                               | 20-40                                    | C2                             |
| T120     | Quercus robur - Pedunculate Oak         | 27         | 14               | 12  | 12  | 12  | 1000           | 1                | 3.5                           | East        | OM        | Fair                 | Good                    | Deadwood in the crown of Minor extent. Restricted inspection due to ivy. Superb maiden form oak, dense ivy cover throughout canopy.Set on low bank.Consider severing ivy.                                           | 20-40                                    | C2                             |
| T121     | Quercus robur - Pedunculate Oak         | 10         | 6.0              | 3.0 | 4.0 | 3.0 | 200            | 1                | 0.0                           | East        | SM        | Fair                 | Good                    | Asymmetric formed crown. Multi stemmed stem formed at 1.5 metres. Restricted inspection due to ivy. Recommend ivy is severed.Canopy bias to north, ivy cover. Part of boundary group. <u>Consider severing ivy.</u> | 20-40                                    | C2                             |
| T122     | Quercus robur - Pedunculate Oak         | 10         | 5.0              | 5.0 | 5.0 | 3.0 | 200, 300, 250  | 3.00             | 3.0                           | East        | EM        | Good                 | Good                    | Asymmetric formed crown. Multi stemmed stem formed at 0.0 metres. Large multistem, or number of close individuals. Bias to east.                                                                                    | 40+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                             | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                |                                          |                                |
| T123     | Acer campestre - Field Maple    | 10         | 2.5              | 3.0 | 4.0 | 0.5 | 150, 150, 200, 100 | 4.00             | 3.0                           | East        | SM        | Fair                 | Good                    | Multi-stemmed hedgerow tree. Limited stature. Crossing branches in Crown.                                                                                      | 20-40                                    | C2                             |
| T124     | Quercus robur - Pedunculate Oak | 11         | 3.0              | 3.5 | 4.5 | 1.0 | 260                | 1                | 2.0                           | East        | SM        | Fair                 | Good                    | Crossing branches in Crown. Crown bias East. Hedge row tree.                                                                                                   | 20-40                                    | C2                             |
| T125     | Quercus robur - Pedunculate Oak | 11         | 4                | 2   | 4.5 | 2.5 | 260                | 1                | 3                             | East        | SM        | Fair                 | Good                    | Tall narrow crowned form. Hedgerow tree. Unable to inspect roadside of stem.                                                                                   | 20-40                                    | C2                             |
| T126     | Quercus robur - Pedunculate Oak | 12         | 2.5              | 3.5 | 4.5 | 4   | 250                | 1                | 3                             | East        | SM        | Good                 | Good                    | Strong central leader. Good crown vitality. Crown interlocks with adjacent tree. Hedgerow tree. Unable to inspect roadside of stem.                            | 20-40                                    | C2                             |
| T127     | Quercus robur - Pedunculate Oak | 12         | 5.5              | 2.5 | 4.5 | 4.0 | 250                | 1                | 0.0                           | East        | SM        | Good                 | Fair                    | Crown lacks central leader. Good ground vitality. Crown interlocks with adjacent tree. Hedgerow tree. Unable to inspect the roadside of stem.                  | 20-40                                    | C2                             |
| T128     | Fraxinus excelsior - Common Ash | 12         | 4                | 4   | 4.5 | 3   | 120, 130, 130, 150 | 4.00             | 5                             | East        | SM        | Good                 | Fair                    | Multiple stems approximately 1 m. Moderate IV on stems. Hedgerow tree. Limited stature.                                                                        | 20-40                                    | C2                             |
| T129     | Quercus robur - Pedunculate Oak | 12         | 3.5              | 2.5 | 4.5 | 2   | 250                | 1                | 1.0                           | East        | SM        | Good                 | Good                    | Strong apical growth. Minor Ivy mid stem. Crown bias to East. The value. Ltd individual stature. Limited individual stature.                                   | 20-40                                    | C2                             |
| T130     | Quercus robur - Pedunculate Oak | 10         | 4                | 3   | 5.5 | 1   | 240                | 1                | 2.5                           | NE          | SM        | Fair                 | Fair                    | Minor deadwood in lower crown. Spindly scaffold limb structure. Bifurcated at approximately 2.5 m. Compression fork likely to develop. Limited stature.        | 20-40                                    | C2                             |
| T131     | Acer campestre - Field Maple    | 10         | 1.5              | 2.5 | 2   | 2.5 | 100, 150, 80, 80   | 4.00             | 4                             | East        | SM        | Fair                 | Good                    | Good Crown vitality, multiple leaders in Crown. Compression forks developing between basal stems. Limited individual stature, group value.                     | 20-40                                    | C2                             |
| T132     | Acer campestre - Field Maple    | 11         | 0.5              | 2.0 | 2.0 | 2.5 | 80, 80, 100        | 3                | 6.0                           | East        | SM        | Fair                 | Good                    | Formed of multiple adjacent stems at ground level. Narrow crown. Limited individual stature.                                                                   | 10-20                                    | C2                             |
| T133     | Fraxinus excelsior - Common Ash | 12         | 1.0              | 5.0 | 5.5 | 3.0 | 150, 100, 150      | 3                | 3.0                           | East        | SM        | Fair                 | Good                    | Formed of two adjacent stands at ground level. Further diverges in Crown, which lacks central leader. Moderate Ivy on middle stem. Limited individual amenity. | 20-40                                    | C2                             |
| T134     | Fraxinus excelsior - Common Ash | 13         | 2.5              | 3.0 | 4.0 | 3.5 | 100                | 6.00             | 4.0                           | East        | EM        | Fair                 | Good                    | Coppice store with a regrowth. Multiple leaders in Crown. Limited individual amenity.                                                                          | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                      | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                         |                                          |                                |
| T135     | Fraxinus excelsior - Common Ash | 13         | 2.5              | 1   | 3   | 2.5 | 150            | 1                | 4                             | NE          | SM        | Fair                 | Good                    | Tall narrow crowned form. Apical dominance lost at approximately 7 m. Compression fork likely to develop at point of bifurcation.                                                                                                                       | 20-40                                    | C2                             |
| T136     | Acer campestre - Field Maple    | 12         | 4                | 1.0 | 2   | 3   | 200            | 1                | 4.00                          | NE          | SM        | Fair                 | Good                    | Multiple leaders in Crown. Good Crown vitality. Limited individual amenity. Unable to inspect unions in detail due to dense vegetation.                                                                                                                 | 20-40                                    | C2                             |
| T137     | Quercus robur - Pedunculate Oak | 18         | 8.0              | 8.0 | 7.0 | 9.0 | 200            | 1                | 3.5                           | SE          | M         | Good                 | Good                    | Prominent tree in Hedgerow. Wide spreading dense Crown with good vitality. Minor to moderate deadwood in lower Crown. Ivy throughout in a Crown limited inspection of branch to stem unions. A fine tree.                                               | 40+                                      | A2                             |
| T138     | Fraxinus excelsior - Common Ash | 14         | 5                | 5   | 4.5 | 4   | 150, 150, 150  | 3.00             | 4                             | East        | SM        | Fair                 | Good                    | Tree is slightly taller than others in Hedgerow. Limited individual amenity nonetheless. lacks central leader multiple stems at ground level. Inspection of lower stems limited by dense vegetation. stem diameter is estimated. Ivy clad middle stems. | 20-40                                    | C2                             |
| T139     | Quercus robur - Pedunculate Oak | 16         | 5.5              | 5.5 | 7.5 | 7.0 | 350, 200       | 2.00             | 2.5                           | South       | EM        | Good                 | Good                    | Good decurrent Crown form. Good ground vitality. Branch diverges from main stem to the east. Accessed to stem limited, diameter estimated.                                                                                                              | 20-40                                    | B2                             |
| T140     | Quercus robur - Pedunculate Oak | 16         | 5.0              | 5.5 | 5.0 | 4.0 | 350            | 1.00             | 2.0                           | South       | EM        | Fair                 | Good                    | Bifurcates at ground level, union appears sound. Stems self suppress one another. Good crown vitality.                                                                                                                                                  | 20-40                                    | B2                             |
| T141     | Fraxinus excelsior - Common Ash | 12         | 1.5              | 2.0 | 1.0 | 5.0 | 150            | 1                | 4.0                           | SW          | SM        | Fair                 | Good                    | Crown form suppressed by adjacent tree. Good vitality nonetheless. Leader off kilter to the West.                                                                                                                                                       | 20-40                                    | C2                             |
| T142     | Quercus robur - Pedunculate Oak | 17         | 8                | 5.5 | 6.5 | 7.5 | 800            | 1                | 4                             | SW          | M         | Good                 | Good                    | Prominent tree located at border. Wide spreading crown. Good vitality. Ivy cloaked from stem to mid crown. Previous excavation within RPA.                                                                                                              | 40+                                      | A2                             |
| T143     | Quercus robur - Pedunculate Oak | 17         | 8.0              | 10  | 8.5 | 10  | 800            | 1                | 6                             | South       | M         | Good                 | Good                    | Prominent tree not included in original topographic survey. Diameters estimated. Compression within RPA. Moderate deadwood limbs, lower crown. Wide spreading the current crown form.                                                                   | 40+                                      | A2                             |
| T144     | Quercus robur - Pedunculate Oak | 16         | 3.0              | 7.5 | 2.5 | 6.0 | 200, 350       | 2.00             | 0.0                           | South       | EM        | Good                 | Fair                    | Unable to access basal stems, diameters estimated. Bifurcation and ground level. Crossing limbs in Crown. Compression fork likely to develop in future. Eastern stem shows good apical dominance.                                                       | 20-40                                    | C2                             |
| T145     | Quercus robur - Pedunculate Oak | 16         | 3.5              | 7.5 | 2.5 | 4.0 | 400            | 1                | 6.0                           | South       | EM        | Fair                 | Good                    | Unable to access basal stems, stem diameter estimated. Bifurcates at approximately 2 m, union appears to have included but inspection limited. Suppress Crown to East and West.                                                                         | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                      | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                         |                                          |                                |
| T146     | Quercus robur - Pedunculate Oak | 17         | 7.0              | 7.5 | 2.5 | 2.5 | 300                     | 1                | 0.0                           | South       | EM        | Good                 | Good                    | Strong apical growth. Narrow crown, suppressed East and West. Group value. Stem diameter estimated.                                                                     | 20-40                                    | C2                             |
| T147     | Quercus robur - Pedunculate Oak | 17         | 4.0              | 6.5 | 2.5 | 6.0 | 300                     | 1                | 5.0                           | SW          | EM        | Good                 | Good                    | Good scaffold limb form, if a little asymmetrical. Group value. Stem diameter estimated.                                                                                | 20-40                                    | C2                             |
| T148     | Quercus robur - Pedunculate Oak | 18         | 6.0              | 8.5 | 3.0 | 5.0 | 400                     | 1                | 6.0                           | SE          | EM        | Fair                 | Good                    | Stem diameter estimated. Crown biased to South, long scaffold limbs developing. Crown lacks essential leader. Group value.                                              | 20-40                                    | C2                             |
| T149     | Quercus robur - Pedunculate Oak | 17         | 7.5              | 7.5 | 7.5 | 6.5 | 580                     | 1                | 6                             | South       | M         | Good                 | Good                    | Well structured, and even crown form. Good amenity. Future potential.                                                                                                   | 40+                                      | B2                             |
| T150     | Fraxinus excelsior - Common Ash | 17         | 7.5              | 7.5 | 7.5 | 6.5 | 240, 120, 320           | 3.00             | 6.0                           | South       | EM        | Fair                 | Good                    | Bifurcates at ground level, union appears sound. Suppressed to the North, moderate deadwood in Northern Crown. Internal decay within East stem. Woodpecker holes noted. | 10-20                                    | C2                             |
| T151     | Quercus robur - Pedunculate Oak | 17         | 7.5              | 7.0 | 2.0 | 2.0 | 250                     | 1                | 0.0                           | South       | EM        | Good                 | Good                    | Good Crown vitality. Crown suppressed to the East and West. Group value.                                                                                                | 20-40                                    | C2                             |
| T152     | Fraxinus excelsior - Common Ash | 15         | 0.0              | 7.0 | 3.5 | 2.5 | 150, 200                | 2.00             | 3.5                           | South       | SM        | Fair                 | Good                    | Stems off kilter with bias to South, Crown bias South. Previous limb failures noted.                                                                                    | 20-40                                    | C2                             |
| T153     | Quercus robur - Pedunculate Oak | 9          | 2.5              | 5.5 | 3.0 | 6.0 | 250, 80                 | 2.00             | 5.0                           | South       | EM        | Fair                 | Good                    | Main stem offkilter with bias to the West. Lever arm reduced in Crown.                                                                                                  | 20-40                                    | C2                             |
| T154     | Quercus robur - Pedunculate Oak | 15         | 8                | 8   | 7   | 6.5 | 380                     | 1                | 3                             | South       | EM        | Good                 | Good                    | Well structured crown. Good vitality. Future potential.                                                                                                                 | 40+                                      | B2                             |
| T155     | Fraxinus excelsior - Common Ash | 17         | 6.0              | 6.5 | 4.5 | 7.0 | 250, 200, 150, 200, 200 | 5.00             | 3.0                           | South       | EM        | Fair                 | Good                    | Formed of several adjacent stems at ground level. Unable to inspect basal unions due to dense vegetation. Good crown vitality, lacks central leader. Group value.       | 20-40                                    | C2                             |
| T156     | Quercus robur - Pedunculate Oak | 18         | 3.0              | 6.5 | 1.5 | 5.0 | 250                     | 1                | 2.0                           | South       | EM        | Good                 | Good                    | Crown suppressed in North, bias the south stop good apical growth and vitality. Group value.                                                                            | 20-40                                    | C2                             |
| T157     | Quercus robur - Pedunculate Oak | 20         | 5.0              | 9.0 | 5.0 | 6.0 | 700                     | 1                | 2.5                           | South       | M         | Good                 | Good                    | Good Crown vitality. More mature tree in group. Minor previous limb failure.                                                                                            | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |      |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|------|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S    | W    |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                    |                                          |                                |
| T158     | Quercus robur - Pedunculate Oak | 20         | 4.5              | 3.0  | 1.5  | 4.0  | 400            | 1                | 7.0                           | South       | EM        | Fair                 | Good                    | Tall, with relatively narrow crown form. Five the case at approximately 2 m, unable to inspect union due to fence and vegetation. Moderate deadwood in inner crown.                                                                                | 20-40                                    | C2                             |
| T159     | Quercus robur - Pedunculate Oak | 18         | 1.5              | 9.5  | 2.5  | 2.5  | 300            | 1                | 0.0                           | South       | EM        | Fair                 | Good                    | Crown suppressed by neighbouring trees, bias to South. Long lateral limb with heavy end weights developing, further monitor. Group value, but limited individual amenity.                                                                          | 20-40                                    | C2                             |
| T160     | Quercus robur - Pedunculate Oak | 20         | 1.5              | 10.0 | 2.5  | 7.5  | 300, 350       | 2.00             | 0.0                           | South       | EM        | Fair                 | Fair                    | Crown form biased to South, main stem bowing to South. Central leader previously failed. woodpecker holes noted on underside of bowing limb to South. Bifurcated at approximately 2 m. <u>compression fork present. Further monitor structural</u> | 20-40                                    | C2                             |
| T161     | Quercus robur - Pedunculate Oak | 20         | 4                | 9.5  | 3.0  | 6.0  | 420            | 1                | 0.0                           | South       | EM        | Fair                 | Good                    | Apical dominance lost at approximately 7 m, co-dominant leaders in Crown. Hanging branches caught up in Crown from adjacent tree. Minor deadwood in lower Crown.                                                                                   | 20-40                                    | B2                             |
| T162     | Quercus robur - Pedunculate Oak | 17         | 0.0              | 7.5  | 3.0  | 1.0  | 250            | 1                | 6.0                           | South       | SM        | Fair                 | Good                    | Stem off kilter and leaders straying to South West. Ivy cloaked stem. Limited individual stature.                                                                                                                                                  | 20-40                                    | C2                             |
| T163     | Quercus robur - Pedunculate Oak | 21         | 10               | 7    | 2.5  | 3    | 300, 350       | 2.00             | 8.00                          | South       | EM        | Fair                 | Good                    | Bifurcates a ground level, union appears sound. Co-dominant crown.                                                                                                                                                                                 | 40+                                      | B2                             |
| T164     | Quercus robur - Pedunculate Oak | 20         | 6                | 11   | 10.5 | 10.5 | 660, 430       | 2.00             | 0.0                           | South       | M         | Fair                 | Good                    | Bifurcates at ground level, previous compression fork has included with reaction wood, appears sound. Stems self suppress, southern stem has lateral scaffold limbs heavily end weighted. <u>consider Crown reduction.</u>                         | 40+                                      | A2                             |
| T165     | Quercus robur - Pedunculate Oak | 16         | 2.0              | 9.0  | 7.5  | 2.0  | 500            | 1                | 2.0                           | SW          | OM        | Poor                 | Poor                    | Tree is in terminal decline. Extensive deadwood and bark delamination. Extensive internal decay likely. Sparse live growth remains. Still has habitat value. Recommend Crown reduced/pollard did to invertebrate tower.                            | <10                                      | C3                             |
| T166     | Fraxinus excelsior - Common Ash | 18         | 3.5              | 10.5 | 4.5  | 5.5  | 300            | 1                | 3                             | South       | EM        | Good                 | Good                    | Not plotted on land survey plan. Off-site tree, Crown extends onto site. Crown biased to South, otherwise in apparent good condition.                                                                                                              | 20-40                                    | B2                             |
| T167     | Acer campestre - Field Maple    | 14         | 2                | 3.0  | 2.55 | 5.5  | 300            | 1                | 3.0                           | South       | EM        | Good                 | Good                    | Young tree, limited stature. Good vitality.                                                                                                                                                                                                        | 20-40                                    | C2                             |
| T168     | Quercus robur - Pedunculate Oak | 20         | 2.0              | 10.0 | 4.5  | 10.0 | 480            | 1                | 4                             | South       | EM        | Good                 | Good                    | Good scaffold limb structure, if biased to the South West. Good vitality. Future potential.                                                                                                                                                        | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |     |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|-----|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S   | W    |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                    |                                          |                                |
| T169     | Quercus robur - Pedunculate Oak | 20         | 2.0              | 5    | 3.0 | 3.5  | 250            | 1                | 2.0                           | South       | SM        | Fair                 | Good                    | Main stem offkilter, apical dominance lost at approximately 6 m. Narrow crown with bias to South.                                                                                                                                                  | 20-40                                    | C2                             |
| T170     | Quercus robur - Pedunculate Oak | 20         | 4.0              | 8.0  | 1.5 | 3.5  | 150            | 1                | 0.0                           | South       | EM        | Fair                 | Good                    | Crown suppressed West. Multiple leaders in Crown. Group value.                                                                                                                                                                                     | 20-40                                    | B2                             |
| T171     | Quercus robur - Pedunculate Oak | 20         | 3.5              | 8.5  | 3.5 | 10.5 | 350, 250       | 2.00             | 2.0                           | SW          | EM        | Fair                 | Good                    | Bifurcates at ground level, union appears sound but access limited due to fence. Stem diameters estimated. Hazard beam failure in lower South Crown, previously pruned. Asymmetric Crown, biased to South West. Group value.                       | 20-40                                    | B2                             |
| T172     | Quercus robur - Pedunculate Oak | 20         | 2.0              | 2.0  | 3.0 | 7.0  | 300            | 1                | 0.0                           | SW          | EM        | Dead                 | Dead                    | Tree is standing deadwood.recommend pollarded to invertebrate tower.                                                                                                                                                                               | <10                                      | C3                             |
| T173     | Fraxinus excelsior - Common Ash | 9          | 4.5              | 3.0  | 2.0 | 5.0  | 200            | 1                | 5.0                           | West        | SM        | Fair                 | Fair                    | Suppressed Crown form with bias to West. Minor dieback in lower East Crown. Limited stature.                                                                                                                                                       | 10-20                                    | C2                             |
| T174     | Fraxinus excelsior - Common Ash | 18         | 6.5              | 6.5  | 2.0 | 8.0  | 300            | 1                | 8.0                           | West        | EM        | Fair                 | Good                    | Bifurcates at approximately 4 m, unable to inspect union in detail. Off-site tree, not on original topographic survey. Good crown vitality.                                                                                                        | 20-40                                    | B2                             |
| T175     | Fraxinus excelsior - Common Ash | 16         | 5.5              | 2.5  | 3.0 | 4.0  | 250, 200       | 2.00             | 6.0                           | West        | EM        | Fair                 | Good                    | Bifurcates at approximately 0.5 m, unable to inspect union due to restricted access. Moderate deadwood in lower South Crown(approximately 3 m long and less than 5 cm diameter). Relatively narrow crown.                                          | 20-40                                    | C2                             |
| T176     | Quercus robur - Pedunculate Oak | 12         | 2.5              | 10.0 | 4.5 | 7.5  | 380            | 1                | 2.0                           | West        | EM        | Fair                 | Fair                    | Suppress Crown form with bias the South West. Previous failures of major limbs in Crown noted. Major deadwood in central and eastern crown. Tip dieback noted. Smaller than expected leaf size in upper crown. Tree appears to be in slow decline. | 10-20                                    | C2                             |
| T177     | Acer campestre - Field Maple    | 16         | 3.0              | 2.5  | 3.5 | 4.5  | 250, 100, 200  | 3.00             | 2.0                           | West        | EM        | Fair                 | Good                    | Formed of multiple stems from 1 m. Unions appear to be sound, but inspection limited by fence. Basal cavities indicated, inspection limited. Previous failure of leader in eastern crown, epicormic growth from wound point. Suppressed crown.     | 10-20                                    | C2                             |
| T178     | Fraxinus excelsior - Common Ash | 18         | 5.5              | 4.0  | 2.5 | 5.5  | 350            | 1                | 0.0                           | West        | EM        | Good                 | Good                    | High Crown, good vitality. Good scaffold limb structure.                                                                                                                                                                                           | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |      |     |      | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|------|-----|------|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E    | S   | W    |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                 |                                          |                                |
| T179     | Quercus robur - Pedunculate Oak      | 17         | 1.5              | 6.5  | 2.5 | 2.0  | 400                | 1                | 8.0                           | West        | EM        | Fair                 | Good                    | Crown biased to south, good Crown vitality. Bifurcated at approximately 6 m, tension fork. Unable to inspect basal stem due to dense vegetation. Group value.                                                                   | 20-40                                    | B2                             |
| T180     | Acer campestre - Field Maple         | 15         | 5.0              | 2.0  | 1.0 | 5.0  | 240                | 1                | 2.0                           | West        | EM        | Fair                 | Good                    | Minor stem cavities noted at approximately 1 m and 2 m, semi-occluded with exposed sap wood. Basal stem obscured by dense vegetation. Limited stature.                                                                          | 10-20                                    | C2                             |
| T181     | Crataegus monogyna - Common Hawthorn | 15         | 2.0              | 1.5  | 1.0 | 1.5  | 200                | 1                | 1.5                           | West        | M         | Fair                 | Good                    | Scrappy form, lower stem obscured by dense vegetation. Narrow crown, limited stature. Minor dieback in lower crown.                                                                                                             | 10-20                                    | C2                             |
| T182     | Quercus robur - Pedunculate Oak      | 20         | 6.5              | 10.0 | 11  | 10.0 | 650                | 1                | 2.0                           | West        | M         | Good                 | Good                    | Wide spreading crown, good scaffold limbs structure, lever arms reduced in upper crown. Good vitality. Clear stem. Prominent tree in area. Unable to inspect basal stem due to dense vegetation, stem diameter estimated.       | 40+                                      | A2                             |
| T183     | Quercus robur - Pedunculate Oak      | 15         | 4.5              | 2.0  | 1.0 | 6.0  | 300                | 1                | 2.0                           | West        | SM        | Fair                 | Good                    | Basal stem cavity noted at 1 m on Western stem. Approximately 1 m long, semi-occluded with internal decay to Heartwood. Good crown vitality, Crown suppressed to East. Limited stature. Further monitor internal decay extents. | 20-40                                    | C2                             |
| T184     | Quercus robur - Pedunculate Oak      | 18         | 8.0              | 10.0 | 8.0 | 11   | 550                | 1                | 0.0                           | West        | EM        | Good                 | Good                    | Even upper Crown, good decurrent crown form. Lower Crown overhangs site boundary. Prominent tree. Stem diameter estimated.                                                                                                      | 40+                                      | A2                             |
| T185     | Quercus robur - Pedunculate Oak      | 18         | 1.5              | 6.0  | 6.5 | 2.0  | 320                | 1                | 6.0                           | West        | EM        | Fair                 | Good                    | Suppressed by tree 84. Crown biased to South West. Relatively narrow crown. Limited stature.                                                                                                                                    | 20-40                                    | C2                             |
| T186     | Crataegus monogyna - Common Hawthorn | 8          | 2.5              | 5.0  | 2.5 | 5.0  | 150, 100, 120, 100 | 4.00             | 1.5                           | West        | EM        | Fair                 | Good                    | Not plotted on land survey plan. Formed of multiple stems, compression, fork unions present. Scrappy crown form. Limited amenity and stature.                                                                                   | 10-20                                    | C2                             |
| T187     | Quercus robur - Pedunculate Oak      | 16         | 7.5              | 5.5  | 2.5 | 5.0  | 500                | 1                | 6.0                           | SW          | EM        | Good                 | Good                    | Inspection of basal stem limited due to access, diameter estimated. Good scaffold limb structure. Good amenity tree, future potential.                                                                                          | 40+                                      | B2                             |
| T188     | Crataegus monogyna - Common Hawthorn | 17         | 6.5              | 3.5  | 2.0 | 9.0  | 380                | 1                | 2.0                           | West        | EM        | Fair                 | Good                    | Stem offkilter and leaning to West, Crown biased to West will stop Crown lacks potential leader. Some moderate deadwood in lower Crown. Otherwise good vitality. Group value.                                                   | 40+                                      | B2                             |
| T189     | Acer campestre - Field Maple         | 15         | 7.0              | 1.0  | 1.5 | 5.0  | 250                | 1                | 8.0                           | North       | EM        | Good                 | Good                    | Crown lacks central leader. Suppressed Crown form. Limited amenity.                                                                                                                                                             | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |      |       | Stem dia. (mm)    | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|------|-------|-------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S    | W     |                   |                  |                               |             |           |                      |                         |                                                                                                                                                                                                    |                                          |                                |
| T190     | Fraxinus excelsior - Common Ash      | 17         | 6.5              | 2.0 | 5.5  | 2.5   | 280               | 1                | 10.0                          | North       | EM        | Poor                 | Fair                    | Extensive basal cavity with open wound and internal decay noted. Basal flair to compensate for lack of strength. Tree is liable to fracture at basal stem. Recommend removal.                      | <10                                      | U                              |
| T191     | Quercus robur - Pedunculate Oak      | 17         | 3.5              | 4.5 | 10.0 | 2.5   | 400               | 1                | 2.0                           | West        | EM        | Fair                 | Good                    | Long lateral limbs to East and West. Considered 10% reduction of limbs overhanging site. Group value.                                                                                              | 40+                                      | B2                             |
| T192     | Quercus robur - Pedunculate Oak      | 20         | 9.0              | 6.5 | 7.0  | 11    | 400, 350, 300     | 3.00             | 1.5                           | West        | M         | Fair                 | Good                    | Co-dominant stems in Crown. Previous compression forks have used into one main stem. Wide spreading crown, good vitality. Prominent tree in the landscape. Moderate deadwood stubs in lower crown. | 40+                                      | A2                             |
| T193     | Quercus robur - Pedunculate Oak      | 18         | 7.0              | 8.0 | 1.0  | 8.0   | 370               | 1                | 2.0                           | West        | EM        | Fair                 | Good                    | Stem offkilter, lean corrected in Crown. Crown bias to West. Good vitality. Group value.                                                                                                           | 40+                                      | B2                             |
| T194     | Crataegus monogyna - Common Hawthorn | 7          | 1.5              | 4.0 | 2.5  | 5.0   | 200               | 1                | 2.0                           | SW          | EM        | Fair                 | Fair                    | Stem at leaning to South and Crown bias to South West. Heavily ivy clad mid stem. Scrappy form.                                                                                                    | 10-20                                    | C2                             |
| T195     | Quercus robur - Pedunculate Oak      | 20         | 5.0              | 4.0 | 8.0  | eight | 550               | 1                | 3.0                           | West        | M         | Fair                 | Good                    | Compression fork at approximately 2 m, much of included growth has occluded. Moderate sized deadwood in mid crown. Group value.                                                                    | 40+                                      | B2                             |
| T196     | Quercus robur - Pedunculate Oak      | 17         | 4.5              | 3.5 | 8.0  | 10.0  | 440               | 1                | 3.0                           | West        | EM        | Fair                 | Good                    | Moderate sized deadwood in lower south and south-west Crown. Ivy clad from lower stem to mid Crown. Good peripheral vitality.                                                                      | 40+                                      | B2                             |
| T197     | Quercus robur - Pedunculate Oak      | 17         | 4.5              | 6.0 | 9.0  | 10.5  | 420               | 1                | 1.5                           | West        | EM        | Fair                 | Good                    | Lower crown biased to West with lateral limb significant end weights, consider reduction of tertiary branches. Ivy clad from middle stem to middle crown.                                          | 40+                                      | B2                             |
| T198     | Quercus robur - Pedunculate Oak      | 12         | 1.0              | 8.0 | 1.0  | 9.5   | 380               | 1                | 1.5                           | SW          | EM        | Fair                 | Good                    | Heavily suppressed Crown, leaders stray away to South West. Minor deadwood image Crown. Limited stature.                                                                                           | 20-40                                    | C2                             |
| T199     | Fraxinus excelsior - Common Ash      | 12         | 1.0              | 4.5 | 1.5  | 2.0   | 200, 200          | 2.00             | 8.0                           | South       | SM        | Fair                 | Fair                    | Previously bifurcated stem, North Eastern stem has died. Remaining stem has taught, drawn out form with a narrow crown.                                                                            | 20-40                                    | C2                             |
| T200     | Crataegus monogyna - Common Hawthorn | 7          | 3.0              | 3.0 | 3.0  | 3.0   | 140, 120, 100, 80 | 4.00             | 2.0                           | North       | EM        | Fair                 | Good                    | Multi-stemmed stand. Compression forks likely to develop in future. Dense and vigorous Crown. Limited stature.                                                                                     | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                             |                                          |                                |
| T201     | Quercus robur - Pedunculate Oak      | 13         | 4.0              | 4.5 | 4.5 | 1.5 | 250            | 1                | 2.0                           | North       | SM        | Good                 | Good                    | Part of a linear row of trees. Suppressed to the West. Minor compression fork in Crown, otherwise good structure and vitality.              | 40+                                      | C2                             |
| T202     | Quercus robur - Pedunculate Oak      | 13         | 4.0              | 6.0 | 3.5 | 0.5 | 200            | 1                | 2.0                           | North       | SM        | Fair                 | Good                    | Part of a linear row of trees, Crown suppressed the East and West. Limited stature.                                                         | 20-40                                    | C2                             |
| T203     | Quercus robur - Pedunculate Oak      | 15         | 6.0              | 6.0 | 4.5 | 4.5 | 350            | 1                | 2.00                          | North       | EM        | Fair                 | Good                    | More prominent tree in linear row, dominant crown with fair scaffold limb structure. Compression forks may develop at main union in future. | 40+                                      | B2                             |
| T204     | Fraxinus excelsior - Common Ash      | 13         | 3.5              | 4.0 | 2.0 | 4.0 | 250            | 1                | 2.0                           | North       | SM        | Fair                 | Good                    | Part of a linear row of trees. Crown suppressed to East, otherwise good scaffold limb structure and good vitality.                          | 20-40                                    | C2                             |
| T205     | Fraxinus excelsior - Common Ash      | 14.5       | 3.0              | 3.5 | 3.5 | 1.5 | 200            | 1                | 6.0                           | East        | SM        | Good                 | Good                    | Strong apical growth and good vitality. Semi mature tree, limited stature.                                                                  | 20-40                                    | C2                             |
| T206     | Crataegus monogyna - Common Hawthorn | 5          | 3.5              | 1.5 | 2.0 | 1.5 | 100, 50        | 2.00             | 1.0                           | NE          | SM        | Fair                 | Good                    | Not plotted on land survey plan. Insignificant multi-stemmed tree at site boundary.                                                         | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                 |                                          |                                |
| T207     | Fraxinus excelsior - Common Ash | 12         | 2.0              | 1.0 | 4.0 | 1.0 | 100            | 1                | 6.0                           | NE          | Y         | Fair                 | Good                    | Not plotted on land survey plan. Young planted tree, suppressed and narrow Crown form.                                                                                                          | 10-20                                    | C2                             |
| T208     | Quercus robur - Pedunculate Oak | 14         | 6.5              | 5.0 | 6.0 | 7.0 | 500            | 1                | 2.5                           | North       | EM        | Fair                 | Good                    | Bifurcates 3 m, fusion word between stems and compression fork. Good crown vitality, lacks central leader. Moderate amenity.                                                                    | 40+                                      | B2                             |
| T209     | Quercus robur - Pedunculate Oak | 15         | 6.0              | 3.0 | 5.0 | 2.5 | 300            | 1                | 6.0                           | East        | EM        | Fair                 | Good                    | Suppressed to the South, leaders stray to the north. Relatively narrow crown.                                                                                                                   | 40+                                      | C2                             |
| T210     | Quercus robur - Pedunculate Oak | 17         | 4.0              | 4.0 | 6.0 | 8.5 | 600            | 1                | 0.0                           | East        | EM        | Fair                 | Fair                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Minor dieback in crown, moderate deadwood in middle and lower crown. Prominent tree at border. Group value.     | 20-40                                    | B2                             |
| T211     | Quercus robur - Pedunculate Oak | 10         | 1.0              | 1.0 | 0.0 | 7.0 | 220            | 1                | 2.0                           | West        | SM        | Fair                 | Fair                    | Located off site. Not plotted on land survey plan. Heavily suppressed crown form with bias West. Limited stature.                                                                               | 10-20                                    | C2                             |
| T212     | Quercus robur - Pedunculate Oak | 12         | 2.0              | 4.0 | 0.0 | 6.5 | 250            | 1                | 1.5                           | West        | SM        | Fair                 | Fair                    | Located off site. Not plotted on land survey plan. Suppressed crown form with bias West. Limited stature.                                                                                       | 20-40                                    | C2                             |
| T213     | Quercus robur - Pedunculate Oak | 15         | 1.0              | 2.0 | 6.0 | 7.0 | 250            | 1                | 5.0                           | East        | SM        | Poor                 | Fair                    |                                                                                                                                                                                                 | 10-20                                    | C2                             |
| T214     | Quercus robur - Pedunculate Oak | 18         | 4.5              | 2.0 | 6.0 | 5.0 | 550            | 1                | 1.5                           | West        | M         | Fair                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Moderate Deadwood mid crown. Ivy cloaked from lower stem to mid crown. More mature tree at border, group value. | 40+                                      | B2                             |
| T215     | Quercus robur - Pedunculate Oak | 18         | 3.0              | 5.0 | 4.5 | 5.5 | 450            | 1                | 6.0                           | East        | EM        | Fair                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Good Crown vitality. Lacks central leader. Bifurcates at approximately 8 m. Group value.                        | 40+                                      | B2                             |
| T216     | Quercus robur - Pedunculate Oak | 12         | 2.0              | 4.0 | 0.0 | 5.5 | 80, 100, 180   | 3.00             | 2.0                           | West        | EM        | Fair                 | Good                    | Suppressed Crown form leaders stray away to the west will stop minor to moderate deadwood in mid Crown. Good vitality where leaves present. Scrappy form.                                       | 10-20                                    | C2                             |
| T217     | Quercus robur - Pedunculate Oak | 14         | 2.0              | 1.5 | 1.0 | 5.0 | 250            | 1                | 3.0                           | West        | SM        | Fair                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Suppressed Crown form, stem and Crown stray to the West. Limited stature.                                       | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                   |                                          |                                |
| T218     | Quercus robur - Pedunculate Oak | 18         | 2.0              | 3.0 | 4.5 | 2.0 | 250            | 1                | 6.0                           | East        | SM        | Fair                 | Fair                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Suppressed Crown form. Sparse upper Crown with Deadwood and dieback.                                                                                                              | 10-20                                    | C2                             |
| T219     | Quercus robur - Pedunculate Oak | 15         | 5.5              | 5.5 | 7.0 | 7.0 | 450            | 1                | 3.0                           | West        | EM        | Fair                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Multiple scaffold limbs diverged from main stem at approximately 3 m. Central leader remains dominant. Good vitality. Group value.                                                | 40+                                      | B2                             |
| T220     | Quercus robur - Pedunculate Oak | 15         | 6.5              | 6.0 | 5.0 | 6.0 | 500            | 1                | 0.0                           | West        | EM        | Fair                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Minor to moderate previous limb failures noted. Moderate deadwood in mid crown. Good vitality in peripheral crown. Group value.                                                   | 40+                                      | B2                             |
| T221     | Quercus robur - Pedunculate Oak | 22         | 6.5              | 7.5 | 6.0 | 7.5 | 550, 350       | 2.00             | 2.0                           | West        | M         | Fair                 | Good                    | Located off site. Not plotted on land survey plan. Bifurcated Crown, good vitality. Bifurcates at basal compression fork. Reaction wood present, union appears sound currently. Detailed inspection prevented due to restricted access. Prominent tree on border. | 40+                                      | A2                             |
| T222     | Quercus robur - Pedunculate Oak | 20         | 6.0              | 6.0 | 6.0 | 6.0 | 450            | 1                | 0.0                           | West        | EM        | Fair                 | Fair                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Minor dieback in lower crown. Moderate deadwood in lower West crown. Moderate amenity and group value.                                                                            | 40+                                      | B2                             |
| T223     | Quercus robur - Pedunculate Oak | 18         | 9.0              | 9.0 | 9.0 | 8.0 | 700            | 1                | 0.0                           | West        | M         | Good                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. A fine tree, good scaffold limb structure. Even and dense crown with good vitality. Prominent landscape presence.                                                                 | 40+                                      | A2                             |
| T224     | Quercus robur - Pedunculate Oak | 16         | 4.0              | 6.0 | 6.0 | 8.0 | 550            | 1                | 2.0                           | West        | M         | Fair                 | Good                    | Strong apical growth and good crown vitality. Slightly underdeveloped scaffold limb structure.                                                                                                                                                                    | 40+                                      | B2                             |
| T225     | Quercus robur - Pedunculate Oak | 15         | 5.5              | 2.5 | 5.0 | 7.5 | 200, 250       | 2.00             | 1.5                           | West        | SM        | Good                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Previous limb failure in at the Crown noted. Bifurcated, unable to inspect basal stems due to dense vegetation and restricted access.                                             | 20-40                                    | C2                             |
| T226     | Quercus robur - Pedunculate Oak | 12         | 7.0              | 7.0 | 6.0 | 7.5 | 300, 600, 100  | 3.00             | 2.0                           | West        | M         | Good                 | Good                    | Hard surface located in RPA. Located off site. Not plotted on land survey plan. Wide spreading crown with good vitality. Multi-stemmed, but southernmost stem dominant. Strong apical growth in stem and decurrent Crown form. Prominent tree at border.          | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                 | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)    | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------|------------|------------------|-----|-----|-----|-------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                         |            | N                | E   | S   | W   |                   |                  |                               |             |           |                      |                         |                                                                                                                                                           |                                          |                                |
| T227     | Quercus robur - Pedunculate Oak         | 10         | 6.0              | 6.0 | 5.5 | 5.5 | 300               | 1.00             | 2.0                           | North       | SM        | Fair                 | Good                    | Tree lacks central leader. Good crown vitality. Limited stature.                                                                                          | 20-40                                    | C2                             |
| T228     | Quercus robur - Pedunculate Oak         | 9          | 2.0              | 3.0 | 2.0 | 3.0 | 200               | 1.00             | 4.0                           | North       | SM        | Fair                 | Good                    | Suppressed Crown form, limited stature.                                                                                                                   | 20-40                                    | C2                             |
| T229     | Crataegus monogyna - Common Hawthorn    | 9          | 2.0              | 2.0 | 2.0 | 2.5 | 100               | 7.00             | 2.0                           | North       | SM        | Fair                 | Good                    | Not plotted on land survey plan. Vigourous multiple stems from ground level. Included growth and fusion between stems. Scrappy form.                      | 10-20                                    | C2                             |
| T230     | Quercus robur - Pedunculate Oak         | 9          | 3.5              | 2.0 | 3.5 | 2.0 | 250               | 1                | 2.0                           | North       | SM        | Good                 | Good                    | Hedgerow tree limited stature. Overhead cables above crown.                                                                                               | 20-40                                    | C2                             |
| T231     | Quercus robur - Pedunculate Oak         | 10         | 3.5              | 3.0 | 3.5 | 3.5 | 250               | 1                | 2.0                           | North       | SM        | Fair                 | Good                    | Multi-stemmed stand of ash. Good crown vitality. Unable to inspect basal stem unions due to dense vegetation.                                             | 20-40                                    | C2                             |
| T232     | Salix caprea - Goat Willow              | 6          | 2.0              | 2.5 | 2.5 | 2.0 | 100               | 1                | 1.0                           | North       | Y         | Fair                 | Good                    | Good Crown vitality, insignificant stature.                                                                                                               | 20-40                                    | C2                             |
| T233     | Aesculus hippocastanum - Horse Chestnut | 5          | 1.0              | 1.0 | 1.0 | 1.0 | 110               | 1                | 2.0                           | North       | Y         | Good                 | Good                    | Young tree, insignificant stature. Narrow crown stop strong apical growth in stem, apical dominance lost in Crown. Redundant stake at base.               | 20-40                                    | C2                             |
| T234     | Aesculus hippocastanum - Horse Chestnut | 6.5        | 1.5              | 1.5 | 1.5 | 1.5 | 110               | 1                | 1.5                           | East        | Y         | Good                 | Good                    | Young tree, insignificant stature. Good vitality.                                                                                                         | 20-40                                    | C2                             |
| T235     | Aesculus hippocastanum - Horse Chestnut | 8          | 2.5              | 2.5 | 2.5 | 2.5 | 140               | 1                | 1.5                           | East        | Y         | Good                 | Good                    | Young tree, insignificant stature. Good vitality.                                                                                                         | 20-40                                    | C2                             |
| T236     | Prunus domestica - Plum                 | 8          | 2.5              | 3.0 | 2.5 | 3.0 | 80                | 6                | 1.0                           | SW          | EM        | Fair                 | Good                    | Typical garden tree. Dense crown, cluttered main union with included growth. Good vitality.                                                               | 10-20                                    | C2                             |
| T237     | Fraxinus excelsior - Common Ash         | 11         | 3.0              | 2.5 | 4.5 | 4.5 | 130, 80, 100, 100 | 4.00             | 4.0                           | SE          | SM        | Fair                 | Good                    | Multi-stemmed at ground level. Good vitality. Ivy clad stems. Unable to inspect basal stems due to dense vegetation.                                      | 20-40                                    | C2                             |
| T238     | Salix cinerea - Grey Willow             | 12         | 9.0              | 2.5 | 7.5 | 4.5 | 200               | 6                | 3.0                           | NW          | M         | Fair                 | Good                    | Forms of multiple adjacent stems. Northern stems offkilter with Crown biased to North, overhanging Road. Epicormic shoots throughout stems. Scrappy form. | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                     | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                        |                                          |                                |
| T239     | Salix cinerea - Grey Willow                     | 12         | 4.0              | 6.0 | 1.5 | 7.0 | 280, 250, 270  | 3.00             | 1.5                           | West        | M         | Fair                 | Good                    | Multi-stemmed at ground level. Previous compression forks have lapsed and resumed growth from lapsed position. Hanging failed branches in Crown. Epicormic growth throughout. Scrappy form.            | 10-20                                    | C2                             |
| T240     | Salix cinerea - Grey Willow                     | 10         | 0.0              | 2.0 | 1.5 | 1.0 | 200            | 1                | 6.0                           | South       | EM        | Poor                 | Poor                    | Sparse crown with limited live growth. Ivy cloaked from stem to crown. Basal bark delamination noted. Limited safe useful lifetime expectancy.                                                         | <10                                      | U                              |
| T241     | Quercus robur - Pedunculate Oak                 | 12         | 4.5              | 6.5 | 2.0 | 6.0 | 300, 100       | 2.00             | 3.0                           | South       | SM        | Good                 | Good                    | Relatively small statured hedgerow tree. Decurrent crown form at approximately 6 m. Future potential.                                                                                                  | 20-40                                    | C2                             |
| T242     | Quercus robur - Pedunculate Oak                 | 8          | 2.0              | 2.5 | 2.5 | 2.5 | 110            | 1                | 3.0                           | South       | Y         | Good                 | Good                    | Small statured hedgerow tree. Good vitality.                                                                                                                                                           | 20-40                                    | C2                             |
| T243     | Quercus robur - Pedunculate Oak                 | 16         | 7.5              | 1.0 | 9.5 | 3.0 | 530            | 1                | 4.0                           | North       | M         | Good                 | Good                    | Recommend ivy is severed. Ivy cloaked from lower stem to mid Crown. Good decurrent Crown form. Group value.                                                                                            | 40+                                      | B2                             |
| T244     | Quercus robur - Pedunculate Oak                 | 18         | 5.0              | 0.5 | 2.0 | 4.5 | 310            | 1                | 2.0                           | North       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Asymmetric crown form with bias to North. Great value, limited individual stature.                                                                                    | 20-40                                    | C2                             |
| T245     | Fraxinus excelsior - Common Ash                 | 21         | 5.0              | 6.0 | 6.5 | 3.5 | 500            | 1                | 3.0                           | NE          | M         | Good                 | Good                    | Crown lacks central leader, co-dominant multiple leaders. Good vitality. Caught up hanging limbs in Crown. Group value.                                                                                | 20-40                                    | B2                             |
| T246     | Quercus robur - Pedunculate Oak                 | 16.5       | 1.5              | 7.0 | 2.5 | 3.0 | 250            | 1                | 2.0                           | NE          | M         | Fair                 | Good                    | Not plotted on land survey plan. Suppressed Crown to North. Limited stature.                                                                                                                           | 20-40                                    | C2                             |
| T247     | Pseudotsuga menziessi - Winter Flowering Cherry | 10         | 1.5              | 4.0 | 2.0 | 2.5 | 150            | 1                | 6.0                           | SW          | SM        | Fair                 | Good                    | Not plotted on land survey plan. High crown and damage central leader. Hanging failed limbs in lower crown. Limited stature.                                                                           | 20-40                                    | C2                             |
| T248     | Fraxinus excelsior - Common Ash                 | 20         | 1.5              | 3.0 | 4.5 | 3.5 | 220            | 1                | 10.0                          | SW          | SM        | Fair                 | Good                    | Not plotted on land survey plan. Tall, narrow crowned form. Multiple leaders in Crown, offkilter. Limited stature.                                                                                     | 20-40                                    | C2                             |
| T249     | Fraxinus excelsior - Common Ash                 | 14         | 8.0              | 3.5 | 4.5 | 2.5 | 260, 300       | 2.00             | 6.0                           | North       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Asymmetric Crown form, biased to the north. Bowing limbs to North. Bifurcates at approximately 1 m, tension fork. Deadwood and previous limb failures in lower crown. | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                         | Height (m) | Crown spread (m) |      |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------------|------------|------------------|------|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                 |            | N                | E    | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                 |                                          |                                |
| T250     | Pseudotsuga menziessi - Winter Flowering Cherry | 14         | 1.0              | 3.0  | 3.5 | 3.5 | 150            | 1                | 12                            | East        | SM        | Fair                 | Good                    | Not plotted on land survey plan. Slender form with high Crown, lacks mass damping branches on stem. Limited stature.                                                                                            | 20-40                                    | C2                             |
| T251     | Prunus avium - Wild Cherry                      | 5          | 2.5              | 2.5  | 1.5 | 1.5 | 90             | 1                | 1.5                           | East        | Y         | Fair                 | Good                    | Narrow crown with previous limb failures. Stand leaning to North. Insignificant tree.                                                                                                                           | 10-20                                    | C2                             |
| T252     | Quercus robur - Pedunculate Oak                 | 13.5       | 7.0              | 2.0  | 5.0 | 4.0 | 280, 150       | 2.00             | 2.0                           | NW          | EM        | Fair                 | Good                    | Stem offkilter, Crown biased to North. Bifurcates at 1 m, tension fork, western stem dominant. Good vitality. Limited stature.                                                                                  | 20-40                                    | C2                             |
| T253     | Fraxinus excelsior - Common Ash                 | 16         | 4.5              | 3    | 2.5 | 3   | 280            | 1.00             | 10                            | NW          | SM        | Fair                 | Good                    | Stale offkilter, spindly upper crown. Good vitality. Limited stature.                                                                                                                                           | 20-40                                    | C2                             |
| T254     | Populus x canadensis - Hybrid Black Poplar      | 24         | 13               | 13   | 12  | 6.0 | 600            | 1                | 0.0                           | NW          | SM        | Fair                 | Good                    | Not plotted on land survey plan. Crown reduction recommended of 20 %.Very large tree, prominent height. Leader strays away to the east, significant crown weight to the east. Moderate deadwood in lower crown. | 20-40                                    | B2                             |
| T255     | Pseudotsuga menziessi - Winter Flowering Cherry | 23         | 4.0              | 4.5  | 4.5 | 6.0 | 420            | 1                | 13                            | South       | EM        | Good                 | Good                    | Not plotted on land survey plan. Strong apical growth, and good whorled scaffold limb form. Prominent height in group.                                                                                          | 40+                                      | B2                             |
| T256     | Pinus sylvestris - Scots Pine                   | 18.5       | 2                | 1.0  | 5   | 1   | 270            | 1                | 11                            | South       | SM        | Fair                 | Good                    | Leader strays to the east. Narrow crown. Limited stature.                                                                                                                                                       | 20-40                                    | C2                             |
| T257     | Pinus sylvestris - Scots Pine                   | 18.5       | 5.0              | 8    | 5.5 | 6.5 | 500            | 1                | 0.0                           | South       | SM        | Fair                 | Good                    | Good Crown vitality. Crown lacks essential leader, Bifurcates at approximately 6 m, tension fork. Moderate deadwood in lower and needs Crown. Group value.                                                      | 40+                                      | B2                             |
| T258     | Quercus robur - Pedunculate Oak                 | 17         | 2                | 10.5 | 7.5 | 2.5 | 410            | 1                | 0.0                           | South       | SM        | Fair                 | Good                    | Crown lacks central leader, suppressed to North and biased to South East. Long lateral branch with heavy end weight to South East. Consider reduction.                                                          | 40+                                      | B2                             |
| T259     | Quercus robur - Pedunculate Oak                 | 18         | 6.5              | 3.5  | 3.5 | 3.0 | 450            | 1                | 1.5                           | NE          | EM        | Fair                 | Good                    | Not plotted on land survey plan. Decurrent upper crown form. Moderate deadwood in lower crown. Tall, drawn up overall form. Group value.                                                                        | 40+                                      | B2                             |
| T260     | Quercus robur - Pedunculate Oak                 | 18         | 3                | 1.5  | 1.5 | 2.0 | 240            | 1                | 2                             | SW          | SM        | Fair                 | Good                    | Tall, drawn up form with narrow crown. Upper leader offkilter. Limited stature.                                                                                                                                 | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                         | Height (m) | Crown spread (m) |      |      |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------------------|------------|------------------|------|------|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                 |            | N                | E    | S    | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                          |                                          |                                |
| T261     | Quercus robur - Pedunculate Oak                 | 17         | 7.0              | 2.0  | 1.5  | 6.0 | 320            | 1                | 0.0                           | SW          | EM        | Fair                 | Good                    | Not plotted on land survey plan. Good crowd vitality. Stem offkilter and Crown biased in North. Group value.                                                                                                                                                                             | 40+                                      | B2                             |
| T262     | Quercus robur - Pedunculate Oak                 | 18.5       | 1.0              | 3.0  | 5.5  | 1.5 | 330            | 1                | 10.0                          | SW          | EM        | Fair                 | Good                    | Central leader previously failed, old epicormic growth forms upper crown. Previously failed long lateral limb to North East has 'harp string' vertical epicormic growth forming remainder of upper crown. Likely weak attachments.                                                       | 40+                                      | C2                             |
| T263     | Quercus robur - Pedunculate Oak                 | 17         | 1.5              | 8.0  | 4.5  | 4.0 | 380            | 1                | 1.0                           | South       | EM        | Fair                 | Good                    | Phototropic, twisted scaffold limb form due to suppression from adjacent tree. Minor peripheral deadwood in lower crown. Good vitality in upper crown. Group value.                                                                                                                      | 40+                                      | B2                             |
| T264     | Quercus robur - Pedunculate Oak                 | 17         | 9.5              | 7.5  | 5.0  | 9.0 | 670            | 1                | 0.0                           | SW          | EM        | Good                 | Good                    | Prominent tree at woodland edge. Good scaffold limb structure in upper crown. Lower crown biased to South. Previous partial limb failure noted in the lower South crown, has since occluded and resumed live growth.                                                                     | 40+                                      | A2                             |
| T265     | Quercus robur - Pedunculate Oak                 | 12.5       | 2.5              | 4    | 4.5  | 4.0 | 250            | 1                | 10.0                          | West        | SM        | Fair                 | Good                    | Previous limb failures in lower crown. Good crown vitality. Limited stature.                                                                                                                                                                                                             | 20-40                                    | C2                             |
| T266     | Quercus robur - Pedunculate Oak                 | 18.5       | 2.0              | 12.5 | 10.5 | 7.0 | 700            | 1                | 5.0                           | South       | M         | Fair                 | Good                    | Recommend crown is deadwooded. Prominent tree at woodland edge. Good Crown vitality and upper scaffold limb structure. Long lateral limb is in the lower South Crown, Lever arm slightly reduced at distal ends. Stem Ivy cloaked. Moderate to major deadwood in lower and middle crown. | 20-40                                    | A2                             |
| T267     | Pseudotsuga menziessi - Winter Flowering Cherry | 14         | 3.0              | 3.5  | 2    | 3.0 | 290            | 1                | 8.0                           | South       | SM        | Fair                 | Good                    | High and narrow crown, offkilter leader. Good vitality. Limited stature.                                                                                                                                                                                                                 | 20-40                                    | C2                             |
| T268     | Picea abies - Norway spruce                     | 14         | 3.5              | 5.5  | 2    | 4.5 | 250            | 1                | 7                             | West        | SM        | Fair                 | Good                    | Apical dominance lost in upper crown. Long lateral limb forming to the South West. Limited stature.                                                                                                                                                                                      | 20-40                                    | C2                             |
| T269     | Pseudotsuga menziessi - Winter Flowering Cherry | 10         | 1.5              | 2.5  | 5.5  | 2.5 | 130            | 1                | 6                             | NW          | SM        | Fair                 | Good                    | Small statured tree, leader strays to East becoming lateral.                                                                                                                                                                                                                             | 20-40                                    | C2                             |
| T270     | Picea abies - Norway spruce                     | 10         | 2                | 3    | 0.5  | 3.5 | 120            | 1                | 8                             | West        | SM        | Poor                 | Good                    | Small statured and suppressed tree, leader strays to West becoming lateral.                                                                                                                                                                                                              | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                    | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                            |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                               |                                          |                                |
| T271     | Quercus robur - Pedunculate Oak            | 13         | 3.5              | 5.5 | 4.5 | 3.0 | 310            | 1                | 3.0                           | West        | SM        | Good                 | Good                    | Currently small statured tree, future potential.                                                                                                                              | 40+                                      | C2                             |
| T272     | Picea abies - Norway spruce                | 10         | 1.5              | 2   | 3   | 3.0 | 220            | 1                | 0.0                           | West        | SM        | Fair                 | Good                    | Suppressed upper crown form, excurrent form lost. Limited stature.                                                                                                            | 20-40                                    | C2                             |
| T273     | Pinus sylvestris - Scots Pine              | 14         | 0                | 4.5 | 4.5 | 1   | 290            | 1                | 3.5                           | South       | SM        | Fair                 | Good                    | Upper leader strays to the east, becoming lateral. Limited stature.                                                                                                           | 20-40                                    | C2                             |
| T274     | Quercus robur - Pedunculate Oak            | 17         | 2.0              | 5.5 | 4.5 | 3.0 | 420            | 1                | 5.0                           | East        | EM        | Good                 | Good                    | Upper stem slightly offilter. Good vitality. Moderate amenity tree at Woodland edge. Future potential.                                                                        | 40+                                      | B2                             |
| T275     | Populus x canadensis - Hybrid Black Poplar | 17         | 0                | 9.5 | 5.5 | 5.0 | 220, 300       | 2.00             | 5                             | SE          | EM        | Poor                 | Good                    | Bifurcates at ground level. Stems cross, included bark present. Stems leaning heavily. Root plate lifted. Recommend removal.                                                  | <10                                      | U                              |
| T276     | Populus x canadensis - Hybrid Black Poplar | 17         | 6.0              | 7.0 | 5.5 | 3.0 | 280            | 1                | 6.0                           | North       | SM        | Fair                 | Good                    | Basal stem offilter, corrected from 1 m upwards. Good upper crown form. Limited landscape presence.                                                                           | 20-40                                    | C2                             |
| T277     | Quercus robur - Pedunculate Oak            | 10         | 7.0              | 3.5 | 3.5 | 3.0 | 150, 150       | 2.00             | 0.0                           | North       | SM        | Fair                 | Good                    | Not plotted on land survey plan. Bifurcates at ground level, codominant stems. Spindly scaffold limbs. Limited stature.                                                       | 20-40                                    | C2                             |
| T278     | Populus x canadensis - Hybrid Black Poplar | 16         | 3.0              | 7.0 | 2.5 | 4.0 | 150, 80        | 2.00             | eight                         | East        | SM        | Fair                 | Good                    | Not plotted on land survey plan. Bifurcates at ground level, northern stem dominant. Strong apical growth. Southern stem leaning at approximately 20° angle. Limited stature. | 20-40                                    | C2                             |
| T279     | Quercus robur - Pedunculate Oak            | 13         | 5                | 6   | 4.5 | 4.0 | 300            | 1                | 1                             | East        | SM        | Good                 | Good                    | Semimature tree at woodland edge. Good crown vitality and decurrent crown form. Currently limited stature. Future potential.                                                  | 20-40                                    | C2                             |
| T280     | Quercus robur - Pedunculate Oak            | 13         | 4.5              | 4.5 | 2.5 | 4.0 | 300            | 1                | 1.0                           | East        | SM        | Fair                 | Good                    | Spindly scaffold limb form, Bifurcates at approximately 5 m. Compression pork likely to develop in future. Limited stature.                                                   | 20-40                                    | C2                             |
| T281     | Quercus robur - Pedunculate Oak            | 15         | 7.0              | 7.0 | 5.0 | 4.5 | 250, 200       | 2.00             | 1.0                           | SE          | SM        | Fair                 | Good                    | Bifurcates at ground level, included growth not present. Self suppressing. Spindly scaffold limb form, limited stature.                                                       | 40+                                      | C2                             |
| T282     | Quercus robur - Pedunculate Oak            | 9          | 4.5              | 1.5 | 4.5 | 2   | 200            | 1                | 1                             | North       | SM        | Good                 | Good                    | Good Crown vitality. Good scaffold limb structure, if suppressed to the south. Limited stature.                                                                               | 40+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                  |                                          |                                |
| T283     | Quercus robur - Pedunculate Oak | 9          | 2.5              | 5   | 5.5 | 2   | 250                     | 1                | 2                             | East        | SM        | Good                 | Good                    | Basal stem offilter, corrected from 1.5 m upwards. Crown Bifurcates at 6 m, tension fork. Good vitality. Limited stature.                                                                                                                                        | 40+                                      | C2                             |
| T284     | Acer campestre - Field Maple    | 11         | 4.0              | 4.0 | 1.0 | 4.5 | 290, 140                | 2.00             | 1.5                           | South       | EM        | Fair                 | Good                    | Scrappy formed tree established on bank. Rabbit holes within RPA. Suppressed Crown form. Limited amenity.                                                                                                                                                        | 20-40                                    | C2                             |
| T285     | Acer campestre - Field Maple    | 14.5       | 5.0              | 4.5 | 2.5 | 3.0 | 150                     | 8.00             | 3.0                           | South       | M         | Fair                 | Good                    | Formed of multiple stems, including growth between all stems. One central stem has died, may create a weak points between stems. Rabbit holes within RPA. Scrappy form.                                                                                          | 10-20                                    | C2                             |
| T286     | Acer campestre - Field Maple    | 13         | 1.0              | 4.5 | 4.5 | 3.5 | 140, 160, 200, 210, 100 | 5.00             | 3.0                           | South       | M         | Fair                 | Fair                    | Not plotted on land survey plan. Several adjacent stems surveyed together. Gnarled basal stems with decay and included growth present. Ivy cloaked mid stems. Rabbit holes within RPA. Scrappy form, limited amenity. Likely limited useful lifetime expectancy. | 10-20                                    | C2                             |
| T287     | Acer campestre - Field Maple    | 14.5       | 4.5              | 4.0 | 1.5 | 2.0 | 250, 200, 100, 220      | 4.00             | 0.0                           | East        | SM        | Fair                 | Good                    | Formed of two main clumps of stems, which further diverge into multiple stems with included growth between stems. Basal decay present on southern stem. Rabbit holes within RPA. Central stems have been self shaded, Deadwood present. Scrappy form.            | 20-40                                    | C2                             |
| T288     | Acer campestre - Field Maple    | 14.5       | 5.0              | 4.0 | 5.0 | 2.5 | 260, 180, 120, 260, 180 | 5.00             | 0.0                           | East        | SM        | Fair                 | Good                    | In better general condition that then adjacent trees. Formed of multiple stems from ground level, included growth between all stems. Dense crown, good vitality.                                                                                                 | 20-40                                    | C2                             |
| T289     | Quercus robur - Pedunculate Oak | 10         | 3.5              | 5.5 | 5   | 4.5 | 300                     | 1                | 0.0                           | East        | SM        | Good                 | Good                    | Even Crown, main leader slightly offilter. Good vitality. Limited stature. Future potential.                                                                                                                                                                     | 40+                                      | B2                             |
| T290     | Quercus robur - Pedunculate Oak | 12         | 4.5              | 4.5 | 4.5 | 3.5 | 380                     | 1                | 0.0                           | East        | SM        | Good                 | Good                    | Good Crown vitality. Main union diverges at approximately 2 m, spindly upper Crown, currently limited stature. Future potential.                                                                                                                                 | 40+                                      | C2                             |
| T291     | Acer saccharinum - Silver Maple | 13.5       | 3                | 1.5 | 3   | 3.5 | 270                     | 1                | 2                             | North       | SM        | Fair                 | Good                    | Multiple leaders in Crown. Branch bark ridge formation at fork unions. Limited stature.                                                                                                                                                                          | 20-40                                    | C2                             |
| T292     | Tilia sp. - Lime sp.            | 10         | 2.5              | 3   | 3   | 4   | 220, 180                | 2.00             | 2                             | East        | SM        | Fair                 | Good                    | Bifurcates at 1.5 m. Compression fork with included growth, currently limited Crown weight and area, but likely to become problematic in future as tree matures.                                                                                                 | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |          |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                                           | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|----------|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E        | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                              |                                          |                                |
| T293     | Acer saccharinum - Silver Maple | 12         | 4.5              | 2        | 4   | 2   | 280            | 1                | 2 0.0                         | North       | SM        | Fair                 | Good                    | Previously pollarded at approximately 2 m. Overburdened main union with multiple leaders in Crown. Some stems have been pruned, part occluded with decay pockets. Will require cyclical pruning regime.                                                                                      | 20-40                                    | C2                             |
| T294     | Acer saccharinum - Silver Maple | 12.5       | 4.0              | 1.5<br>3 | 4.5 | 4.0 | 310            | 1                | 2.0                           | NW          | SM        | Fair                 | Good                    | Previously pollarded at approximately 2 m. Overburdened main union with multiple leaders in Crown, poor attachments. Some stems have been pruned, part occluded with decay and Perenniporia fraxinea decay fungus noted. Further monitor decay extents.will require cyclical pruning regime. | 20-40                                    | C2                             |
| T295     | Acer saccharinum - Silver Maple | 12.5       | 2.5              | 5        | 3.5 | 4   | 330            | 1                | 2                             | South       | EM        | Fair                 | Good                    | Previously pollarded at approximately 2 m. Overburdened main union with multiple leaders in Crown. Some stems have been pruned, part occluded with decay and Deadwood fungus noted. Will require cyclical pruning regime.                                                                    | 20-40                                    | C2                             |
| T296     | Acer campestre - Field Maple    | 10         | 3.5              | 3.5      | 3   | 2   | 150, 120, 75   | 3.00             | 2                             | North       | SM        | Fair                 | Good                    | Multi-stemmed at ground level, no included growth stems. Multiple leaders in Crown, self suppressing. Limited stature.                                                                                                                                                                       | 20-40                                    | C2                             |
| T297     | Tilia sp. - Lime sp.            | 12         | 4.5              | 2.0      | 3.5 | 2.5 | 300            | 1                | 1.5                           | North       | EM        | Fair                 | Good                    | Bifurcates approximately 2 m, compression fork with adaptive growth present. Minor deadwood in lower crown. Limited stature.                                                                                                                                                                 | 40+                                      | C2                             |
| T298     | Juglans regia - Common Walnut   | 7          | 4                | 1        | 2   | 1.5 | 90             | 1                | 1.5                           | North       | Y         | Fair                 | Good                    | Good internode length in Crown. Crown biased the North. Limited stature, suppressed by adjacent trees.                                                                                                                                                                                       | 20-40                                    | C2                             |
| T299     | Tilia sp. - Lime sp.            | 13         | 4.5              | 4.5      | 4.5 | 3.5 | 360            | 1                | 1.5                           | NE          | EM        | Fair                 | Good                    | Bifurcates at approximately 1.5 m, compression fork with included growth. Companion shelter present. Codominant leaders in Crown. Minor stem wounds, occluded.                                                                                                                               | 40+                                      | C2                             |
| T300     | Acer saccharinum - Silver Maple | 19         | 4                | 1.5      | 3.5 | 2   | 400            | 1                | 2                             | North       | EM        | Fair                 | Good                    | Tall, drawn out form. Codominant leaders in Crown, apical dominance loss at approximately 8 m. Bulges at approximately 1.5 m and 3 m on stem. Good vitality. Group value.                                                                                                                    | 40+                                      | B2                             |
| T301     | Acer saccharinum - Silver Maple | 17         | 1.5              | 1        | 1.5 | 1   | 210            | 1                | 8                             | North       | SM        | Fair                 | Good                    | Tall, drawnout and narrow crowned form. Apical dominance lost at approximately 10 m, crowned Bifurcates. Limited individual amenity.                                                                                                                                                         | 20-40                                    | C2                             |
| T302     | Quercus robur - Pedunculate Oak | 18.5       | 8.5              | 3.5      | 6.0 | 1.5 | 450            | 1                | 2.0                           | North       | EM        | Fair                 | Fair                    | Stem slightly offkilter, slight crown bias to the North. Minor to moderate deadwood in lower crown. Peripheral dieback noted in lower crown. Previous limb failures noted. Moderate group and individual amenity.                                                                            | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |          |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                      | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|----------|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E        | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                         |                                          |                                |
| T303     | Fraxinus excelsior - Common Ash | 14         | 3.5              | 3.0      | 4.5 | 2.5 | 200, 180, 250  | 3.00             | 2.0                           | East        | SM        | Fair                 | Fair                    | Multiple stems at ground level, included growth between stems. Minor deadwood in lower West crown. One adjacent stem has died. Scrappy form.                                                                                                            | 20-40                                    | C2                             |
| T304     | Acer campestre - Field Maple    | 17         | 4.5              | 4.0      | 5.0 | 4.0 | 420            | 1                | 0.0                           | East        | SM        | Fair                 | Good                    | Mature size for species. Dense crown, good vitality. Crossing limbs in crown. Group value.                                                                                                                                                              | 20-40                                    | B2                             |
| T305     | Fraxinus excelsior - Common Ash | 15         | 1.5              | 5.5      | 2.5 | 3   | 270            | 1                | 2                             | South       | SM        | Fair                 | Good                    | Good Crown vitality, biased to the south. Limited stature.                                                                                                                                                                                              | 20-40                                    | C2                             |
| T306     | Quercus robur - Pedunculate Oak | 18.5       | 4.0              | 1.5      | 3.5 | 1.5 | 300            | 1                | 8.0                           | East        | EM        | Fair                 | Fair                    | Recommend crown is deadwooded.Moderate deadwood and died back in lower crown, including a deadwood name approximately 7 m long and 10 cm in diameter. Crown bias East. A steel chain has been included in the stem growth.remove remaining steel chain. | 20-40                                    | C2                             |
| T307     | Quercus robur - Pedunculate Oak | 20         | 2                | 7.5<br>7 | 5.5 | 3.5 | 200, 290       | 2.00             | 0.0                           | East        | EM        | Fair                 | Good                    | Bifurcates at ground level, stems self suppress. Spindly upper scaffold limbs, Crown bias South. Limited individual stature.                                                                                                                            | 20-40                                    | C2                             |
| T308     | Pyrus communis - Common Pear    | 12         | 1.0              | 0.5      | 1.5 | 1.0 | 170            | 1                | 2.0                           | West        | SM        | Poor                 | Poor                    | Sparse crown with extensive dieback in upper Crown. Tree appears to be in decline. Limited useful lifetime expectancy.                                                                                                                                  | <10                                      | C3                             |
| T309     | Quercus robur - Pedunculate Oak | 15.5       | 2.5              | 5.5      | 6   | 5   | 480            | 1                | 2                             | SE          | EM        | Fair                 | Good                    | Crown bias the West, due to suppression from tree which has since been felled. Good Crown vitality. Moderate amenity.                                                                                                                                   | 40+                                      | B2                             |
| T310     | Acer campestre - Field Maple    | 13         | 5.0              | 2.5      | 4.5 | 3.0 | 150            | 7.00             | 2.0                           | NW          | EM        | Fair                 | Fair                    | Scrappy, multi-stemmed form. Multiple leaders in Crown. Included growth between basal stems. Minor basal cavities noted. Some stems are ivy clad with peripheral dieback.                                                                               | 10-20                                    | C2                             |
| T311     | Quercus robur - Pedunculate Oak | 18         | 3.5              | 4.5      | 3   | 3.5 | 490            | 1                | 2                             | North       | EM        | Good                 | Good                    | Strong apical growth and good scaffold limb structure. Good vitality. A fine tree, future potential.                                                                                                                                                    | 40+                                      | B2                             |
| T312     | Fagus sylvatica - Common Beech  | 15         | 7.5              | 3.5      | 6.5 | 4.5 | 490            | 1                | 2.0                           | West        | EM        | Good                 | Good                    | Good scaffold limb structure, central leader present. Good crown vitality. Future potential.                                                                                                                                                            | 40+                                      | B2                             |
| T313     | Quercus robur - Pedunculate Oak | 13         | 5.5              | 6.0      | 4.5 | 6.0 | 1150           | 1                | 0.0                           | East        | V         | Fair                 | Fair                    | Tree has veteran characteristics. Crown appears to have retrenched, tree may be undergoing basifugal mortality. Large deadwood limbs in lower South crown. Sufficient live growth remains in crown. High amenity value.                                 | 20-40                                    | A3                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                           | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)        | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------|------------|------------------|-----|-----|-----|-----------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                   |            | N                | E   | S   | W   |                       |                  |                               |             |           |                      |                         |                                                                                                                                                                                                 |                                          |                                |
| T314     | Betula pendula - Silver Birch     | 4          | 2                | 2   | 4   | 3   | 200                   | 1                | 0.0                           | East        | SM        | Fair                 | Good                    | Nursery trained weeping form, with leaders straying to the east. Limited stature.                                                                                                               | 20-40                                    | C2                             |
| T315     | Quercus robur - Pedunculate Oak   | 18         | 6                | 6   | 6   | 5.5 | 520                   | 1                | 2                             | SE          | EM        | Good                 | Good                    | Decurrent crown, good scaffold limb form, overhead cable underpasses south Crown. Good Crown vitality.                                                                                          | 40+                                      | B2                             |
| T316     | Prunus avium - Wild Cherry        | 5          | 3.5              | 1.5 | 3.5 | 2.0 | 180                   | 1                | 1.5                           | NE          | SM        | Fair                 | Good                    | Leader has been previously topped. Otherwise, good vitality. Compression forks at branch to stem unions. Limited stature.                                                                       | 10-20                                    | C2                             |
| T317     | Prunus avium - Wild Cherry        | 10         | 4                | 3.5 | 3.5 | 3.5 | 250, 220              | 2.00             | 1                             | NW          | EM        | Fair                 | Good                    | Lacks central leader, codominant self suppressing crown. Bifurcates at 1.5 m, tension fork. Good crown vitality. Limited stature.                                                               | 10-20                                    | C2                             |
| T318     | Thuja plicata - Western Red Cedar | 9          | 1.5              | 1.5 | 1   | 2   | 100, 50               | 2.00             | 0.0                           | North       | SM        | Fair                 | Good                    | Bifurcates at approximately 1 m, unable to inspect union in detail due to dense foliage. Insignificant stature.                                                                                 | 20-40                                    | C2                             |
| T319     | Thuja plicata - Western Red Cedar | 9.5        | 2.0              | 2   | 2.0 | 2.0 | 120, 130              | 2.00             | 0.0                           | North       | SM        | Fair                 | Good                    | Bifurcates at approximately 1 m, unable to inspect union in detail due to dense foliage. Insignificant stature.                                                                                 | 20-40                                    | C2                             |
| T320     | Sorbus aria - Coast Redwood       | 12         | 4.0              | 2.5 | 2.5 | 4.0 | 230                   | 1.00             | 1.5                           | North       | SM        | Fair                 | Good                    | Multiple scaffold limbs diverged from main stem at approximately 2 m. Unable to inspect unions in detail due to ivy. Dense crown, rounded form suppressed to the east. Rabbit holes within RPA. | 20-40                                    | C2                             |
| T321     | Quercus robur - Pedunculate Oak   | 17         | 7.5              | 7   | 8.5 | 6.5 | 470                   | 1                | to                            | North       | EM        | Good                 | Good                    | Ivy cloaked from stem to mid crown, limited inspection of these areas. Good vitality, wide spreading decurrent crown scaffold limb structure.                                                   | 40+                                      | B2                             |
| T322     | Fraxinus excelsior - Common Ash   | 12         | 7.5              | 7.5 | 7.5 | 7.5 | 380, 350, 350         | 3.00             | 2.5                           | East        | EM        | Good                 | Good                    | Multiple stems at ground level. Adaptive growth between stems and lateral support present. Even, wide spreading crown. Good vitality.                                                           | 20+                                      | B2                             |
| T323     | Acer campestre - Field Maple      | 10.5       | 3.5              | 2.5 | 1.5 | 4   | 210, 180, 100, 50, 60 | 5.00             | 0.0                           | North       | EM        | Fair                 | Good                    | Suppressed upper Crown with bias to the West. Gnarled basal stems, fusion and included growth. Likely limited useful lifetime expectancy.                                                       | 10-20                                    | C2                             |
| T324     | Fraxinus excelsior - Common Ash   | 12         | 5.0              | 5.0 | 5.0 | 4.0 | 280, 220              | 2.00             | 1.5                           | East        | EM        | Fair                 | Good                    | Bifurcates at ground level, Crown lacks central leader. Stems offkilter. Minor dieback in lower Crown, otherwise good vitality.                                                                 | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                  | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                     |                                          |                                |
| T325     | Quercus robur - Pedunculate Oak | 12         | 3.0              | 2.5 | 1.5 | 4.5 | 210                     | 1                | 2.0                           | NW          | SM        | Fair                 | Good                    | Stem slightly offkilter with Crown bias the West, suppressed by adjacent field maple. Young tree, good vitality, limited stature.                                                                                                   | 40+                                      | C2                             |
| T326     | Acer campestre - Field Maple    | 12         | 3.5              | 5.0 | 4.5 | 3.5 | 220, 140, 190, 270, 150 | 5.00             | 3.0                           | East        | M         | Fair                 | Good                    | Multiple stems from 1 m upwards. Fusion and included growth between stems. Dense crown, lacks central leader. Scrappy form, limited stature.                                                                                        | 20-40                                    | B2                             |
| T327     | Acer campestre - Field Maple    | 13         | 4.0              | 3.5 | 5.5 | 4.5 | 160, 210, 410           | 3.00             | 2.0                           | East        | M         | Fair                 | Good                    | Formed of multiple stems at ground level. Westernmost stem dominant and likely formed from several previously fused stems. Previous failures of subordinate stems noted. Minor squirrel damage on stem. Dense crown, good vitality. | 20-40                                    | B2                             |
| T328     | Acer campestre - Field Maple    | 10.5       | 2.5              | 3.5 | 2.5 | 3.5 | 260                     | 1                | 2                             | West        | EM        | Fair                 | Good                    | Stem form suggests main stem is formed from multiple previously used stems. Dense crown, relatively narrow form.                                                                                                                    | 20-40                                    | C2                             |
| T329     | n/a                             |            |                  |     |     |     |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                     |                                          |                                |
| T330     | Acer campestre - Field Maple    | 12         | 5                | 5   | 4   | 5   | 120                     | 10.00            | 2                             | South       | EM        | Fair                 | Good                    | Multiple stems at ground level, fusion and included growth between stems. Crown lacks central leader. Dense crown, good vitality. Limited stature.                                                                                  | 20-40                                    | B2                             |
| T331     | Fraxinus excelsior - Common Ash | 18.5       | 7.5              | 9.5 | 6.5 | 9   | 330, 490, 380, 290      | 4.00             | 1.5                           | South       | M         | Good                 | Good                    | Wide spreading Crown, arising from multiple stems at 1.5 m. Good adaptive growth at the stem unions. Minor to moderate deadwood in lower Crown, otherwise a good vitality. Prominent tree in Hedgerow, a fine ash.                  | 40+                                      | A2                             |
| T332     | Acer campestre - Field Maple    | 8.5        | 3.0              | 2.0 | 3.0 | 2.0 | 260                     | 1                | 0.0                           | South       | EM        | Good                 | Good                    | Small statured tree. Relatively narrow Crown form. Dense crown, good vitality.                                                                                                                                                      | 20-40                                    | C2                             |
| T333     | Acer campestre - Field Maple    | 16         | 4.5              | 4.5 | 4.5 | 6.5 | 220, 350, 160, 350, 100 | 5.00             | 1.5                           | East        | M         | Fair                 | Good                    | Formed of multiple stems at ground level. Fusion between stems. Longitudinal stem wound approximately 1 m in length, with internal decay present on major stem. Part oclluded. Good crown vitality.                                 | 20-40                                    | B2                             |
| T334     | Quercus robur - Pedunculate Oak | 16         | 3.5              | 5.5 | 4.0 | 5.5 | 450                     | 1                | 0.0                           | East        | EM        | Good                 | Good                    | Crown suppressed to the North East. Good scaffold limb structure and crown vitality. Future potential.                                                                                                                              | 40+                                      | A2                             |
| T335     | Quercus robur - Pedunculate Oak | 14         | 6.0              | 4.5 | 5.5 | 7.0 | 330                     | 1                | 3.0                           | NE          | EM        | Fair                 | Good                    | A number of scaffold limbs in the Western Crown have previously failed. Remaining Crown has good vitality, but slender scaffold limb form.                                                                                          | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                     | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                        |                                          |                                |
| T336     | Acer campestre - Field Maple         | 12         | 1.5              | 3.0 | 5.0 | 3.0 | 300, 190, 120<br>0      | 3.00             | 5.0                           | East        | EM        | Fair                 | Fair                    | Relatively narrow crown, much of crown is ivy clad. Scrappy form. Likely limited useful lifetime expectancy.                                                                                                                           | 10-20                                    | C2                             |
| T337     | Acer campestre - Field Maple         | 8          | 1.5              | 3   | 4.5 | 1   | 150, 100, 150           | 3.00             | 1                             | East        | EM        | Poor                 | Fair                    | Heavily suppressed form. Heavily ivy clad throughout tree, sparse live growth remains in up the Crown. Leaders strayed to the east. Likely limited useful lifetime expectancy.                                                         | 10-20                                    | C2                             |
| T338     | Quercus robur - Pedunculate Oak      | 17         | 8.5              | 11  | 6.5 | 9.5 | 960                     | 1                | 0.0                           | East        | EM        | Fair                 | Fair                    | Major previous limb failure at included bark union. Large area of exposed heartwood at point of failure. Remaining Crown is biased to south. Future limb failure is a possibility. Tree still retains some prominent stature.          | 20-40                                    | A3                             |
| T339     | Fraxinus excelsior - Common Ash      | 16         | 2.0              | 7.5 | 5.0 | 4.5 | 250, 270                | 2.00             | 4.0                           | SE          | EM        | Fair                 | Good                    | Suppressed Crown form, bias to south. Ivy clad from lower stem to lower crown. Minor deadweight in lower crown, otherwise good vitality. Bifurcates at 0.5 m, occluded union.                                                          | 20-40                                    | C2                             |
| T340     | Acer campestre - Field Maple         | 9          | 4.5              | 3.5 | 3.5 | 2   | 190, 140, 90            | 3.00             | 1.5                           | East        | EM        | Fair                 | Good                    | Dense crown, good vitality. Limited stature.                                                                                                                                                                                           | 20-40                                    | C2                             |
| T341     | Acer campestre - Field Maple         | 8.5        | 3.5              | 4.5 | 3.5 | 4.0 | 150                     | 6                | 1.5                           | SE          | EM        | Fair                 | Fair                    | Formed of multiple stems at ground level. Stems and lower crown ivy clad. Good vitality in upper crown. Limited stature.                                                                                                               | 20-40                                    | C2                             |
| T342     | Crataegus monogyna - Common Hawthorn | 8          | 3.5              | 3.5 | 3.5 | 5.0 | 100                     | 7.00             | 1.5                           | North       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Multi-stemmed with multiple leaders in Crown. Fusion and friction wood between stems. Dense crown, good vitality, crossing branches.                                                                  | 10-20                                    | C2                             |
| T343     | Fraxinus excelsior - Common Ash      | 23         | 9.5              | 9.5 | 4.5 | 9.5 | 400, 330, 350, 300, 330 | 5.00             | 3.0                           | South       | M         | Good                 | Good                    | Multi-stemmed from 0.5 m upwards, likely aged coppice stand. Occluded unions between basal stems, lateral support between leaders. Dense crown. Exposed structural roots along ditch, habitat value. Prominent landscape amenity.      | 40+                                      | A2                             |
| T344     | Fraxinus excelsior - Common Ash      | 20         | 6.5              | 8.5 | 3.5 | 5.5 | 250                     | 6                | 3.0                           | South       | M         | Fair                 | Good                    | Exposed structural roots along ditch, habitat value. Multiple stems, likely age coppice stand. Occluded unions between stems, lateral support amongst leaders. Minor deadwood in lower crown. Minor ivy clad middle stem. Group value. | 20-40                                    | B2                             |
| T345     | Fraxinus excelsior - Common Ash      | 15.5       | 9.0              | 4.0 | 5.5 | 0.0 | 350, 180                | 2                | 0.0                           | South       | EM        | Poor                 | Fair                    | Major previous stem failure and scaffold limb failures. Remaining Crown has asymmetric form, with reduced scaffold limb structure. Heavy end weights with reduced lateral support. Consider limb reduction.                            | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |     |      | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|-----|------|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S   | W    |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                 |                                          |                                |
| T346     | Acer campestre - Field Maple    | 6          | 2                | 3.5  | 1.5 | 4.5  | 220                     | 1.00             | 2                             | East        | EM        | Fair                 | Good                    | Suppressed Crown form with biased East. Basal stem decay. Small statured.                                                                                                                                                                       | 10-20                                    | C2                             |
| T347     | Fraxinus excelsior - Common Ash | 19         | 8.0              | 9.5  | 4.0 | 8.5  | 390, 390, 160, 240, 210 | 5                | 2.0                           | North       | M         | Fair                 | Good                    | Multi-stemmed, likely aged coppice stand. Eastern stems stray outwards, giving overall crown biased the East. Previous basal compression forks have responded with adaptive growth. Group value.                                                | 40+                                      | B2                             |
| T348     | Quercus robur - Pedunculate Oak | 17         | 4.5              | 8.2  | 4.5 | five | 760                     | 1                | 0.0                           | SW          | M         | Fair                 | Fair                    | Moderate deadwood in upper crown, reduced scaffold limb structure in upper crown. Tree appears to be retrenching. Epicormic growth around lower stem.                                                                                           | 40+                                      | B2                             |
| T349     | Fraxinus excelsior - Common Ash | 19         | 9.5              | 5    | 3.5 | 3.5  | 390                     | 1                | 10                            | South       | EM        | Good                 | Good                    | Basal stem offkilter and corrected from 1.5 m upwards, strong apical growth diverging into a decurrent crown form. Relatively narrow crown. Previous failures of lower limbs noted.                                                             | 40+                                      | C2                             |
| T350     | Fraxinus excelsior - Common Ash | 16         | 4.5              | 9.5  | 1.5 | 6.0  | 250, 280, 260           | 3.00             | 0.0                           | South       | M         | Fair                 | Good                    | Multi-stemmed at ground level, likely aged coppice down. Tension forks between basal stems. Some leaders bow away to the peripheries.                                                                                                           | 20-40                                    | C2                             |
| T351     | Fraxinus excelsior - Common Ash | 23         | 4.0              | 8.0  | 3.5 | 3.5  | 400, 370                | 2.00             | 3.5                           | South       | EM        | Good                 | Good                    | Bifurcates at ground level, no included growth noted. Codominant crown, self suppressing. Minor deadwood in lower crown. Group value.                                                                                                           | 40+                                      | B2                             |
| T352     | Fraxinus excelsior - Common Ash | 15         | 4.5              | 7.5  | 6.5 | 2.5  | 290, 300                | 2.00             | 3                             | SE          | EM        | Fair                 | Good                    | Bifurcates at ground level, adaptive growth at stem union. Dense codominant crowns. Pruning wounds to northern stem, decay pockets present, semi-occluded with epicormic growth. Limited stature.                                               | 20-40                                    | C2                             |
| T353     | Fraxinus excelsior - Common Ash | 18         | 7.5              | 7.5  | 2.5 | 6.0  | 320, 160, 280, 280, 0   | 4.00             | 0.0                           | SE          | EM        | Fair                 | Good                    | Multiple stems at ground level, occluded unions between stems. Previous compression fork between stem and branch is semi-occluded. Minor basal stem wound noted, exposed sapwood, part occluded. Dense crown, good vitality. Crown biased East. | 20-40                                    | C2                             |
| T354     | Quercus robur - Pedunculate Oak | 18         | 6.0              | 10.5 | 7.5 | 5.0  | 860                     | 1                | 0.0                           | South       | M         | Good                 | Good                    | Good scaffold limb structure and crown vitality. Wide spreading crown, prominent landscape amenity. Minor to moderate deadwood in lower crown.                                                                                                  | 40+                                      | A2                             |
| T355     | Fraxinus excelsior - Common Ash | 17.5       | 6                | 8.5  | 6.5 | 8.5  | 200, 200, 350, 350, 300 | 5.00             | 3                             | SE          | M         | Fair                 | Good                    | Multi-stemmed at ground level, likely aged coppice stand. Wide spreading crown with multiple leaders. Limited minor dieback in lower crown, otherwise good vitality. Unable to inspect basal stem unions in detail due to dense vegetation.     | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                    |                                          |                                |
| T356     | Quercus robur - Pedunculate Oak | 14.5       | 5.5              | 6.5 | 6.5 | 7.0 | 760                | 1                | 3.0                           | East        | M         | Fair                 | Good                    | Ivy clad from 1 m to approximately 12 m, limited inspection of obscured areas. Slightly unbalanced decurrent crown form. Pruning wounds to lower South crown. Good vitality.                                                                       | 40+                                      | B2                             |
| T357     | Fraxinus excelsior - Common Ash | 13         | 3.5              | 8   | 7.5 | 4.5 | 320, 330, 200, 280 | 4.00             | 2                             | SW          | EM        | Fair                 | Good                    | Clad with a mature ivy from 1.5 m to 10 m. Limited inspection of obscured areas. Multiple stems at ground level. Crown bias to South, offkilter stems with reduced lever arm at peripheries. Limited minor dieback, otherwise good Crown vitality. | 20-40                                    | C2                             |
| T358     | Fraxinus excelsior - Common Ash | 14         | 5.0              | 4.0 | 5.0 | 6.5 | 220, 230, 220, 150 | 4.00             | 2.0                           | SW          | EM        | Fair                 | Fair                    | Multiple stems at ground level, adaptive growth between previous compression forks. Exposed to buttress roots. Reduced crown density, peripheral dieback present in places.                                                                        | 10-20                                    | C2                             |
| T359     | Acer campestre - Field Maple    | 13         | 3.5              | 6   | 4.5 | 3.5 | 140                | 8.00             | 6                             | SW          | EM        | Poor                 | Good                    | Multiple adjacent stems at ground level, compression forks between stems noted. Basal decay and longitudinal stem wounds with internal decay noted. Ivy clad stems. Limited useful lifetime expectancy.                                            | 10-20                                    | C2                             |
| T360     | Fraxinus excelsior - Common Ash | 13         | 1.5              | 2.5 | 3   | 2.5 | 220                | 1                | 8                             | East        | SM        | Fair                 | Fair                    | Small statured tree. Minor sized deadwood of moderate extent in lower crown.                                                                                                                                                                       | 20-40                                    | C2                             |
| T361     | Fraxinus excelsior - Common Ash | 13         | 2                | 2.5 | 3   | 2.5 | 190                | 1                | 0.0                           | East        | SM        | Fair                 | Fair                    | Small statured tree. Stem offkilter. Fusion wood between branch and lower stem. Minor sized deadwood of moderate extent in lower crown.                                                                                                            | 20-40                                    | C2                             |
| T362     | Quercus robur - Pedunculate Oak | 18         | 4.5              | 7   | 5.5 | 7   | 650                | 1                | 1.5                           | South       | M         | Good                 | Good                    | Not plotted on land survey plan. Old epicormic growth around lower stem. Major previous limb failure at lower stem, Deadwood stub remains, part occluded. Reasonably well-balanced decurrent crown form. Good crown vitality.                      | 40+                                      | A2                             |
| T363     | Acer campestre - Field Maple    | 16         | 2.0              | 2.5 | 2.5 | 7.0 | 160, 160, 170, 120 | 4.00             | 5                             | West        | EM        | Fair                 | Fair                    | Multiple stems at ground level. Basal decay pockets noted. Heavily ivy clad stems. Relatively narrow upper crowns. Aesthetically poor form, likely limited useful lifetime expectancy.                                                             | 10-20                                    | C2                             |
| T364     | Acer campestre - Field Maple    | 16         | 5.5              | 2.5 | 2.5 | 1.5 | 150, 150, 200, 0   | 4.00             | 5                             | West        | OM        | Poor                 | Fair                    | Multiple stems at ground level, extensive basal decay and longitudinal decay columns. Heavily ivy clad stems, with relatively sparse upper crowns remaining.                                                                                       | <10                                      | U                              |
| T365     | Acer campestre - Field Maple    | 16         | 3.0              | 4.5 | 3   | 5   | 120, 160, 100, 130 | 4.00             | 3                             | West        | EM        | Fair                 | Fair                    | Multiple stems at ground level. Extensive basal decay on easternmost stem. Decay pockets on remaining stems. Ivy clad stems. Dieback of easternmost leader. Remaining Crown biased to the West. Limited amenity.                                   | 10-20                                    | C3                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)         | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                        |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                                 |                                          |                                |
| T366     | Acer campestre - Field Maple         | 16         | 5                | 3   | 2.5 | 5   | 100, 180, 220          | 3.00             | 5                             | West        | OM        | Poor                 | Fair                    | Bifurcates at ground level, included growth between gnarled stems. Longitudinal decay columns noted. Ivy clad stems. Crown biased to the North, dieback in Southern Crown. Limited amenity and useful lifetime expectancy.                                                                      | 10-20                                    | C2                             |
| T367     | Quercus robur - Pedunculate Oak      | 21         | 4                | 8.5 | 7   | 6.5 | 660                    | 1                | 3                             | South       | M         | Fair                 | Good                    | Previous major limb failure has left Crown with bias to the south. Minor to moderate deadwood in lower crown. High landscape amenity.                                                                                                                                                           | 40+                                      | A2                             |
| T368     | Quercus robur - Pedunculate Oak      | 18         | 4.5              | 2   | 4.5 | 6.0 | 500                    | 1                | 1.5                           | East        | EM        | Good                 | Good                    | Strong apical stem growth diverges into balance decurrent crown form. Good crown vitality. Moderate deadwood in lower West crown.                                                                                                                                                               | 40+                                      | B2                             |
| T369     | Fraxinus excelsior - Common Ash      | 12         | 1.0              | 4.0 | 2.5 | 2.0 | 140                    | 1                | 3.0                           | South       | SM        | Fair                 | Fair                    | Stem offkilter. Fusion wood between lower stem and branch. Relatively narrow crown. Minor Deadwood, moderate extent in lower crown. Limited stature.                                                                                                                                            | 20-40                                    | C2                             |
| T370     | Fraxinus excelsior - Common Ash      | 14.5       | 6.0              | 4.0 | 8.0 | 5.5 | 360                    | 1                | 0.0                           | South       | SM        | Fair                 | Good                    | Main stem diverges at 3 m, Tension forks. Central leader remains dominant until decurrent crown. South eastern diverging limbs have formed a compression fork.consider reduction of eastern diverging limb.                                                                                     | 20-40                                    | C2                             |
| T371     | Crataegus monogyna - Common Hawthorn | 10.5       | 3.0              | 3.0 | 3.0 | 1.5 | 220, 190, 100, 100, 80 | 5.00             | 2.0                           | East        | EM        | Fair                 | Good                    | Forms of multiple stems, compression forks and fusion wood between stems noted. Basal bark delamination at point of partial compression forks failure. Crossing branches in dense Crown.                                                                                                        | 10-20                                    | C2                             |
| T372     | Crataegus monogyna - Common Hawthorn | 10.5       | 0                | 2.5 | 3.5 | 3.5 | 190                    | 1                | 2.0                           | South       | SM        | Fair                 | Good                    | Young tree, limited stature. Stem slightly offkilter and Bifurcates at approximately 3 m, Crown lacks essential leader. Suppressed to the north.                                                                                                                                                | 20-40                                    | C2                             |
| T373     | Quercus robur - Pedunculate Oak      | 16.5       | 2.0              | 6.5 | 5.5 | 6.5 | 490                    | 1                | 3.0                           | SE          | EM        | Fair                 | Good                    | Not plotted on land survey plan. Bifurcates at approximately 5 m, tension fork. Minor deadwood in the lower crown, moderate extent. Upper crown suppressed by prominent tree to the north.                                                                                                      | 40+                                      | B2                             |
| T374     | Quercus robur - Pedunculate Oak      | 23         | 4.0              | 9.5 | 6.0 | 9.5 | 810                    | 1                | 3.0                           | South       | M         | Good                 | Good                    | Very prominent tree on site. Strong apical growth of stem with fluted buttress roots. Balanced decurrent crown form with good vitality. Treehouse built around lower stem. Would benefit the incremental growth of the lower stem if decking was graduallyreduced away from stem. High amenity. | 40+                                      | A2                             |
| T375     | Quercus robur - Pedunculate Oak      | 12         | 3                | 3   | 0   | 6.5 | 270                    | 1                | 2.5                           | West        | SM        | Fair                 | Good                    | Crown heavily suppressed by prominent tree to the South West, upper stem and Crown lean out to the West. Good vitality, limited stature.                                                                                                                                                        | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                          |                                          |                                |
| T376     | Acer campestre - Field Maple         | 8          | 2.0              | 3.0 | 4.0 | 1.0 | 160, 122.5     | 2.00             | 0.0                           | West        | EM        | Fair                 | Fair                    | Tree is heavily suppressed stem is heavily ivy clad. Limited inspection of areas obscured by ivy. Relatively sparse remaining Crown. Likely limited useful lifetime expectancy.                                          | 10-20                                    | C2                             |
| T377     | Quercus robur - Pedunculate Oak      | 23         | 5.5              | 3.0 | 4.5 | 6.0 | 530            | 1                | 2                             | East        | EM        | Good                 | Fair                    | Strong apical growth and good decurrent crown form. Minor peripheral dieback, limited extent.                                                                                                                            | 40+                                      | B2                             |
| T378     | Quercus robur - Pedunculate Oak      | 23         | 6.5              | 5.5 | 4.5 | 8.0 | 720            | 1                | 5.0                           | West        | M         | Good                 | Fair                    | Prominent tree, high landscape amenity. Minor to moderate deadwood stubs in lower and middle crown. Hard surfacing within RPA.                                                                                           | 40+                                      | A2                             |
| T379     | Taxus baccata - Common Yew           | 8.5        | 1.5              | 3.0 | 4.5 | 3.5 | 240            | 1                | 1.5                           | East        | SM        | Good                 | Good                    | Crown self suppresses with adjacent tree. Dense crown, good vitality. Limited stature.                                                                                                                                   | 40+                                      | C2                             |
| T380     | Taxus baccata - Common Yew           | 9          | 4                | 1.5 | 4   | 3.5 | 240            | 1                | 1                             | North       | SM        | Fair                 | Good                    | Self suppresses with adjacent tree. Crown lacks central leader. Compression fork at approximately 2 m. Dense crown, good vitality. Limited stature.                                                                      | 40+                                      | C2                             |
| T381     | Crataegus monogyna - Common Hawthorn | 9          | 3                | 1.5 | 2.5 | 3   | 220            | 1                | 2                             | North       | EM        | Fair                 | Good                    | Appears to have been previously topped. Dense crown, good vitality. Suppressed to the East. Limited stature.                                                                                                             | 20-40                                    | C2                             |
| T382     | Acer campestre - Field Maple         | 12.5       | 3.0              | 3.0 | 4.0 | 2.0 | 220, 190       | 2.00             | 0.0                           | North       | EM        | Fair                 | Fair                    | Bifurcates at 1 m, tight compression fork with included growth. Extensive epicormic growth at lower stem. Bifurcated crown with bias to the East. Limited stature.                                                       | 20-40                                    | C2                             |
| T383     | Acer campestre - Field Maple         | 15.5       | 4.5              | 4.5 | 4.5 | 3.5 | 220, 300       | 2.00             | 0.0                           | North       | EM        | Fair                 | Good                    | Hard surface located in RPA. Trifurcates at ground level, compression fork's between stems, with adaptive growth present. Epicormic growth present around lower stems. Dense crown, good vitality. Lacks central leader. | 20-40                                    | C2                             |
| T384     | Acer campestre - Field Maple         | 11         | 3.0              | 2.0 | 1.0 | 4.5 | 240            | 1                | 0.0                           | North       | EM        | Fair                 | Good                    | Stem offkilter, leader strays to the West and Crown bias to the West. Longitudinal decay column from tensile stresses on stem at approximately 2 m, semi-occluded.                                                       | 10-20                                    | C2                             |
| T385     | Crataegus monogyna - Common Hawthorn | 12         | 2.5              | 1.0 | 2.0 | 1.0 | 200            | 1                | 1.5                           | North       | SM        | Fair                 | Good                    | Tall, upright form. Crown lacks central leader. Good vitality. Limited stature.                                                                                                                                          | 20-40                                    | C2                             |
| T386     | Acer campestre - Field Maple         | 12         | 3.5              | 3.5 | 3.5 | 5.0 | 270            | 1                | 2.0                           | SW          | EM        | Fair                 | Good                    | Bifurcates at 1 m, compression fork with adaptive growth (peaked bulges). Dense crown, lack central leader. Good vitality. Limited stature.                                                                              | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                                  | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                     |                                          |                                |
| T387     | Ilex aquifolium - Common Holly  | 6          | 2.5              | 3   | 2.5 | 2   | 100            | 1                | 0.5                           | East        | SM        | Fair                 | Good                    | Adjacent stems, currently no included growth, but compression fork likely to develop in future. Good vitality, limited stature.                                                                                                                                                     | 20-40                                    | C2                             |
| T388     | Ilex aquifolium - Common Holly  | 6          | 2.5              | 1   | 2   | 2.0 | 190            | 1                | 0.5                           | East        | SM        | Fair                 | Good                    | Previously topped at approximately 6 m. Good vitality amongst remaining growth. Limited potential for scaffold limb structure.                                                                                                                                                      | 20-40                                    | C2                             |
| T389     | Fraxinus excelsior - Common Ash | 20         | 5.5              | 5   | 6.5 | 6   | 330, 340       | 2.00             | 9                             | West        | EM        | Fair                 | Fair                    | Bifurcates at less than 1 m, adaptive growth at the union. Crown Trifurcates. Slightly reduced crown density. Minor to moderate deadwood and dieback in lower to middle crown.                                                                                                      | 20-40                                    | C2                             |
| T390     | Quercus robur - Pedunculate Oak | 17.5       | 2.0              | 5.5 | 5.5 | 3.5 | 320            | 1                | 6.0                           | West        | EM        | Fair                 | Good                    | Upper crown biased to south, leader offkilter. Good crown vitality. Future potential.                                                                                                                                                                                               | 40+                                      | C2                             |
| T391     | Quercus robur - Pedunculate Oak | 21         | 5.5              | 7.5 | 6.0 | 4.0 | 560            | 1                | 0.0                           | West        | M         | Good                 | Good                    | Hard surface located in RPA. Strong apical growth in stem, diverges into good decurrent crown form. Dense crown, good vitality. Future potential.                                                                                                                                   | 40+                                      | B2                             |
| T392     | Fraxinus excelsior - Common Ash | 12         | 1.0              | 1.5 | 1.5 | 1.0 | 280            | 1                | 1.0                           | South       | SM        | Poor                 | Poor                    | Previous major failures at both leaders in Bifurcated Crown. No remaining scaffold limb structure, only sparse epicormic growth remains. Tree is essentially an invertebrate tower.                                                                                                 | <10                                      | U                              |
| T393     | Quercus robur - Pedunculate Oak | 23         | 5.5              | 4.5 | 6   | 6.5 | 760            | 1                | 3.0                           | NW          | M         | Good                 | Fair                    | Hard surface located in RPA. Prominent tree alongside driveway. Strong apical growth in stem diverging into good decurrent crown form. Minor to moderate deadwood in lower crown. Minor died back of limited extent in upper crown. Epicormic growth in crown.                      | 40+                                      | A2                             |
| T394     | Quercus robur - Pedunculate Oak | 18         | 3                | 4.5 | 0.5 | 10  | 460            | 1                | 2.0                           | NW          | EM        | Fair                 | Good                    | Asymmetric crown form with bias to the West will stop previous failure of major limb in Lower West crown. Hanging limb. Otherwise, good vitality and moderate value.                                                                                                                | 40+                                      | B2                             |
| T395     | Acer campestre - Field Maple    | 12         | 2.5              | 2.0 | 4   | 3   | 230            | 1                | 1.5                           | East        | EM        | Fair                 | Good                    | Aged epicormic growth on lower stem. Crown lacks central leader, scaffold limbs stray to the east. Limiting stature. Good vitality                                                                                                                                                  | 20-40                                    | C2                             |
| T396     | Quercus robur - Pedunculate Oak | 17.5       | 6.5              | 6.5 | 3.5 | 7.0 | 710            | 1                | 3.0                           | West        | M         | Fair                 | Fair                    | Hard surface located in RPA. Bifurcates at approximately 4 m, well structured Tension fork. Minor to moderate deadwood of moderate extent in lower and middle crown. Slightly reduced crown density. Epicormic growth in crown. Prominent tree at house entrance, good group value. | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                            |                                          |                                |
| T397     | Quercus robur - Pedunculate Oak | 17.5       | 4.5              | 5.5 | 4.5 | 3.0 | 600            | 1                | 0.0                           | East        | M         | Fair                 | Good                    | Hard surface located in RPA. Minor to moderate deadwood of moderate extent in lower and middle crown, particularly to the north. Otherwise, good vitality and good group value. Forms an arch over driveway entrance along with adjacent tree to the West. | 40+                                      | B2                             |
| T398     | Quercus robur - Pedunculate Oak | 20         | 5                | 8.5 | 7   | 7.5 | 670            | 1                | 3                             | SW          | M         | Good                 | Good                    | A fine tree, prominent landscape presence and amenity. Strong apical growth in stem diverging into well structured decurrent crown form. Balanced scaffold limbs. Good vitality. Minor deadwood only.                                                      | 40+                                      | A2                             |
| T399     | Fraxinus excelsior - Common Ash | 23         | 5.5              | 1   | 4   | 3   | 460            | 1                | 10                            | North       | EM        | Poor                 | Fair                    | Extensive internal decay at lower and basal stem with open wounds, part occluded. Extensive heartwood rot. Asymmetric crown, reduced density.recommend tree is removed.                                                                                    | 10-20                                    | U                              |
| T400     | Fraxinus excelsior - Common Ash | 23         | 2.5              | 1.0 | 5.0 | 0.0 | 340            | 1                | 1.0                           | East        | EM        | Fair                 | Fair                    | Part of a close- spaced group. Asymmetric, narrow crown biased to the east. Dieback in in upper crown.                                                                                                                                                     | 20-40                                    | C2                             |
| T401     | Fraxinus excelsior - Common Ash | 20         | 2                | 6.5 | 8   | 1   | 390            | 1                | 10                            | East        | EM        | Fair                 | Good                    | Part of a close spaced group. Asymmetric crown, suppressed to the West and biased to the East. Limited scaffold limb structure.                                                                                                                            | 20-40                                    | C2                             |
| T402     | Quercus robur - Pedunculate Oak | 23         | 7                | 3   | 4.0 | 4.5 | 520            | 1                | 2                             | North       | M         | Good                 | Good                    | Prominent tree in close spaced group. Crown biased the North, otherwise good structure and vitality.                                                                                                                                                       | 40+                                      | A2                             |
| T403     | Quercus robur - Pedunculate Oak | 23         | 1.5              | 8.5 | 6.5 | 5.0 | 660            | 1                | 1.0                           | East        | M         | Good                 | Good                    | Dominant tree in close spaced group. Minor to moderate deadwood in lower crown. Strong apical growth diverging into good decurrent crown form with bias to South.                                                                                          | 40+                                      | A2                             |
| T404     | Taxus baccata - Common Yew      | 8          | 3.5              | 3.5 | 2   | 4   | 150            | 1                | 0.5                           | East        | SM        | Fair                 | Good                    | Dense crown, good vitality. Crown lacks central leader, and overhead cable passes through Crown. Limited stature.                                                                                                                                          | 40+                                      | C2                             |
| T405     | Quercus robur - Pedunculate Oak | 19         | 6.5              | 3   | 2.0 | 1.5 | 460            | 1                | 10                            | West        | EM        | Fair                 | Fair                    | Stem slightly offkilter and leaning less than 10° to the West. Crown bias to North West. Moderate sized deadwood limb in lower crown. Dieback of moderate extent in lower and middle crown. Moderate group value                                           | 20-40                                    | B2                             |
| T406     | Fraxinus excelsior - Common Ash | 22         | 2.0              | 7.0 | 4.0 | 2.5 | 400            | 1                | 0.0                           | West        | EM        | Fair                 | Fair                    | Stem wounds and signs of compressive stress on lower North West stem. Part occluded. Crown biased the south. Moderate sized deadwood and dieback of moderate extent in lower, middle and peripheral Crown. Further monitor condition.                      | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                   |                                          |                                |
| T407     | Quercus robur - Pedunculate Oak | 12         | 1.5              | 2.5 | 4.0 | 1   | 290            | 1                | 1.5                           | SE          | SM        | Poor                 | Poor                    | Open stem wound with extensive heartwood decay. Decay column extends at least 1.5 m vertically. Ivy clad middle stem. Extensive dieback throughout Crown. Sparse live growth remains.recommend tree is removed.                                   | <10                                      | U                              |
| T408     | Quercus robur - Pedunculate Oak | 22         | 2.5              | 3.5 | 5.5 | 2.5 | 610            | 1                | 0.0                           | SE          | SM        | Poor                 | Poor                    | Basal stem wound with bark delamination. Extensive dieback and deadwood in upper crown. Major deadwood present, presents hazard. Limited useful lifetime expectancy.recommend tree is pollarded to an invertebrate power.                         | 10-20                                    | C3                             |
| T409     | Ilex aquifolium - Common Holly  | 12         | 2.0              | 3.5 | 3.5 | 2.5 | 320            | 1                | 0.0                           | East        | EM        | Fair                 | Good                    | Sven Bifurcates at approximately 2 m, Tension fork. Good crown vitality, lacks central leader. Limited stature.                                                                                                                                   | 20-40                                    | C2                             |
| T410     | Quercus robur - Pedunculate Oak | 19         | 2.5              | 3.0 | 3.5 | 5.5 | 420            | 1                | 3.0                           | NE          | EM        | Fair                 | Good                    | Building/structure located in RPA. Tree has been previously Crown lifted and Crown reduced for easement of building to the south. Epicormic growth at pruning wounds. Good vitality.                                                              | 20-40                                    | B2                             |
| T411     | Ilex aquifolium - Common Holly  | 7          | 2.5              | 3.0 | 3.0 | 1.5 | 100, 50        | 2.00             | 0.0                           | North       | EM        | Fair                 | Good                    | Young tree, lacks central leader. Limited stature.                                                                                                                                                                                                | 20-40                                    | C2                             |
| T412     | Salix caprea - Goat Willow      | 8          | 2.5              | 2.0 | 2.0 | 1.5 | 120            | 1                | 1.5                           | North       | SM        | Fair                 | Good                    | Not plotted on land survey plan. Young tree situated at edge of ditch. Good vitality, limited stature.                                                                                                                                            | 20-40                                    | C2                             |
| T413     | Quercus robur - Pedunculate Oak | 21         | 2.5              | 2.0 | 4.0 | 4.5 | 420            | 1                | 9.0                           | West        | EM        | Fair                 | Fair                    | Recommend crown is deadwooded.Recommend conservation deadwooding.Tree has been previously Crown lifted for easement of building to the West. Expensive dieback in upper crown.                                                                    | 20-40                                    | B1                             |
| T414     | Fraxinus excelsior - Common Ash | 12         | 2.5              | 1.5 | 6   | 2   | 190            | 1                | 2.5                           | NW          | SM        | Fair                 | Good                    | Young tree. Leaders offkilter and straight to the east. Limited stature.                                                                                                                                                                          | 20-40                                    | C2                             |
| T415     | Quercus robur - Pedunculate Oak | 19         | 3.0              | 4.0 | 4.0 | 3.0 | 420            | 1                | 3.0                           | East        | EM        | Fair                 | Fair                    | Previously Crown reduced. Moderate sized deadwood in North Crown. Epicormic growth on lower stem. Further monitor condition.                                                                                                                      | 20-40                                    | B1                             |
| T416     | Fraxinus excelsior - Common Ash | 20         | 2.5              | 6.5 | 8.0 | 3.0 | 220, 200, 150  | 3.00             | 0.0                           | West        | SM        | Fair                 | Good                    | Multiple stems at 1 m, compression fork with adaptive growth present. Leader to the West has been previously pruned, epicormic regrowth. Leader to the east strained at approximately 35° angle. Asymmetric and unbalanced crown. Minor deadwood. | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                             | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                |                                          |                                |
| T417     | Quercus robur - Pedunculate Oak | 20         | 4.5              | 4.5 | 8.0 | 7.0 | 300, 430       | 2.00             | 2.0                           | West        | EM        | Fair                 | Good                    | Two adjacent stems surveyed together. Northern steis dominant with an even Crown that has been previously Crown reduced. Southern Stan is offkilter and leans approximately 15° to the north west. Give vitality in both crowns.                                               | 40+                                      | B2                             |
| T418     | Acer campestre - Field Maple    | 11         | 2.5              | 3.5 | 3.5 | 4.5 | 170, 150       | 2.00             | 1.5                           | East        | EM        | Fair                 | Good                    | Bifurcates at 1.5 m, compression fork with adaptive growth. Codominant leaders in Crown, lateral support. Good vitality. Limited stature.                                                                                                                                      | 20-40                                    | C2                             |
| T419     | Fraxinus excelsior - Common Ash | 23         | 7.5              | 3.0 | 6.0 | 3.0 | 560            | 1                | 0.0                           | West        | M         | Fair                 | Good                    | Ivy clad stem from 1 m to approximately 16 m where Crown diverges. Unable to inspect unions due to ivy. Crown lacks central leader. Major previous limb failure noted, tear out wound semi occluded. Prominent skyline amenity.                                                | 40+                                      | A2                             |
| T420     | Fraxinus excelsior - Common Ash | 16         | 1.5              | 4.5 | 0   | 6.5 | 300            | 1                | 13                            | South       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Them off kilter with an approximate 20° angle to the south from 2 m. Corrected with vertical growth of leaders in Crown. Ivy cloaked from 1.5 m to 10 m. Scrappy form, limited stature.                                                       | 20-40                                    | C2                             |
| T421     | Fraxinus excelsior - Common Ash | 15         | 5.0              | 0.0 | 1.0 | 2.5 | 230            | 1                | 8.0                           | South       | SM        | Fair                 | Good                    | Suppressed Crown with heavy bias to the south. Leader strays offkilter from approximately 3 m at an approximate 30° angle.                                                                                                                                                     | 20-40                                    | C2                             |
| T422     | Fraxinus excelsior - Common Ash | 17         | 6                | 1.5 | 0   | 3   | 380            | 1                | 0.0                           | West        | EM        | Poor                 | Good                    | Major basal internal decay, with open wound and extensive heartwood rot. Bifurcates at approximately 2 m, southern stem has failed. Good vitality in remaining leader, however, the attachment point to the stem is becoming increasingly decayed.recommend tree is pollarded. | <10                                      | U                              |
| T423     | Quercus robur - Pedunculate Oak | 16         | 7.5              | 8.5 | 3.5 | 4   | 420            | 1                | 0.0                           | West        | EM        | Fair                 | Good                    | Building/structure located in RPA. Strong, clear stem. Shipping container in RPA. Main leader biased to the south, Crown balance by major limb to the north. Give vitality. Minor to moderate deadwood in lower self Crown. Partially failed limbs in middle Crown noted.      | 40+                                      | B2                             |
| T424     | Acer campestre - Field Maple    | 20         | 4.5              | 6.0 | 3.0 | 6.0 | 300, 200       | 2.00             | 2.5                           | NW          | M         | Fair                 | Fair                    | Not plotted on land survey plan. Stem ivy clad from 1 m to upper crown. Bifurcates approximately 1.5 m, union obscured. Crown lacks central leader. Dieback in lower crown. Inspection limited by ivy. Scrappy form.                                                           | 10-20                                    | B2                             |
| T425     | Fraxinus excelsior - Common Ash | 22         | 4                | 3.5 | 3.5 | 6.5 | 220, 350, 210  | 3.00             | 1.5                           | SW          | EM        | Good                 | Good                    | Formed of multiple adjacent stems, central stem is dominant and diverges into good decurrent crown form. Crowns combine to give moderate landscape value.                                                                                                                      | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                  | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                     |                                          |                                |
| T426     | Fraxinus excelsior - Common Ash | 16         | 3.5              | 7.0 | 3.5 | 3.0 | 300                | 1                | 3.0                           | South       | SM        | Poor                 | Good                    | Not plotted on land survey plan. Multiple included union failures. Semi occluded at wound points. Extensive decay around wound points. Bifurcated Crown formed of aged epicormic growth from point of previous failure.                             | 10-20                                    | C2                             |
| T427     | Fraxinus excelsior - Common Ash | 16         | 5                | 6   | 9   | 1   | 260                | 1                | 8                             | NE          | SM        | Fair                 | Good                    | Not plotted on land survey plan. Stem diverges into multiple leaders at approximately 3 m. Compression forks and fusion wood present. Crown has heavy bias that it is. Symptoms of bacterial ash canker present. Limited stature.                   | 20-40                                    | C2                             |
| T428     | Fraxinus excelsior - Common Ash | 7          | 3                | 4.5 | 8   | 0   | 200, 220           | 2.00             | 2                             | East        | OM        | Poor                 | Fair                    | Bifurcates at approximately 1.5 m. Middle crown is swamped with ivy, unable to inspect this area. A leader strays away to the east at approximately 40% with weeping crown form. Bacterial ash canker symptoms. Limited useful lifetime expectancy. | <10                                      | U                              |
| T429     | Corylus avellana - Common Hazel | 7          | 6.0              | 7.0 | 6.0 | 5.5 | 100                | 20.00            | 1.5                           | East        | M         | Fair                 | Good                    | Not plotted on land survey plan. Mature stand of Hazel, formed of multiple stems with wide spreading, dense crown. Good vitality.                                                                                                                   | 20-40                                    | B1                             |
| T430     | Fraxinus excelsior - Common Ash | 15         | 5.5              | 1.5 | 4.0 | 6.0 | 190, 330, 120      | 3.00             | 8.0                           | West        | OM        | Poor                 | Fair                    | Extensive basal decay with two large open wounds. Crown is formed of aged epicormic growth attached at former stump. Tree has no long-term potential.recommend tree is removed. Failure imminent.                                                   | <10                                      | U                              |
| T431     | Quercus robur - Pedunculate Oak | 15         | 3.5              | 2.5 | 4.5 | 6.0 | 250, 220           | 2.00             | 8.0                           | West        | SM        | Fair                 | Good                    | Not plotted on land survey plan. Bifurcates at approximately 1 m, previous compression fork with adaptive growth present. Deadwood in lower crown. Crown lacks central leader. Limited stature.                                                     | 20-40                                    | C2                             |
| T432     | Quercus robur - Pedunculate Oak | 10         | 1.5              | 1.5 | 4.0 | 2   | 150, 110, 150      | 3.00             | 6                             | East        | SM        | Poor                 | Poor                    | Tree is swamped with ivy, limited life growth remains. Limited inspection of obscured areas. Likely limited useful lifetime expectancy.                                                                                                             | <10                                      | U                              |
| T433     | Fraxinus excelsior - Common Ash | 17         | 2.5              | 5.5 | 6.0 | 3.5 | 340, 140, 140, 100 | 4.00             | 2.0                           | East        | EM        | Fair                 | Good                    | Not plotted on land survey plan. Formed of one dominant stem with aged basal epicormic growth. Crown lacks central leader. Good vitality. Limited stature.                                                                                          | 20-40                                    | C2                             |
| T434     | Fraxinus excelsior - Common Ash | 19         | 5                | 6.5 | 2.5 | 7   | 270                | 1                | 8                             | NE          | EM        | Fair                 | Good                    | Offkilter stem. Diverging branch forms compression fork with main stem. Crown lacks central leader, leaders stray to cardinal points. Scrappy, drawn out form.                                                                                      | 20-40                                    | C2                             |
| T435     | Fraxinus excelsior - Common Ash | 18         | 3                | 2.5 | 6   | 1.5 | 380                | 1                | 1.5                           | East        | EM        | Fair                 | Fair                    | Stem offkilter and Crown biased to the West. Minor deadwood and dieback in Eastern and Northern Crown.                                                                                                                                              | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                             | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                     |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                            |                                          |                                |
| T436     | Fraxinus excelsior - Common Ash     | 18         | 5.5              | 3   | 7   | 7   | 550            | 1                | 1.5                           | East        | M         | Fair                 | Good                    | Stem Bifurcates at approximately 5 m, compression fork with adaptive growth. Bifurcated Crown, with vitality. Previous limb failures noted. Moderate landscape amenity.                                                                                    | 40+                                      | B2                             |
| T437     | Ilex aquifolium - Common Holly      | 12         | 2.0              | 4.0 | 1.5 | 3.5 | 300, 250       | 2.00             | 0.0                           | East        | EM        | Fair                 | Fair                    | Bifurcated at ground level, no included growth. Heavenly Ivy clad mid crown. Leader of eastern standard appears to have broken out. Limited inspection due to Ivy. Limited stature.                                                                        | 20-40                                    | C2                             |
| T438     | Quercus robur - Pedunculate Oak     | 18.5       | 4                | 6   | 1.5 | 6   | 600            | 1                | 12                            | South       | M         | Good                 | Good                    | Strong apical stem, slightly offkilter and diverges into reasonably well-balanced decurrent crown form slight bias to the south. Good vitality. Minor deadwood in lower crown. Moderate amenity.                                                           | 40+                                      | B2                             |
| T439     | Quercus robur - Pedunculate Oak     | 20         | 10               | 4.5 | 4.5 | 6   | 700            | 1                | 3                             | North       | M         | Good                 | Good                    | Apically strong stem diverges into well-balanced decurrent crown form. A major lateral limb in the lower South Crown extends over a shed, branch attachment is good and lever arm reduced at peripheral branches. End weight reduction might be considered | 40+                                      | A2                             |
| T440     | Fraxinus excelsior - Common Ash     | 18         | 6                | 3.5 | 5   | 2   | 300            | 1                | 5                             | North       | EM        | Fair                 | Good                    | Stem offkilter. Limited scaffold limb structure. Limited stature.                                                                                                                                                                                          | 20-40                                    | C2                             |
| T441     | Fraxinus excelsior - Common Ash     | 14         | 7.0              | 7.0 | 7.0 | 2.0 | 200            | 6                | 2.0                           | NE          | EM        | Fair                 | Good                    | Established at edge of ditch. Multiple stems, included growth among some. Ivy clad mid stem. North Eastern stem is bowing. Minor died back in lower crown. Scrappy form.                                                                                   | 20-40                                    | C2                             |
| T442     | Populus balsamifera - Balsam poplar | 14         | 3.5              | 3.5 | 2.0 | 3.5 | 150, 120       | 2.00             | 0.0                           | NE          | SM        | Fair                 | Good                    | Bifurcates at ground level, compression fork at basal stems. Stems offkilter. Limited stature.                                                                                                                                                             | 20-40                                    | C2                             |
| T443     | Populus balsamifera - Balsam poplar | 14         | 2.5              | 3.5 | 3.5 | 1.5 | 200, 150, 120  | 3.00             | 4.0                           | South       | SM        | Fair                 | Good                    | Multiple adjacent stems at ground level, surveyed collectively. A leader in the southernmost stem has previously broken out. Scrappy form, limited stature.                                                                                                | 20-40                                    | C2                             |
| T444     | Quercus robur - Pedunculate Oak     | 12.5       | 7.5              | 1   | 5.5 | 7.5 | 390            | 1                | 3                             | West        | EM        | Fair                 | Fair                    | Suppressed by adjacent tree to the south, Crown biased and stem slightly offkilter to the north. Limited scaffolding structure, with slightly reduced crown density.                                                                                       | 20-40                                    | C2                             |
| T445     | Quercus robur - Pedunculate Oak     | 16.5       | 7.0              | 8.5 | 7.5 | 6.5 | 1020           | 1                | 0.0                           | South       | V         | Good                 | Good                    | Large main stem diverges into balanced decurrent crown form with multiple leaders at 4 metres. Wide spreading crown, good vitality. Prominent tree, high amenity.                                                                                          | 40+                                      | A2                             |
| T446     | Quercus robur - Pedunculate Oak     | 12         | 4                | 4   | 4   | 4.5 | 240            | 1                | 8                             | South       | SM        | Good                 | Good                    | Established at side of ditch. Young tree, limited stature.                                                                                                                                                                                                 | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                  |                                          |                                |
| T447     | Crataegus monogyna - Common Hawthorn | 4          | 2                | 2   | 2   | 2   | 200            | 1                | 0.5                           | North       | M         | Fair                 | Good                    | Crossing branches in crown.                                                                                                                      | 10-20                                    | C1                             |
| T448     | Quercus robur - Pedunculate Oak      | 20         | 12               | 16  | 15  | 13  | 1900           | 1                | 3.5                           | NE          | V         | Fair                 | Good                    | Deadwood in the crown of major extent. Previous branch failures noted. Ancient oak tree. Large decay columns in leaders. Cavity at 3m.           | 40+                                      | A3                             |
| T449     | Crataegus monogyna - Common Hawthorn | 5          | 3                | 2.5 | 2.5 | 2.5 | 300            | 1                | 0.5                           | North       | M         | Fair                 | Good                    | Crossing branches in crown.                                                                                                                      | 10-20                                    | C1                             |
| T450     | Quercus robur - Pedunculate Oak      | 16         | 5                | 7   | 5   | 5   | 700            | 1                | 2                             | North       | M         | Good                 | Good                    | Epicormics growth on stem. Pruning wounds to crown.                                                                                              | 40+                                      | A1                             |
| T451     | Salix cinerea - Grey Willow          | 9          | 5                | 4   | 5   | 5   | 120            | 6                | 2                             | South       | EM        | Poor                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to access. Multi stemmed tree on ditch bank.    | 10-20                                    | C2                             |
| T452     | Salix cinerea - Grey Willow          | 7          | 3                | 4   | 5   | 1   | 250, 200       | 2.00             | 0.5                           | East        | M         | Poor                 | Good                    | Previous branch failures noted. Included branch union in the crown. Restricted inspection due to access.                                         | 10-20                                    | C2                             |
| T453     | Quercus robur - Pedunculate Oak      | 8          | 3.0              | 3   | 2   | 3   | 160            | 1                | 1                             | SW          | Y         | Fair                 | Good                    | Restricted inspection due to access.                                                                                                             | 20-40                                    | B2                             |
| T454     | Quercus robur - Pedunculate Oak      | 13         | 8                | 9   | 8   | 9   | 700            | 1                | 3                             | South       | M         | Good                 | Good                    | Epicormics growth on stem. Deadwood in the crown of minor extent. Restricted inspection due to access.                                           | 40+                                      | A2                             |
| T455     | Fraxinus excelsior - Common Ash      | 13         | 3                | 4   | 5   | 5   | 260, 230       | 2.00             | 3                             | East        | EM        | Fair                 | Good                    | Bifurcated stem formed at 0.0 metres. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree. | 10-20                                    | C2                             |
| T456     | Quercus robur - Pedunculate Oak      | 6          | 1                | 3   | 5   | 0   | 240            | 1                | 2                             | NE          | SM        | Poor                 | Fair                    | Heavily suppressed crown. Restricted inspection due to vegetation.                                                                               | 10-20                                    | C2                             |
| T457     | Quercus robur - Pedunculate Oak      | 14         | 5                | 7   | 7   | 5   | 600            | 1                | 2.5                           | SE          | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                         | 40+                                      | A2                             |
| T458     | Quercus robur - Pedunculate Oak      | 14         | 6                | 5   | 6   | 6   | 800            | 1                | 2                             | South       | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to ivy.                                         | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                           |                                          |                                |
| T459     | Acer campestre - Field Maple    | 9          | 2                | 2   | 2   | 2   | 200            | 1                | 3                             | NE          | SM        | Fair                 | Good                    | Restricted inspection due to vegetation.                                                                                                                                                                                                  | 20-40                                    | B2                             |
| T460     | Fraxinus excelsior - Common Ash | 19         | 5                | 4   | 6   | 5   | 550            | 1                | 4.5                           | North       | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to access.                                                                                                                               | 20-40                                    | B2                             |
| T461     | Quercus robur - Pedunculate Oak | 10         | 1                | 6   | 6   | 6   | 550            | 1                | 3                             | South       | EM        | Fair                 | Fair                    | Epicormics growth on stem. Heavily suppressed crown. Restricted inspection due to ivy.                                                                                                                                                    | 20-40                                    | B2                             |
| T462     | Quercus robur - Pedunculate Oak | 8          | 4                | 5   | 5   | 5   | 550            | 1                | 2                             | South       | M         | Good                 | Fair                    | Epicormics growth on stem. Deadwood in the crown of minor extent.                                                                                                                                                                         | 20-40                                    | B2                             |
| T463     | Quercus robur - Pedunculate Oak | 10         | 6                | 3   | 6   | 6   | 300            | 1                | 0.5                           | North       | SM        | Fair                 | Good                    | Restricted inspection due to access and ivy.                                                                                                                                                                                              | 20-40                                    | B2                             |
| T464     | Quercus robur - Pedunculate Oak | 7          | 3                | 0   | 3   | 3   | 180            | 1                | 0.5                           | North       | Y         | Poor                 | Fair                    | Heavily suppressed crown. Restricted inspection due to access and ivy.                                                                                                                                                                    | 10-20                                    | C2                             |
| T465     | Quercus robur - Pedunculate Oak | 11         | 3                | 3.0 | 3.0 | 3.0 | 350, 200       | 2.00             | 2                             | East        | SM        | Fair                 | Good                    | Included main stem union. Restricted inspection due to access. General poor form to tree.                                                                                                                                                 | 20-40                                    | C2                             |
| T466     | Salix cinerea - Grey Willow     | 5          | 4                | 4   | 0   | 5   | 170            | 6                | 0.5                           | SW          | M         | Poor                 | Fair                    | Some evidence of bark damage. Multi stemmed stem formed at 0.5 metres. Deadwood in the crown of minor extent. Crossing branches in crown. Previous branch failures noted. Restricted inspection due to access. General poor form to tree. | 10-20                                    | C2                             |
| T467     | Quercus robur - Pedunculate Oak | 12         | 4.0              | 4.0 | 4   | 4   | 250, 230       | 2.00             | 2                             | SE          | SM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to access. General poor form to tree.                                                                                                                                    | 20-40                                    | C2                             |
| T468     | Quercus robur - Pedunculate Oak | 11         | 4                | 2   | 5   | 5   | 350            | 1                | 1                             | NW          | SM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to access. General poor form to tree.                                                                                                                                    | 20-40                                    | B2                             |
| T469     | Quercus robur - Pedunculate Oak | 10         | 2                | 3   | 3   | 2   | 180            | 1                | 4                             | South       | Y         | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation.                                                                                                                                                           | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                    |                                          |                                |
| T470     | Quercus robur - Pedunculate Oak | 9          | 3                | 3.0 | 3.0 | 3   | 250            | 1                | 2                             | SE          | SM        | Fair                 | Good                    | Restricted inspection due to vegetation.                                                                                                                                           | 20-40                                    | B2                             |
| T471     | Quercus robur - Pedunculate Oak | 7          | 3.0              | 3.0 | 3.0 | 3.0 | 250, 180       | 2.00             | 1                             | North       | SM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree.                                                                         | 20-40                                    | B2                             |
| T472     | Quercus robur - Pedunculate Oak | 6          | 4.5              | 4.5 | 4   | 4.5 | 280            | 1                | 0.5                           | NW          | SM        | Fair                 | Fair                    | Bifurcated stem formed at 0.5 metres. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree.                                   | 10-20                                    | C2                             |
| T473     | Fraxinus excelsior - Common Ash | 9          | 3                | 2   | 3   | 3   | 130, 110, 90   | 3.00             | 5                             | East        | Y         | Poor                 | Good                    | General poor form to tree.                                                                                                                                                         | 10-20                                    | C2                             |
| T474     | Fraxinus excelsior - Common Ash | 9          | 3.0              | 3   | 3.5 | 2   | 130            | 1.00             | 3                             | East        | SM        | Poor                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree.                                                                         | 10-20                                    | C2                             |
| T475     | Quercus robur - Pedunculate Oak | 12         | 5                | 5   | 5   | 5   | 400, 350       | 2.00             | 1                             | South       | EM        | Poor                 | Good                    | Included main stem union. Restricted inspection due to vegetation.                                                                                                                 | 20-40                                    | B2                             |
| T476     | Fraxinus excelsior - Common Ash | 7          | 3                | 3   | 3   | 3   | 120            | 6                | 2                             | SW          | SM        | Poor                 | Fair                    | Multi stemmed stem formed at 0.0 metres. Restricted inspection due to vegetation. General poor form to tree.                                                                       | 10-20                                    | C2                             |
| T477     | Acer campestre - Field Maple    | 7          | 2                | 2   | 2   | 2   | 130, 130       | 2.00             | 2.5                           | South       | SM        | Poor                 | Good                    | Included main stem union. Restricted inspection due to vegetation. General poor form to tree.                                                                                      | 10-20                                    | C2                             |
| T478     | Quercus robur - Pedunculate Oak | 8          | 3                | 3   | 3   | 3   | 300            | 1                | 2                             | NE          | SM        | Fair                 | Good                    | Bifurcated stem formed at 2.0 metres. Restricted inspection due to vegetation.                                                                                                     | 20-40                                    | B2                             |
| T479     | Quercus robur - Pedunculate Oak | 8          | 2.0              | 2.0 | 2.0 | 2.0 | 200            | 1                | 0.5                           | South       | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. General poor form to tree.                                                                                                                | 20-40                                    | C2                             |
| T480     | Quercus robur - Pedunculate Oak | 6          | 0                | 4   | 5   | 2   | 150            | 1                | 3                             | East        | SM        | Poor                 | Fair                    | The tree is leaning at a 10 degree angle in a SE direction. Asymmetric formed crown. Heavily suppressed crown. Restricted inspection due to vegetation. General poor form to tree. | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                               |                                          |                                |
| T481     | Fraxinus excelsior - Common Ash | 14         | 6.0              | 7.0 | 7.0 | 4.0 | 580                | 1                | 6.0                           | SE          | M         | Poor                 | Fair                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to ivy and vegetation. Lost leader in past.  | 10-20                                    | C2                             |
| T482     | Quercus robur - Pedunculate Oak | 14         | 6.0              | 6   | 7.0 | 6   | 650                | 1                | 5                             | SE          | M         | Fair                 | Fair                    | Deadwood in the crown of moderate extent. Branch dieback of minor extent. Restricted inspection due to ivy and vegetation.                    | 40+                                      | A2                             |
| T483     | Fraxinus excelsior - Common Ash | 9          | 4.0              | 4   | 4   | 4   | 200, 190, 180, 160 | 4.00             | 3                             | West        | SM        | Poor                 | Good                    | Restricted inspection due to vegetation. General poor form to tree.                                                                           | 10-20                                    | C2                             |
| T484     | Quercus robur - Pedunculate Oak | 16         | 6                | 7   | 6   | 6   | 800                | 1                | 3                             | SW          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                      | 40+                                      | A1                             |
| T485     | Fraxinus excelsior - Common Ash | 9          | 4                | 3.5 | 3.5 | 3.5 | 280, 250           | 2.00             | 2.0                           | SW          | SM        | Fair                 | Good                    | Bifurcated stem formed at 0.0 metres. Deadwood in the crown of minor extent. General poor form to tree.                                       | 10-20                                    | C1                             |
| T486     | Quercus robur - Pedunculate Oak | 7          | 2                | 2   | 2   | 2.5 | 200                | 1                | 1.5                           | West        | Y         | Fair                 | Fair                    | Heavily suppressed crown.                                                                                                                     | 10-20                                    | C1                             |
| T487     | Ulmus sp. - Elm                 | 12         | 4                | 3   | 3   | 2   | 200                | 1                | 2.0                           | North       | SM        | Poor                 | Fair                    | Heavily suppressed crown. Restricted inspection due to vegetation. Tree has no long term potential. Early signs of DED in upper stem.         | <10                                      | U                              |
| T488     | Fraxinus excelsior - Common Ash | 12         | 4.0              | 8   | 4   | 7   | 450                | 1                | 3                             | SW          | M         | Fair                 | Fair                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation.                                                               | 20-40                                    | B2                             |
| T489     | Quercus robur - Pedunculate Oak | 13         | 6.0              | 5.5 | 4.5 | 5.5 | 640                | 1                | 3.5                           | North       | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Bark damage to some roots at base where soil disturbance has occurred. | 40+                                      | A1                             |
| T490     | Fraxinus excelsior - Common Ash | 8          | 1                | 2   | 1   | 1   | 130, 130           | 2.00             | 3                             | South       | Y         | Fair                 | Fair                    | Deadwood in the crown of extent. General poor form to tree.                                                                                   | 10-20                                    | C2                             |
| T491     | Fraxinus excelsior - Common Ash | 8          | 1.0              | 2.0 | 1.0 | 2   | 190                | 1                | 2.5                           | West        | Y         | Fair                 | Good                    |                                                                                                                                               | 10-20                                    | C2                             |
| T492     | Quercus robur - Pedunculate Oak | 4          | 0                | 2.5 | 2   | 2   | 130                | 1                | 2                             | South       | Y         | Poor                 | Fair                    | Heavily suppressed crown. Deadwood in the crown of minor extent. General poor form to tree. Tree has no long term potential.                  | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                    |                                          |                                |
| T493     | Fraxinus excelsior - Common Ash | 8          | 3                | 3.0 | 3.0 | 3.0 | 150, 130, 90   | 3.00             | 2.0                           | South       | SM        | Fair                 | Good                    | Restricted inspection due to vegetation. General poor form to tree.                                                                                | 10-20                                    | C2                             |
| T494     | Quercus robur - Pedunculate Oak | 16         | 4.0              | 8.0 | 7   | 7   | 650            | 1                | 2                             | SE          | M         | Fair                 | Good                    | Included main stem union. Deadwood in the crown of minor extent. Fused limb/branches. Restricted inspection due to access.                         | 40+                                      | A2                             |
| T495     | Pinus sylvestris - Scots Pine   | 16         | 3                | 4   | 4   | 4   | 500            | 1                | 6                             | South       | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to access and ivy.                                                                | 40+                                      | A2                             |
| T496     | Pinus sylvestris - Scots Pine   | 15         | 4.0              | 5.0 | 4.0 | 4.0 | 530            | 1                | 4.0                           | South       | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to access. Excellent form.                                                        | 40+                                      | A2                             |
| T497     | Acer campestre - Field Maple    | 6          | 1.5              | 2   | 1   | 2.5 | 170            | 1                | 1                             | South       | SM        | Poor                 | Good                    | Heavily suppressed crown. Tree has no long term potential. Good collective worth.                                                                  | 10-20                                    | C2                             |
| T498     | Acer campestre - Field Maple    | 10         | 2                | 2.0 | 2.5 | 2.5 | 260            | 1                | 1.0                           | SW          | SM        | Good                 | Good                    | Multi stemmed stem formed at 2.0 metres.                                                                                                           | 20-40                                    | B2                             |
| T499     | Fraxinus excelsior - Common Ash | 20         | 7                | 6   | 5   | 5   | 800            | 1                | 5                             | South       | M         | Fair                 | Fair                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to ivy.                                           | 20-40                                    | B2                             |
| T500     | Quercus robur - Pedunculate Oak | 7          | 2                | 4   | 0   | 2   | 400            | 1                | 0.0                           | South       | EM        | Dead                 | Dead                    | Deadwood in the crown of major extent. Restricted inspection due to vegetation. Dead oak in hedgerow.                                              | <10                                      | U                              |
| T501     | Quercus robur - Pedunculate Oak | 9          | 3                | 4   | 3   | 5   | 600            | 1                | 2                             | West        | M         | Fair                 | Fair                    | Epicormics growth on stem & crown. Pruning wounds to crown. Bifurcated stem formed at 2.0 metres. Restricted inspection due to ivy and vegetation. | 20-40                                    | B2                             |
| T502     | Quercus robur - Pedunculate Oak | 10         | 3.0              | 3   | 3.0 | 3   | 480            | 1                | 3                             | West        | EM        | Good                 | Good                    | Pruning wounds to crown.                                                                                                                           | 20-40                                    | B2                             |
| T503     | Quercus robur - Pedunculate Oak | 20         | 6                | 11  | 10  | 9   | 1000           | 1                | 6                             | SW          | M         | Fair                 | Good                    | Pruning wounds to stem. Deadwood in the crown of minor extent.                                                                                     | 40+                                      | A2                             |
| T504     | Quercus robur - Pedunculate Oak | 20         | 6                | 9   | 6   | 9   | 1000           | 1                | 4                             | West        | M         | Fair                 | Good                    | Pruning wounds to stem. Deadwood in the crown of minor extent.                                                                                     | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                           | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                   |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                             |                                          |                                |
| T505     | Populus canescens - Balsam poplar | 21         | 5                | 10  | 6   | 6   | 750            | 1                | 8.5                           | South       | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted.                                                                                                                      | 40+                                      | A2                             |
| T506     | Quercus robur - Pedunculate Oak   | 8          | 4                | 2   | 5   | 1   | 500            | 1                | 4                             | North       | M         | Poor                 | Poor                    | Pruning wounds to stem. Deadwood in the crown of moderate extent. Branch dieback of moderate extent.                                                                                        | 10-20                                    | C1                             |
| T507     | Quercus robur - Pedunculate Oak   | 13         | 5                | 7   | 7   | 7   | 800            | 1                | 2                             | SW          | M         | Good                 | Good                    | Epicormics growth on stem. Pruning wounds to stem.                                                                                                                                          | 40+                                      | A2                             |
| T508     | Quercus robur - Pedunculate Oak   | 10         | 3                | 4   | 5   | 5   | 650            | 1                | 2                             | SW          | M         | Poor                 | Poor                    | Deadwood in the crown of moderate extent. Branch dieback of major extent. Previous branch failures noted. Restricted inspection due to ivy and vegetation. Tree has no long term potential. | 10-20                                    | C2                             |
| T509     | Quercus robur - Pedunculate Oak   | 12         | 4                | 2   | 1   | 6   | 650            | 1                | 2                             | SW          | M         | Fair                 | Fair                    | The tree is leaning at a 10 degree angle in a West direction. Deadwood in the crown of minor extent. Previous branch failures noted.                                                        | 20-40                                    | B2                             |
| T510     | Quercus robur - Pedunculate Oak   | 16         | 8                | 5   | 5   | 8   | 850            | 1                | 2                             | West        | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation.                                                                                                             | 40+                                      | A2                             |
| T511     | Quercus robur - Pedunculate Oak   | 16         | 5                | 3   | 4   | 7   | 450, 450       | 2.00             | 5                             | NW          | M         | Fair                 | Fair                    | Deadwood in the crown of moderate extent. Restricted inspection due to vegetation. General poor form to tree. One stem has lost leader in past.                                             | 20-40                                    | B2                             |
| T512     | Quercus robur - Pedunculate Oak   | 16         | 7                | 6   | 4   | 7   | 750            | 1                | 2                             | SW          | M         | Good                 | Good                    | Epicormics growth on stem. Deadwood in the crown of moderate extent.                                                                                                                        | 40+                                      | A2                             |
| T513     | Quercus robur - Pedunculate Oak   | 10         | 4                | 5   | 5   | 3   | 600            | 1                | 3                             | South       | M         | Fair                 | Poor                    | Deadwood in the crown of moderate extent. Branch dieback of major extent. Previous branch failures noted. In decline.                                                                       | 10-20                                    | C2                             |
| T514     | Quercus robur - Pedunculate Oak   | 10         | 5                | 6   | 7   | 7   | 630            | 1                | 3                             | SE          | M         | Fair                 | Fair                    | Previous branch failures noted. Lost leader in past.                                                                                                                                        | 20-40                                    | B2                             |
| T515     | Quercus robur - Pedunculate Oak   | 7          | 2.0              | 2.0 | 2.0 | 2.0 | 140            | 1                | 3.5                           | East        | Y         | Fair                 | Good                    | Restricted inspection due to vegetation.                                                                                                                                                    | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)  | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                  | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|-----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                 |                  |                               |             |           |                      |                         |                                                                                                                                                                                                     |                                          |                                |
| T516     | Fraxinus excelsior - Common Ash | 7          | 2.0              | 2.0 | 2.0 | 2.0 | 100, 70, 70, 70 | 4.00             | 2.5                           | West        | Y         | Poor                 | Good                    | Restricted inspection due to vegetation. General poor form to tree.                                                                                                                                 | 10-20                                    | C2                             |
| T517     | Quercus robur - Pedunculate Oak | 15         | 3                | 4   | 4   | 4   | 450             | 1                | 2.5                           | NW          | EM        | Good                 | Good                    | Epicormics growth on stem. Restricted inspection due to ivy. Ditch between tree and site.                                                                                                           | 40+                                      | A2                             |
| T518     | Quercus robur - Pedunculate Oak | 17         | 5                | 7   | 6   | 7   | 600             | 1                | 5                             | East        | M         | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy. Ditch between tree and site.                                                                                               | 40+                                      | A2                             |
| T519     | Quercus robur - Pedunculate Oak | 17         | 5.0              | 6.0 | 5.0 | 6.0 | 750             | 1                | 1.0                           | East        | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Crossing branches in crown. Fused limb/branches. Restricted inspection due to vegetation. General poor form to tree. Ditch between tree and site. Fine tree. | 40+                                      | A2                             |
| T520     | Fraxinus excelsior - Common Ash | 14         | 5.0              | 5.0 | 5.0 | 5.0 | 250, 20         | 2.00             | 3.0                           | East        | EM        | Fair                 | Good                    | Restricted inspection due to vegetation. General poor form to tree. Ditch between tree and site.                                                                                                    | 20-40                                    | B2                             |
| T521     | Quercus robur - Pedunculate Oak | 13         | 5.0              | 5.0 | 3.0 | 5.0 | 400             | 1                | 3.0                           | NW          | EM        | Fair                 | Fair                    | Pruning wounds to stem. Restricted inspection due to vegetation. Ditch between tree and site.                                                                                                       | 20-40                                    | A2                             |
| T522     | Quercus robur - Pedunculate Oak | 15         | 5.0              | 6   | 6   | 5.0 | 500             | 1                | 4                             | NW          | M         | Fair                 | Good                    | Pruning wounds to stem. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Ditch between tree and site.                                                                | 40+                                      | A2                             |
| T523     | Quercus robur - Pedunculate Oak | 15         | 5.0              | 5   | 6.0 | 4   | 480             | 1                | 2                             | SW          | EM        | Fair                 | Good                    | Pruning wounds to stem. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree. Ditch between tree and site.                                     | 20-40                                    | A2                             |
| T524     | Quercus robur - Pedunculate Oak | 15         | 6                | 6   | 5   | 6   | 500             | 1                | 3                             | NE          | EM        | Good                 | Good                    | Pruning wounds to stem. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Ditch between tree and site.                                                                | 40+                                      | A2                             |
| T525     | Quercus robur - Pedunculate Oak | 15         | 5                | 5   | 5.0 | 5   | 350, 30         | 2.00             | 1.5                           | West        | EM        | Fair                 | Good                    | Restricted inspection due to ivy and vegetation. General poor form to tree. Ditch between tree and site.                                                                                            | 40+                                      | B2                             |
| T526     | Fraxinus excelsior - Common Ash | 12         | 5                | 0   | 1   | 1   | 260             | 1                | 9                             | North       | SM        | Poor                 | Poor                    | The tree is leaning at a 10 degree angle in a North direction. Previous branch failures noted. Restricted inspection due to vegetation. General poor form to tree. Tree has no long term potential. | 10-20                                    | C2                             |
| T527     | Acer campestre - Field Maple    | 7          | 3                | 1   | 2   | 2   | 180             | 1                | 3                             | West        | SM        | Poor                 | Fair                    | Heavily suppressed crown. Restricted inspection due to vegetation.                                                                                                                                  | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                    | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                       |                                          |                                |
| T528     | Corylus avellana - Common Hazel | 7.0        | 3.0              | 3.0 | 5.5 | 1.5 | 40             | 15.00            | 2.0                           | East        | EM        | Fair                 | Good                    | Not plotted on land survey plan. Estimated location. Multi-stemmed at ground level. Multiple epicormic shoots from older stems. Previous stem failures. Limited amenity.                                                                                              | 20-40                                    | C2                             |
| T529     | Corylus avellana - Common Hazel | 9.0        | 3.0              | 1.5 | 6.5 | 0.0 | 75, 75, 75, 75 | 4.00             | 2.0                           | East        | SM        | Fair                 | Fair                    | Not plotted on land survey plan. Estimated location. X2 adjacent bifurcated stems, friction and fusion wood present. Ivy on stems. Crown slightly overhangs Road. Limited stature.                                                                                    | 10-20                                    | C2                             |
| T530     | Corylus avellana - Common Hazel | 8.0        | 1.5              | 3.5 | 5.0 | 1.0 | 50             | 9.00             | 1.5                           | East        | SM        | Fair                 | Fair                    | Not plotted on land survey plan. Estimated location. Ivy clad more mature stems, with epicormic growth. Crown overhangs fence. Limited stature.                                                                                                                       | 20-40                                    | C2                             |
| T531     | Fraxinus excelsior - Common Ash | 12.0       | 1.5              | 2   | 5   | 1   | 180            | 1                | 8                             | East        | SM        | Fair                 | Good                    | Not plotted on land survey plan. Estimated location. Narrow Crown form, stem offkilter. Lacks central leader. Limited stature.                                                                                                                                        | 20-40                                    | C2                             |
| T532     | Corylus avellana - Common Hazel | 10.0       | 3.5              | 2.5 | 5.0 | 4.0 | 100            | 10.00            | 0.0                           | South       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Estimated location. Multi-stemmed at ground level, internal Deadwood and previously failed stems. Ivy cloaked stems present. Crown overhangs Road. Limited stature.                                                                  | 20-40                                    | C2                             |
| T533     | Quercus robur - Pedunculate Oak | 18.0       | 6.0              | 2.0 | 6.5 | 0.0 | 290            | 1                | 9.0                           | North       | EM        | Fair                 | Fair                    | Upper stem offkilter, Crown is suppressed to the West with bias to the North East. Moderate sized Deadwood of moderate extent in the lower Crown. Ivy on mid stem.                                                                                                    | 20-40                                    | C2                             |
| T534     | Quercus robur - Pedunculate Oak | 20.0       | 8.0              | 2.0 | 7.0 | 3.0 | 480            | 1                | 10.0                          | North       | EM        | Fair                 | Good                    | Prominent roadside tree. Crown bias to North East. Moderate sized Deadwood of moderate extent in lower Crown, otherwise good vitality in upper Crown.                                                                                                                 | 40+                                      | B2                             |
| T535     | Quercus robur - Pedunculate Oak | 18.0       | 8.0              | 2.0 | 7.0 | 3.0 | 420            | 1                | 13                            | North       | EM        | Fair                 | Fair                    | Recommend ivy is severed.Heavily Ivy clad from lower stem to middle Crown. Moderate sized Deadwood of moderate extent in lower Crown. Crown suppressed to South and West. Ivy prevented detailed inspection.                                                          | 20-40                                    | C2                             |
| T536     | Quercus robur - Pedunculate Oak | 19.0       | 8.5              | 3.0 | 4.5 | 2.5 | 450            | 1                | 11                            | North       | EM        | Fair                 | Good                    | Recommend ivy is severed.Moderately Ivy clad from lower stem to middle Crown. Moderate sized Deadwood in lower Crown. Crown biased the North, with long extending limbs in lower Crown. Good vitality.consider reduction of long extending limbs.                     | 40+                                      | B2                             |
| T537     | Fraxinus excelsior - Common Ash | 19.0       | 7.5              | 4.5 | 4.0 | 1.0 | 190, 470       | 2.00             | 13                            | North       | SM        | Fair                 | Fair                    | Recommend ivy is severed.Bifurcates at ground level. Eastern stem is heavily forwards leaning with Crown overhanging Road. Heavily Ivy clad mid stem. Minor to moderate Deadwood in middle and lower Crown.consider Crown reduction of leaning stem overhanging Road. | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)          | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|-------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                         |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                  |                                          |                                |
| T538     | Acer campestre - Field Maple         | 9.5        | 4.5              | 4.5 | 4.0 | 4.5 | 220, 150, 80, 80, 100   | 5.00             | 1.5                           | South       | EM        | Fair                 | Good                    | Not plotted on land survey plan. Estimated location. Multiple stems at 1.5 m, union obscured by vegetation and fence. Included growth/fusion and friction wood likely. Crown overhangs Gateway. Good vitality, lacks central leader. Limited stature.                            | 20-40                                    | C2                             |
| T539     | Crataegus monogyna - Common Hawthorn | 7.5        | 5.0              | 3.5 | 1.0 | 4.5 | 80                      | 8.00             | 1.5                           | North       | EM        | Fair                 | Good                    | Dense Crown formed from multi-stems diverging at approximately 1 m. Friction wood present between stems. Some Ivy. Limited stature.                                                                                                                                              | 20-40                                    | C2                             |
| T540     | Crataegus monogyna - Common Hawthorn | 8.0        | 3.0              | 1.5 | 1.0 | 2.5 | 50                      | 7.00             | 1.5                           | North       | EM        | Fair                 | Good                    | Tree has no long term potential. Dense Crown formed of multiple adjacent stems. Heavily Ivy clad lower stems. Scrappy form. Limited amenity.                                                                                                                                     | 10-20                                    | C2                             |
| T541     | Prunus avium - Wild Cherry           | 6.0        | 1                | 1   | 0.5 | 2   | 140                     | 1                | 0.5                           | North       | OM        | Poor                 | Poor                    | Tree is in terminal decline. Stem failure likely.                                                                                                                                                                                                                                | <10                                      | U                              |
| T542     | Quercus robur - Pedunculate Oak      | 15.0       | 7.5              | 6   | 5.5 | 7   | 650                     | 1                | 0.5                           | East        | M         | Good                 | Good                    | Located at edge of the pond. Strong apical stem, which diverges into balanced decurrent crown form. Minor dieback and Deadwood in places, otherwise good vitality. Previous limb failures noted on Pond side, semi-occluded with epicormic regrowth.                             | 40+                                      | B1                             |
| T543     | Alnus glutinosa - Common Alder       | 15.0       | 5                | 7   | 3   | 3   | 250                     | 1                | 2                             | South       | EM        | Good                 | Good                    | Not plotted on land survey plan. Estimated location. Major limb diverges from stem at approximately 0.5 m, vertical growth is beginning to compete with leader. Strong apical growth in main leader. Other than diverging southern limb, balanced excurrent form. Good vitality. | 20-40                                    | C2                             |
| T544     | Salix chrysocoma - Goat Willow       | 16.0       | 7.0              | 7.0 | 7.5 | 6.0 | 650                     | 1                | 1.5                           | East        | OM        | Fair                 | Poor                    | Crown density and live buds much reduced, extensive, peripheral dieback. Tree appears to be in terminal decline. Restricted inspection due to dense brambles, stem diameter estimated.                                                                                           | <10                                      | U                              |
| T545     | Ulmus sp. - Elm                      | 11.0       | 3.5              | 2.0 | 3.0 | 1.5 | 150                     | 1                | 3.0                           | North       | SM        | Good                 | Fair                    | Stem offilter and Ivy clad. Likely limited useful lifetime expectancy due to Dutch elm disease.                                                                                                                                                                                  | 10-20                                    | C2                             |
| T546     | Salix chrysocoma - Goat Willow       | 14.0       | 5                | 8   | 7   | 7.5 | 500                     | 1                | 1                             | West        | M         | Fair                 | Good                    | Unable to access basal stem due to dense blackthorn hedge., Stem diameter estimated. Dense Crown, weeping form and good vitality. Trifurcates at approximately 2 m, no included growth noted and fairly balanced Crown form. Distinctive at field boundary                       | 20-40                                    | B2                             |
| T547     | Fraxinus excelsior - Common Ash      | 12.0       | 4.5              | 3.5 | 4   | 3   | 100, 120, 130, 120, 180 | 5.00             | 6                             | West        | SM        | Fair                 | Good                    | Multi-stemmed at ground level, unable to inspect basal stems, due to dense vegetation. Good Crown vitality, lacks central leader. Outgrown hedgerow tree. Limited stature.                                                                                                       | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)         | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                             | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                        |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                |                                          |                                |
| T548     | Fraxinus excelsior - Common Ash | 10.5       | 3                | 3.5 | 3   | 3.0 | 100, 150, 120          | 3.00             | 1.5                           | South       | SM        | Fair                 | Good                    | Multiple stems at 1.5 m, compression fork's present. Currently, limited Crown size. Dense Crown, good vitality. Limited stature.                                                                               | 20-40                                    | C2                             |
| T549     | Acer pseudoplatanus - Sycamore  | 12.0       | 3.0              | 2.5 | 3.0 | 2.5 | 130, 140               | 2.00             | 2                             | South       | SM        | Fair                 | Good                    | Crown bifurcates at less than 1.5 m, basal stem obscured by dense brambles, but included growth likely. Good vitality. Limited stature.                                                                        | 20-40                                    | C2                             |
| T550     | Acer pseudoplatanus - Sycamore  | 10.0       | 3.5              | 4   | 4   | 4   | 210, 170, 170          | 3.00             | 2                             | South       | SM        | Fair                 | Good                    | Multiple leaders in Crown, main stem diverges at approximately 0.5 (compression fork) and 1.5 m (reaction wood present at union). Good vitality. Limited stature.                                              | 20-40                                    | C2                             |
| T551     | Betula pendula - Silver Birch   | 10.5       | 5                | 0   | 2   | 2   | 160                    | 1                | 2                             | North       | SM        | Fair                 | Good                    | Stem offkilter, leaning less than 10° to the North. Crown biased the North. Good vitality, limited stature.                                                                                                    | 20-40                                    | C2                             |
| T552     | Quercus robur - Pedunculate Oak | 7.5        | 2.0              | 2.5 | 2.0 | 2.0 | 130                    | 1                | 1.5                           | SE          | SM        | Good                 | Good                    | Strong apical growth, if a little offkilter. Even Crown form. Future potential, but currently limited stature.                                                                                                 | 20-40                                    | C2                             |
| T553     | Acer pseudoplatanus - Sycamore  | 12.0       | 3                | 1   | 3.5 | 3.5 | 160, 170               | 2.00             | 2.5                           | South       | SM        | Fair                 | Good                    | Not plotted on land survey plan. Stem bifurcates at approximately 1 m, compression fork with redundant tree tie included in growth. Redundant stake becoming included at base. Good vitality. Limited stature. | 20-40                                    | C2                             |
| T554     | Fraxinus excelsior - Common Ash | 12.0       | 4.0              | 3.5 | 4.0 | 3.5 | 310                    | 1                | 2                             | West        | SM        | Fair                 | Good                    | Browsing damage (biotic) to basal stem, part occluded. Redundant stake becoming included at base. Crown lacks central leader, good vitality. Limited stature.                                                  | 20-40                                    | C2                             |
| T555     | Acer pseudoplatanus - Sycamore  | 11.0       | 4                | 3.5 | 4.5 | 3   | 150, 130, 190, 100, 90 | 5.00             | 2                             | SW          | SM        | Fair                 | Good                    | Multiple stems diverged at approximately 1 m, multiple compression forks, likely to become problematic in future. Crown lacks central leader. Good vitality. Limited stature.                                  | 20-40                                    | C2                             |
| T556     | Quercus robur - Pedunculate Oak | 11.0       | 1.5              | 1.5 | 4.5 | 0.5 | 160                    | 1                | 4                             | South       | SM        | Fair                 | Good                    | Suppressed Crown with bias to West. Redundant planting stake at base. Limited stature.remove redundant planting stake.                                                                                         | 20-40                                    | C2                             |
| T557     | Fagus sylvatica - Common Beech  | 11.0       | 1.5              | 3   | 1   | 1.5 | 130                    | 1                | 2                             | South       | SM        | Good                 | Good                    | Narrow Crowned, upright form. No significant defects noted. Limited stature.                                                                                                                                   | 20-40                                    | C2                             |
| T558     | Fagus sylvatica - Common Beech  | 11.0       | 3                | 1   | 2.5 | 2   | 140                    | 1                | 4                             | NW          | SM        | Fair                 | Good                    | Crown lacks central leader, lower Crown suppressed by adjacent building. Limited stature.                                                                                                                      | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                                                   |                                          |                                |
| T559     | Fagus sylvatica - Common Beech  | 12.0       | 1.5              | 3.5 | 2.5 | 3.0 | 190, 180       | 2.00             | 2.0                           | South       | SM        | Fair                 | Good                    | Bifurcates at approximately 1.5 m, tension fork with redundant tree tie included in growth. Good vitality, limited stature.                                                                                                                                                                       | 20-40                                    | C2                             |
| T560     | Fraxinus excelsior - Common Ash | 11.0       | 3                | 2   | 3.5 | 2   | 150            | 1.00             | 2                             | East        | SM        | Poor                 | Poor                    | Extensive basal bark delamination. Epicormic growth around based. Extensive peripheral Crown dieback. Limited useful lifetime expectancy.                                                                                                                                                         | <10                                      | U                              |
| T561     | Quercus robur - Pedunculate Oak | 18.0       | 6.5              | 8.0 | 6.0 | 5.0 | 1080           | 1                | 2.0                           | NE          | M         | Fair                 | Good                    | Strong lower trunk bifurcates into fairly balanced decurrent crown form with multiple leaders at approximately 5 m. Previously Crown reduced with aged epicormic regrowth at pruning wounds. Good vitality in Crown. Prominent tree in landscape.bark delamination and exposed sapwood on Eastern | 40+                                      | A2                             |
| T562     | Fraxinus excelsior - Common Ash | 11.0       | 3.5              | 4.0 | 2.5 | 3.0 | 210            | 1                | 2.0                           | North       | SM        | Good                 | Good                    | Hard surface located in RPA. No significant defects noted. Pruning wounds to lower stem/Crown, occluded with epicormic regrowth. Limited stature.                                                                                                                                                 | 20-40                                    | C2                             |
| T563     | Fraxinus excelsior - Common Ash | 11.0       | 3.0              | 4.0 | 4.0 | 2.0 | 240            | 1                | 0.0                           | North       | SM        | Good                 | Good                    | No significant defects noted. Redundant planting stake at base. Limited stature.remove redundant planting stake.                                                                                                                                                                                  | 20-40                                    | C2                             |
| T564     | Quercus robur - Pedunculate Oak | 10.0       | 3.5              | 3.5 | 4.0 | 3.5 | 220            | 1                | 1.5                           | West        | SM        | Good                 | Good                    | Hard surface located in RPA. Balanced Crown form with strong central leader. Good vitality. Minor previous limb failure in lower South West Crown. Future potential.                                                                                                                              | 40+                                      | C2                             |
| T565     | Fraxinus excelsior - Common Ash | 9.0        | 3.0              | 2.5 | 3.0 | 3.0 | 120            | 1                | 1.5                           | NW          | SM        | Fair                 | Good                    | Self sown tree, hard surfacing within RPA and debris littered around stem. Multiple stems at ground level, crossing limbs noted. Included branch the stem unions. Good vitality. Limited stature.                                                                                                 | 20-40                                    | C2                             |
| T566     | Quercus robur - Pedunculate Oak | 11.5       | 5                | 4   | 5   | 4   | 250            | 1                | 1                             | SW          | SM        | Good                 | Fair                    | Hard surfacing within RPA and debris littered around stem. Building to South conflicts with Crown spread. Pruning wounds to lower North Crown for easement of vehicles etc. Epicormic growth at pruning wounds and in Crown. Minor dieback in places.remove redundant planting stake.             | 20-40                                    | C2                             |
| T567     | Fraxinus excelsior - Common Ash | 10.5       | 3.5              | 2.5 | 2   | 1.5 | 200, 200       | 2                | 2.5                           | North       | SM        | Fair                 | Good                    | Restricted inspection due to access and ivy. Ivy cloaked lower stem. Bifurcates at less than 1.5 m, unable to inspect union. Bifurcated Crown, good vitality. To bree littered throughout RPA, compression within RPA.remove redundant planting stake.                                            | 20-40                                    | C2                             |
| T568     | Fraxinus excelsior - Common Ash | 16.0       | 6                | 6   | 5.5 | 7.5 | 300            | 1                | 0.0                           | North       | EM        | Fair                 | Good                    | Compaction around base of tree. Building/structure located in RPA. Debris lifted within RPA, Arctic lorry parked within RPA. Good Crown vitality. Unable to access basal stem to undertake detailed inspection, site line obscured. Stem diameter estimated.remove redundant planting stake.      | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                    | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                       |                                          |                                |
| T569     | Acer campestre - Field Maple    | 8          | 3                | 2   | 2   | 3   | 310            | 1                | 0.5                           | NW          | EM        | Fair                 | Good                    | Pruning wounds to crown. Restricted inspection due to ivy.                                                                                                            | 20-40                                    | B2                             |
| T570     | Fraxinus excelsior - Common Ash | 15         | 5                | 5   | 4   | 4   | 500            | 1                | 8                             | South       | EM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                                              | 20-40                                    | B2                             |
| T571     | Quercus robur - Pedunculate Oak | 13         | 8.0              | 7.0 | 5.0 | 7.0 | 500, 400       | 2.00             | 3.5                           | SW          | M         | Fair                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Hanging branches in the crown. Previous branch failures noted. Dual stems. Lost leader on south stem. | 40+                                      | A2                             |
| T572     | Quercus robur - Pedunculate Oak | 13         | 7                | 6.5 | 6   | 3   | 600            | 1.00             | 4                             | NW          | M         | Good                 | Good                    | Deadwood in the crown of minor extent.                                                                                                                                | 40+                                      | A2                             |
| T573     | Quercus robur - Pedunculate Oak | 11         | 6                | 6   | 2   | 5   | 320            | 1.00             | 3                             | SW          | SM        | Fair                 | Fair                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Previous branch failures noted.                                                                       | 20-40                                    | B2                             |
| T574     | Fraxinus excelsior - Common Ash | 12         | 7                | 2   | 4   | 6   | 300, 280       | 2.00             | 0.5                           | East        | M         | Fair                 | Fair                    | Pruning wounds to crown. Deadwood in the crown of minor extent.                                                                                                       | 20-40                                    | B2                             |
| T575     | Acer campestre - Field Maple    | 9          | 3                | 3   | 3   | 3   | 100            | 8.00             | 0.5                           | South       | EM        | Poor                 | Fair                    | Pruning wounds to crown. General poor form to tree.                                                                                                                   | 10-20                                    | C2                             |
| T576     | Quercus robur - Pedunculate Oak | 8          | 6                | 3   | 1   | 1   | 260            | 1.00             | 3                             | East        | SM        | Poor                 | Fair                    | Pruning wounds to crown. Heavily suppressed crown. Deadwood in the crown of minor extent. General poor form to tree.                                                  | 10-20                                    | C2                             |
| T577     | Acer campestre - Field Maple    | 11         | 3                | 2   | 3   | 1   | 10             | 6                | 3                             | SE          | EM        | Poor                 | Fair                    | Pruning wounds to crown. Deadwood in the crown of minor extent. General poor form to tree.                                                                            | 10-20                                    | C2                             |
| T578     | Quercus robur - Pedunculate Oak | 15         | 6                | 8   | 6   | 5   | 600            | 1.00             | 3                             | South       | M         | Fair                 | Good                    | Pruning wounds to crown. Previous branch failures noted. Restricted inspection due to ivy. Lateral suppression from adjacent tree.                                    | 20-40                                    | A2                             |
| T579     | Fraxinus excelsior - Common Ash | 15         | 6.0              | 4   | 1   | 4   | 320            | 1.00             | 3                             | SW          | EM        | Fair                 | Fair                    | Deadwood in the crown of minor extent. Lateral suppression from adjacent tree.                                                                                        | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T580     | Quercus robur - Pedunculate Oak      | 20         | 8                | 8   | 8   | 9   | 1100           | 1.00             | 2                             | SW          | Notable   | Poor                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation. Large wound on south side where natural brace has failed. Large hanging limb to south at 3m.                                                                               | 40+                                      | A3                             |
| T581     | Acer campestre - Field Maple         | 20         | 8.0              | 4   | 2   | 3   | 120            | 6                | 2                             | North       | EM        | Fair                 | Fair                    | Multi stemmed stem formed at 0.0 metres. Restricted inspection due to ivy and vegetation. General poor form to tree.                                                                                                                                               | 10-20                                    | B2                             |
| T582     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T583     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T584     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T585     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T586     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T587     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T588     | n/a                                  |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                                    |                                          |                                |
| T589     | Douglas Fir<br>Pseudotsuga menziesii | 17         | 3.0              | 3.0 | 4.0 | 3.0 | 350            | 1                | 8.0                           | East        | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy and vegetation.                                                                                                                                                                            | 40+                                      | A2                             |
| T590     | Larix decidua - European Larch       | 6          | 4                | 0   | 5   | 0   | 300            | 1                | 6.0                           | East        | EM        | Poor                 | Poor                    | The tree is leaning at a 20 degree angle in a NE direction. Heavily suppressed crown. Hanging branches in the crown. Previous branch failures noted. Restricted inspection due to ivy and vegetation. Tree has no long term potential. 0Recommend tree is removed. | <10                                      | U                              |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |   |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|---|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                   |                                          |                                |
| T591     | n/a                                   |            |                  |   |     |     |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                   |                                          |                                |
| T592     | Acer campestre - Field Maple          | 12         | 4                | 3 | 3   | 3   | 300            | 1                | 3.0                           | West        | EM        | Good                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to ivy and vegetation.                                                           | 20-40                                    | B2                             |
| T593     | Acer campestre - Field Maple          | 9          | 1                | 2 | 2   | 2   | 200            | 1                | 2                             | South       | SM        | Poor                 | Fair                    | Heavily suppressed crown. Restricted inspection due to vegetation. Growing out of ditch bank.                                                                                     | 10-20                                    | C2                             |
| T594     | Fraxinus excelsior - Common Ash       | 13         | 5                | 4 | 7   | 4   | 200            | 8.00             | 0.5                           | NW          | M         | Fair                 | Fair                    | Crossing branches in crown. Fused limb/branches.General poor form to tree. Multi stemmed specimen at 0.5m.                                                                        | 10-20                                    | C2                             |
| T595     | Fraxinus excelsior - Common Ash       | 13         | 4                | 5 | 7.0 | 3   | 380            | 1.00             | 2                             | East        | EM        | Fair                 | Good                    | Pruning wounds to crown.                                                                                                                                                          | 20-40                                    | B2                             |
| T596     | Fraxinus excelsior - Common Ash       | 15         | 6                | 7 | 10  | 4   | 300            | 7.00             | 2.5                           | North       | M         | Fair                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Large multi stemmed specimen. Eastern stem is suppressed by apically dominant stems and has overextended to east. | 20-40                                    | B2                             |
| T597     | Fraxinus excelsior - Common Ash       | 12         | 5                | 6 | 7   | 3   | 180            | 6                | 0.5                           | East        | EM        | Poor                 | Fair                    | major stem cavity. Deadwood in the crown of moderate extent. General poor form to tree.                                                                                           | 10-20                                    | C2                             |
| T598     | Crataegus monogyna - Common Hawthorn  | 8          | 3                | 3 | 3   | 3.0 | 180, 180, 180  | 3.00             | 2                             | SE          | M         | Fair                 | Good                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Crossing branches in crown. Previous branch failures noted.                                                       | 10-20                                    | C2                             |
| T599     | Crataegus monogyna - Common Hawthorn  | 12         | 4                | 4 | 4   | 3.0 | 340            | 1.00             | 2                             | SE          | EM        | Fair                 | Good                    | Epicormic growth on crown. Pruning wounds to crown.                                                                                                                               | 20-40                                    | B2                             |
| T600     | Ulmus sp. - Elm                       | 6          | 0.5              | 3 | 1.5 | 1   | 150            | 1                | 0.5                           | South       | SM        | Poor                 | Fair                    | Pruning wounds to crown. Heavily suppressed crown. Deadwood in the crown of minor extent. Tree has no long term potential. 0                                                      | <10                                      | U                              |
| T601     | Sorbus torminalis - Wild Service Tree | 10         | 4                | 3 | 3   | 3   | 330, 300, 300  | 3.00             | 3.5                           | North       | M         | Fair                 | Good                    | The tree has a moderate basal cavity. Restricted inspection due to ivy. Uncommon native tree.                                                                                     | 20-40                                    | B3                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                                                               |                                          |                                |
| T602     | Sorbus torminalis - Wild Service Tree | 14         | 6                | 5   | 7   | 7   | 550                | 1.00             | 5                             | East        | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                                                                                      | 40+                                      | A2                             |
| T603     | Sorbus torminalis - Wild Service Tree | 18         | 5                | 5.0 | 5   | 6   | 550                | 1                | 2                             | East        | M         | Poor                 | Good                    | Bifurcated stem formed at 1.5 metres. Deadwood in the crown of minor extent. General poor form to tree. Crown reduction recommended of 25 %. Severely included union at 1.5m with pronounced 'ears'.          | 10-20                                    | C2                             |
| T604     | Quercus robur - Pedunculate Oak       | 13         | 1                | 1   | 1.5 | 2   | 350                | 1                | 0.0                           | East        | EM        | Dead                 | Dead                    | Deadwood in the crown of moderate extent. Dead tree.                                                                                                                                                          | <10                                      | U                              |
| T605     | Salix caprea - Goat Willow            | 12         | 4                | 3   | 8   | 6   | 330, 310, 200, 180 | 4.00             | 2                             | NW          | M         | Poor                 | Good                    | Pruning wounds to crown. Decayed subsiding limb.                                                                                                                                                              | 10-20                                    | C2                             |
| T606     | Fraxinus excelsior - Common Ash       | 12         | 6                | 5   | 7   | 5   | 340, 340, 260      | 3.00             | 4                             | NW          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Growing off ditch bank.                                                                                                                                                | 20-40                                    | B2                             |
| T607     | Quercus robur - Pedunculate Oak       | 12         | 5.0              | 4.0 | 4.0 | 4.0 | 340                | 1                | 3.0                           | North       | SM        | Fair                 | Good                    | Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Growing off ditch bank.                                                                                                       | 40+                                      | B2                             |
| T608     | Acer campestre - Field Maple          | 8          | 1                | 2   | 2   | 1.5 | 250                | 1                | 0.5                           | West        | SM        | Good                 | Fair                    | Pruning wounds to crown. Restricted inspection due to vegetation. Growing off ditch bank.                                                                                                                     | 10-20                                    | C2                             |
| T609     | Acer campestre - Field Maple          | 8          | 2                | 1   | 1   | 1.5 | 200                | 1                | 3                             | SW          | SM        | Fair                 | Fair                    | The tree has a minor basal cavity. Pruning wounds to crown. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. Growing off ditch bank.                                           | 10-20                                    | C2                             |
| T610     | Acer campestre - Field Maple          | 10         | 3.0              | 1.5 | 3.0 | 2.5 | 200, 160           | 2.00             | 2.0                           | SE          | SM        | Poor                 | Good                    | Included main stem union. Deadwood in the crown of minor extent. Crossing branches in crown. Fused limb/branches. Restricted inspection due to vegetation. General poor form to tree. Growing off ditch bank. | 10-20                                    | C2                             |
| T611     | Crataegus monogyna - Common Hawthorn  | 9          | 4                | 2   | 3   | 1.5 | 250                | 1                | 2                             | North       | M         | Fair                 | Good                    | Pruning wounds to crown. Crossing branches in crown. Restricted inspection due to vegetation.                                                                                                                 | 10-20                                    | C2                             |
| T612     | Acer campestre - Field Maple          | 10         | 0.0              | 6.0 | 3.0 | 3.0 | 130                | 6                | 1.0                           | West        | EM        | Poor                 | Fair                    | Pruning wounds to crown. Deadwood in the crown of minor extent. Restricted inspection due to vegetation. General poor form to tree. Multi stemmed specimen.                                                   | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                 |                                          |                                |
| T613     | Quercus robur - Pedunculate Oak      | 16         | 4                | 6   | 5   | 7   | 600            | 1                | 3                             | SW          | M         | Fair                 | Good                    | Deadwood in the crown of minor extent. Previous branch failures noted. Restricted inspection due to ivy.                                                                                                                        | 40+                                      | A2                             |
| T614     | Fraxinus excelsior - Common Ash      | 16         | 5                | 5   | 5   | 6   | 600, 150       | 2.00             | 3                             | SE          | M         | Fair                 | Fair                    | Bifurcated stem formed at 3.0 metres. Deadwood in the crown of minor extent. Restricted inspection due to ivy.                                                                                                                  | 20-40                                    | B2                             |
| T615     | Quercus robur - Pedunculate Oak      | 11         | 3                | 3   | 3   | 3   | 600            | 1                | 3.0                           | East        | M         | Dead                 | Dead                    | Deadwood in the crown of major extent. Recommend crown is deadwooded. Dead oak. Reduce to safe proportions and retain remainder as habitat.                                                                                     | <10                                      | U                              |
| T616     | Fraxinus excelsior - Common Ash      | 16         | 5                | 2   | 4.5 | 2   | 200            | 1                | 6                             | North       | SM        | Good                 | Good                    | Young tree at woodland edge. Bifurcates at approximately 4 m. Limited stature.                                                                                                                                                  | 20-40                                    | C2                             |
| T617     | Fraxinus excelsior - Common Ash      | 21         | 6.0              | 5.0 | 7.0 | 5.5 | 230, 260       | 2.00             | 6.0                           | North       | SM        | Fair                 | Good                    | Bifurcates at ground level, compression fork with included growth. Crown bias to North. Young tree at woodland edge, group value as part of woodland but limited individual value.                                              | 20-40                                    | C2                             |
| T618     | Crataegus monogyna - Common Hawthorn | 16         | 3.0              | 2.0 | 2.0 | 2.0 | 220, 230, 180  | 3.00             | 2.5                           | North       | M         | Fair                 | Good                    | Situated at woodland edge. Multiple stems, arising from compression forks. Crown lacks central leader. Pruning wounds to lower North Crown. Deadwood in middle Crown. Limited stature.                                          | 20-40                                    | C2                             |
| T619     | Fraxinus excelsior - Common Ash      | 17         | 7.5              | 1.5 | 7.0 | 6.0 | 250, 120, 130  | 3.00             | 6.0                           | NE          | EM        | Fair                 | Good                    | Not plotted on land survey plan. Located at woodland edge. Main stem offkilter with Crown bias to North. Group value.                                                                                                           | 20-40                                    | C2                             |
| T620     | Fraxinus excelsior - Common Ash      | 23         | 5                | 7   | 7.0 | 7   | 300, 310, 320  | 3.00             | 6                             | North       | EM        | Fair                 | Good                    | Tree at woodland edge with prominent height. Trifurcates at ground level, limited inspection of basal unions due to access, but compensatory growth apparent between northern stems. Good Crown vitality, lacks central leader. | 40+                                      | B2                             |
| T621     | Fraxinus excelsior - Common Ash      | 18         | 5.0              | 2.0 | 5.0 | 6.0 | 280            | 1                | 5.0                           | NW          | SM        | Fair                 | Good                    | Young tree at woodland edge, one of the larger peripheral trees. Group value is higher than individual value.                                                                                                                   | 20-40                                    | C2                             |
| T622     | Fraxinus excelsior - Common Ash      | 18         | 4.5              | 4   | 2   | 5.5 | 240            | 1                | 8                             | NW          | SM        | Good                 | Good                    | Young tree at woodland edge. Stem slightly offkilter. Crown suppressed East. Good vitality. Group value higher than individual value.                                                                                           | 20-40                                    | C2                             |
| T623     | Salix cinerea - Grey Willow          | 18         | 7.0              | 0.0 | 6.0 | 2.5 | 220            | 1                | 2.5                           | North       | EM        | Poor                 | Good                    | Stem established within ditch. Offkilter with bias to North. Pruning wounds to lower stem. Previous limb failures noted, previously failed hazard beam noted on Eastern stem. Lower amenity tree at woodland edge.              | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                                                                                                                                 |                                          |                                |
| T624     | Fraxinus excelsior - Common Ash | 18         | 5.5              | 3.0 | 5.5 | 5.5 | 260                | 1                | 6.0                           | North       | SM        | Good                 | Good                    | Young tree established at woodland edge. Group value higher than individual value.                                                                                              | 20-40                                    | C2                             |
| T625     | Fraxinus excelsior - Common Ash | 16         | 7.0              | 3.0 | 5.0 | 4.0 | 240, 200           | 2.00             | 5.0                           | North       | SM        | Fair                 | Good                    | Young tree established at woodland edge. Bifurcates at 1.5 m, compression fork with compensatory growth at union. Minor Deadwood in Western Crown.                              | 20-40                                    | C2                             |
| T626     | Fraxinus excelsior - Common Ash | 16         | 5                | 4   | 2.5 | 5.5 | 250, 180           | 2.00             | 7                             | NW          | SM        | Fair                 | Good                    | Young tree established that woodland edge. Bifurcates at .5 m, compression fork. Multiple leaders in Crown. Minor Deadwood in lower Crown.                                      | 20-40                                    | C2                             |
| T627     | Fraxinus excelsior - Common Ash | 18         | 5.5              | 3.5 | 4.5 | 4   | 380                | 1                | 5                             | North       | EM        | Fair                 | Good                    | More mature tree at woodland edge. Basal stem slightly offkilter, corrected in Crown. Slight Crown bias to North, otherwise good form. Minor Deadwood in lower Crown.           | 20-40                                    | B2                             |
| T628     | Quercus robur - Pedunculate Oak | 18.5       | 6                | 2.5 | 6   | 6   | 300, 200, 130, 200 | 4.00             | 3                             | East        | EM        | Fair                 | Good                    | Multiple stems at ground level, no included growth unions noted. Good Crown vitality. Deadwood in lower South Crown. Lacks central leader. Moderate group and individual value. | 40+                                      | B2                             |
| T629     | Fraxinus excelsior - Common Ash | 18         | 5.0              | 4.0 | 4.5 | 4.5 | 210, 210, 110      | 3.00             | 3.0                           | East        | SM        | Fair                 | Good                    | Bifurcates at ground level, Crown lacks central leader. Major open basal wound with extensive internal decay. Failure of basal stem possible. Deadwood limbs in Crown.          | <10                                      | U                              |
| T630     | Fraxinus excelsior - Common Ash | 18         | 7.5              | 5.5 | 5.0 | 7.5 | 330, 180, 290      | 3.00             | 2.5                           | East        | EM        | Fair                 | Good                    | Tree at edge of woodland border. Bifurcates at ground level, included growth not noted. Crown lacks central leader. Good vitality. Pruning wounds to lower East. Crown.         | 20-40                                    | B2                             |
| T631     | Fraxinus excelsior - Common Ash | 10         | 5                | 1   | 5.5 | 4   | 100, 140           | 2.00             | 0.0                           | East        | SM        | Poor                 | Fair                    | Not plotted on land survey plan. Large open wound at basal stem. Extensive internal decay present. Basal stem fracture a possibility.                                           | <10                                      | U                              |
| T632     | Fraxinus excelsior - Common Ash | 13         | 2.0              | 2.0 | 3.0 | 1.0 | 370                | 1                | 9.0                           | East        | SM        | Poor                 | Fair                    | Not plotted on land survey plan. Recommend tree is removed. Longitudinal open wound from ground level to approximately 8 m. Extensive internal decay. Tree failure imminent.    | <10                                      | U                              |
| T633     | Populus alba - White Poplar     | 13         | 5.5              | 5   | 12  | 0   | 270, 300           | 2.00             | 3                             | East        | EM        | Poor                 | Fair                    | Recommend tree is removed. Tree is leaning heavily to the East, lever arms are not reduced. Uprooting likely.                                                                   | <10                                      | U                              |
| T634     | Taxus baccata - Common Yew      | 10         | 3.0              | 3.0 | 5.0 | 0.0 | 120, 120, 120, 120 | 4.00             | 1.0                           | South       | SM        | Fair                 | Good                    | Multiple stems at 1.5 m, compression forks with included growth. Crown lacks central leader. Pruning wounds to Eastern Crown. Limited stature.                                  | 40+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |      |      | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|------|------|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S    | W    |                    |                  |                               |             |           |                      |                         |                                                                                               |                                          |                                |
| T635     | Fraxinus excelsior - Common Ash | 10         | 3.0              | 3.0  | 2    | 4.5  | 170, 140, 120      | 3.00             | 2                             | West        | SM        | Fair                 | Poor                    | Extensive dieback in upper Crown. Likely limited useful lifetime expectancy. Limited amenity. | 10-20                                    | C2                             |
| T636     | Quercus robur - Pedunculate Oak | 15.0       | 0.0              | 9.0  | 9.0  | 4.0  | 500, 500, 200, 200 | 4.00             | 5.00                          | South       | EM        | Fair                 | Good                    | x4 stems, asymmetrical canopy due to suppression from north.                                  | 20-40                                    | B2                             |
| T637     | Fagus sylvatica - Common Beech  | 16.0       | 4.0              | 9.0  | 8.0  | 4.0  | 700                | 1.00             | 5.00                          | South       | EM        | Fair                 | Good                    | Asymmetrical canopy due to suppression from north. Large deadwood over road.                  | 20-40                                    | B2                             |
| T638     | Quercus robur - Pedunculate Oak | 15.0       | 5.0              | 4.0  | 4.0  | 3.0  | 400                | 1.00             | 5.00                          | West        | EM        | Good                 | Good                    | Growing adjacent neighbouring tree, drawn up form.                                            | 40+                                      | B2                             |
| T639     | Fagus sylvatica - Common Beech  | 20.0       | 10.0             | 10.0 | 10.0 | 10.0 | 100                | 1.00             | 5.00                          | North       | M         | Good                 | Good                    | Restricted inspection due to access. Well formed open canopy within woodland.                 | 40+                                      | A1                             |
| T640     | Quercus robur - Pedunculate Oak | 10.0       | 5.0              | 3.0  | 2.0  | 6.0  | 300                | 1.00             | 5.00                          | West        | WM        | Fair                 | Good                    | Edge of woodland tree growing towards west, stem damage on west side at 0.5-1.                | 40+                                      | C2                             |
| T641     | Quercus robur - Pedunculate Oak | 10.0       | 3.0              | 4.0  | 3.0  | 3.0  | 300                | 1.00             | 5.00                          | South       | SM        | Fair                 | Good                    | Understory tree, growing on other side of fence.                                              | 40+                                      | C2                             |
| T642     | Quercus robur - Pedunculate Oak | 15.0       | 6.0              | 6.0  | 6.0  | 6.0  | 800                | 1.00             | 10.00                         | East        | M         | Fair                 | Good                    | Well formed, major branch failure on west side at 2m with remaining large stump.              | 40+                                      | B2                             |
| T643     | Quercus robur - Pedunculate Oak | 15.0       | 5.0              | 6.0  | 2.0  | 7.0  | 500                | 1.00             | 10.00                         | West        | M         | Fair                 | Good                    | Recent stem damage on west side of stem at 2m, minor lvy growth.                              | 40+                                      | B2                             |
| T644     | Quercus robur - Pedunculate Oak | 15.0       | 1.0              | 1.0  | 1.0  | 1.0  | 400                | 1.00             | 10.00                         | West        | OM        | Dead                 | Dead                    | Dead tree.                                                                                    | <10                                      | U                              |
| T645     | Fagus sylvatica - Common Beech  | 15.0       | 3.0              | 5.0  | 4.0  | 4.0  | 200                | 1.00             | 5.00                          | South       | Y         | Dead                 | Dead                    | Well established young tree with good potential.                                              | 40+                                      | C1                             |
| T646     | Quercus robur - Pedunculate Oak | 20.0       | 8.0              | 5.0  | 5.0  | 4.0  | 700                | 1.00             | 5.00                          | West        | M         | Good                 | Good                    | Well formed large tree on junction corner, high landscape and arboricultural value.           | 40+                                      | A1                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |      |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|------|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S    | W    |                |                  |                               |             |           |                      |                         |                                                                                                               |                                          |                                |
| T647     | Fagus sylvatica - Common Beech  | 15.0       | 4.0              | 3.0  | 3.0  | 3.0  | 200            | 1.00             | 4.00                          | North       | Y         | Good                 | Good                    | Well established young tree.                                                                                  | 40+                                      | C1                             |
| T648     | Quercus robur - Pedunculate Oak | 20.0       | 7.0              | 5.0  | 5.0  | 6.0  | 500            | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Good specimen on edge of woodland, growing on top of bank.                                                    | 40+                                      | B1                             |
| T649     | Quercus robur - Pedunculate Oak | 20.0       | 3.0              | 6.0  | 6.0  | 6.0  | 600            | 1.00             | 10.00                         | West        | M         | Good                 | Good                    | Restricted inspection due to access. Woodland specimen behind fence line.                                     | 40+                                      | B1                             |
| T650     | Fagus sylvatica - Common Beech  | 15.0       | 3.0              | 3.0  | 3.0  | 3.0  | 600            | 1.00             | 10.00                         | North       | Y         | Good                 | Good                    | Ivy growth, well established young tree.                                                                      | 40+                                      | C1                             |
| T651     | Fagus sylvatica - Common Beech  | 15.0       | 5.0              | 3.0  | 3.0  | 3.0  | 300            | 1.00             | 10.00                         | North       | SM        | Good                 | Good                    | Situated road side of fence, well established young tree.                                                     | 40+                                      | C1                             |
| T652     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 5.0  | 5.0  | 4.0  | 1000           | 1.00             | 17.00                         | East        | EM        | Fair                 | Fair                    | Large historic wound, heartwood exposed on north side from 0.5-4m, 0.6 wide, good reaction growth.            | 40+                                      | C1                             |
| T653     | Quercus robur - Pedunculate Oak | 20.0       | 6.0              | 9.0  | 7.0  | 9.0  | 900            | 1.00             | 10.00                         | West        | M         | Good                 | Good                    | Situated on other side of fence, asymmetric form as growing adjacent other large canopied tree to the east.   | 40+                                      | B1                             |
| T654     | Quercus robur - Pedunculate Oak | 20.0       | 12.0             | 12.0 | 12.0 | 12.0 | 1000           | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Fine specimen, well formed, spreading canopy.                                                                 | 40+                                      | A1                             |
| T655     | Quercus robur - Pedunculate Oak | 20.0       | 5.0              | 5.0  | 5.0  | 5.0  | 400            | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Good specimen growing between two large open grown trees.                                                     | 40+                                      | C1                             |
| T656     | Quercus robur - Pedunculate Oak | 20.0       | 9.0              | 9.0  | 9.0  | 9.0  | 900            | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Good specimen, open spreading canopy, twin stem at 5m, recent pruning wounds from crown lifting over highway. | 40+                                      | A2                             |
| T657     | Fagus sylvatica - Common Beech  | 20.0       | 8.0              | 6.0  | 6.0  | 6.0  | 500            | 1.00             | 7.00                          | North       | M         | Good                 | Good                    | Good specimen growing between trees, drawn up habit.                                                          | 40+                                      | B1                             |
| T658     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 500            | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Good specimen growing between trees, drawn up habit.                                                          | 40+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                              | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                      |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                            |                                          |                                |
| T659     | Quercus robur - Pedunculate Oak      | 20.0       | 5.0              | 5.0 | 7.0 | 4.0 | 600            | 1.00             | 10.00                         | North       | M         | Good                 | Good                    | Heavily Ivy clad, good specimen.                                                                                                                                                                           | 40+                                      | B1                             |
| T660     | Quercus robur - Pedunculate Oak      | 20.0       | 6.0              | 0.0 | 2.0 | 2.0 | 500            | 1.00             | 10.00                         | North       | M         | Poor                 | Good                    | Heavily Ivy clad, significant lean over private property to north.                                                                                                                                         | 20-40                                    | C1                             |
| T661     | Quercus robur - Pedunculate Oak      | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 10.00                         | North       | M         | Fair                 | Fair                    | Heavily ivy clad, etiolated form.                                                                                                                                                                          | 20-40                                    | C1                             |
| T662     | Crataegus monogyna - Common Hawthorn | 5.0        | 0.0              | 0.0 | 6.0 | 0.0 | 200            | 1.00             | 5.00                          | East        | M         | Dead                 | Dead                    | Recommend tree is removed - dead, heavy lean over road. Remove foreseeable obstruction to the highway.                                                                                                     | 20-40                                    | U                              |
| T663     | Crataegus monogyna - Common Hawthorn | 5.0        | 7.0              | 6.0 | 4.0 | 6.0 | 600            | 1.00             | 5.00                          | South       | M         | Good                 | Good                    | Heavy Ivy growth, lean over private garden.                                                                                                                                                                | 40+                                      | B1                             |
| T664     | Quercus robur - Pedunculate Oak      | 20.0       | 6.0              | 6.0 | 6.0 | 6.0 | 500            | 1.00             | 6.00                          | South       | M         | Poor                 | Poor                    | Recommend tree is removed. Growing on other side of ditch, restricted rooting zone due to footway reinforcements.                                                                                          | <10                                      | U                              |
| T665     | Quercus robur - Pedunculate Oak      | 20.0       | 3.0              | 4.0 | 1.0 | 2.0 | 300            | 1.00             | 10.00                         | South       | EM        | Fair                 | Good                    | Growing on other side of ditch, restricted rooting zone due to footway reinforcements, etiolated drawn up habit.                                                                                           | 40+                                      | C2                             |
| T666     | Quercus robur - Pedunculate Oak      | 15.0       | 5.0              | 3.0 | 4.0 | 5.0 | 300            | 1.00             | 3.00                          | North       | EM        | Good                 | Good                    | Restricted inspection due to access. Growing on other side of ditch, restricted rooting zone due to footway reinforcements, in private garden behind close board fence, heavy lean towards north.          | 20-40                                    | C2                             |
| T667     | Quercus robur - Pedunculate Oak      | 15.0       | 5.0              | 5.0 | 3.0 | 5.0 | 500            | 1.00             | 10.00                         | South       | EM        | Good                 | Good                    | Good specimen, asymmetric canopy from east side, growing on other side of ditch, restricted root zone due to footway reinforcements.                                                                       | 40+                                      | B2                             |
| T668     | Quercus robur - Pedunculate Oak      | 10.0       | 4.0              | 4.0 | 4.0 | 4.0 | 500            | 1.00             | 5.00                          | South       | OM        | Dead                 | Dead                    | Dead tree, remove.                                                                                                                                                                                         | <10                                      | U                              |
| T669     | Quercus robur - Pedunculate Oak      | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 5.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                            |                                          |                                |
| T670     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T671     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T672     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T673     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T674     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T675     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T676     | Quercus robur - Pedunculate Oak | 15.0       | 3.0              | 3.0 | 3.0 | 3.0 | 400            | 1.00             | 0.00                          | West        | SM        | Good                 | Good                    | Group of 8 individual stems in good health with significant landscape value on corner of junction, one Norway Maple within group, all growing on other side to ditch - associated restricted rooting zone. | 40+                                      | B2                             |
| T677     | Fraxinus excelsior - Common Ash | 20.0       | 9.0              | 9.0 | 9.0 | 9.0 | 500            | 1.00             | 10.00                         | West        | M         | Good                 | Fair                    | Large off site tree, unable to access stem.                                                                                                                                                                | 10-20                                    | C2                             |
| T678     | Fraxinus excelsior - Common Ash | 10.0       | 0.0              | 6.0 | 0.0 | 0.0 | 200            | 1.00             | 10.00                         | South       | SM        | Poor                 | Good                    | Heavy lean over road. Remove.                                                                                                                                                                              | 10-20                                    | U                              |
| T679     | Quercus robur - Pedunculate Oak | 10.0       | 1.0              | 1.0 | 1.0 | 1.0 | 300            | 1.00             | 0.00                          | South       | SM        | Dead                 | Dead                    | Dead. Remove.                                                                                                                                                                                              | <10                                      | U                              |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |      |      |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|------|------|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E    | S    | W    |                |                  |                               |             |           |                      |                         |                                                                                                                          |                                          |                                |
| T680     | Quercus robur - Pedunculate Oak | 10.0       | 4.0              | 3.0  | 4.0  | 4.0  | 400            | 1.00             | 2.00                          | West        | SM        | Good                 | Good                    | Well established tree, good potential for further growth.                                                                | 40+                                      | C1                             |
| T681     | Quercus robur - Pedunculate Oak | 5.0        | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 1.00                          | West        | SM        | Good                 | Good                    | Off site on other side of ditch and boundary line.                                                                       | 40+                                      | B2                             |
| T682     | Quercus robur - Pedunculate Oak | 10.0       | 6.0              | 6.0  | 6.0  | 6.0  | 500            | 1.00             | 5.00                          | North       | M         | Fair                 | Poor                    | Off site on other side of ditch and boundary line, sparse canopy, significant dieback.                                   | 10-20                                    | C2                             |
| T683     | Quercus robur - Pedunculate Oak | 15.0       | 10.0             | 10.0 | 10.0 | 10.0 | 1000           | 1.00             | 3.00                          | North       | M         | Good                 | Fair                    | Growing on other side of ditch, Ivy growth throughout, wide spreading form, good specimen.                               | 40+                                      | C2                             |
| T684     | Quercus robur - Pedunculate Oak | 15.0       | 5.0              | 8.0  | 8.0  | 3.0  | 1000           | 1.00             | 5.00                          | East        | M         | Good                 | Poor                    | Good specimen, some large deadwood over road, established Ivy growth.                                                    | 40+                                      | B1                             |
| T685     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 5.00                          | North       | EM        | Good                 | Good                    | Not plotted on land survey plan. 5 individual trees forming group, good amenity benefit.                                 | 40+                                      | C2                             |
| T686     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 0.00                          | North       | EM        | Good                 | Good                    | 5 individual trees forming group, good amenity benefit.                                                                  | 40+                                      | C2                             |
| T687     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 0.00                          | North       | EM        | Good                 | Good                    | 5 individual trees forming group, good amenity benefit.                                                                  | 40+                                      | C2                             |
| T688     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 0.00                          | North       | EM        | Good                 | Good                    | 5 individual trees forming group, good amenity benefit.                                                                  | 40+                                      | C2                             |
| T689     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 0.00                          | North       | EM        | Good                 | Good                    | 5 individual trees forming group, good amenity benefit.                                                                  | 40+                                      | C2                             |
| T690     | Quercus robur - Pedunculate Oak | 15.0       | 4.0              | 4.0  | 4.0  | 4.0  | 300            | 1.00             | 5.00                          | North       | SM        | Good                 | Fair                    | Individual Ash, sparse canopy.                                                                                           | 10-20                                    | C2                             |
| T691     | Quercus robur - Pedunculate Oak | 10.0       | 4.0              | 3.0  | 4.0  | 2.0  | 900            | 1.00             | 3.00                          | North       | OM        | Fair                 | Poor                    | Stag headed Oak with some regrowth on northern side, remaining stem is dead, retain if possible for ecological benefits. | 10-20                                    | C3                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                         | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                 |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                  |                                          |                                |
| T692     | Fraxinus excelsior - Common Ash | 15.0       | 4.0              | 5.0 | 4.0 | 5.0 | 500            | 1.00             | 4.00                          | West        | M         | Good                 | Poor                    | Ash growing in close proximity to Oak forming one canopy together, slight lean to west, dense undergrowth of shrubby Field Maple.                                                | 40+                                      | B1                             |
| T693     | Quercus robur - Pedunculate Oak | 15.0       | 8.0              | 7.0 | 7.0 | 7.0 | 600            | 1.00             | 10.00                         | West        | M         | Good                 | Good                    | Oak growing in close proximity to Ash forming one canopy together, slight lean to north, dense undergrowth of shrubby Field maple. Stem damage from high vehicles on stem at 4m. | 40+                                      | C1                             |
| T694     | Quercus robur - Pedunculate Oak | 10.0       | 3.0              | 3.0 | 3.0 | 3.0 | 300            | 1.00             | 2.00                          | North       | EM        | Fair                 | Fair                    | Squat habit, historic hedge grown habit.                                                                                                                                         | 40+                                      | C1                             |
| T695     | Quercus robur - Pedunculate Oak | 10.0       | 1.0              | 5.0 | 2.0 | 4.0 | 500            | 1.00             | 3.00                          | South       | EM        | Fair                 | Fair                    | One sided canopy, Ivy growth.                                                                                                                                                    | 40+                                      | C1                             |
| T696     | Quercus robur - Pedunculate Oak | 10.0       | 2.0              | 4.0 | 4.0 | 1.0 | 500            | 1.00             | 5.00                          | South       | EM        | Fair                 | Fair                    | Poorly formed canopy, low amenity value, Ivy growth.                                                                                                                             | 10-20                                    | C1                             |
| T697     | Quercus robur - Pedunculate Oak | 10.0       | 2.0              | 4.0 | 2.0 | 2.0 | 500            | 1.00             | 0.00                          | South       | EM        | Poor                 | Fair                    | Heavy Ivy growth, poor form, limited useful life expectancy. Remove.                                                                                                             | 10-20                                    | U                              |
| T698     | Quercus robur - Pedunculate Oak | 10.0       | 6.0              | 6.0 | 4.0 | 5.0 | 500            | 1.00             | 5.00                          | North       | EM        | Fair                 | Good                    | Growing adjacent tree, asymmetrical form, Ivy growth.                                                                                                                            | 40+                                      | B2                             |
| T699     | Quercus robur - Pedunculate Oak | 10.0       | 6.0              | 6.0 | 6.0 | 2.0 | 700            | 1.00             | 5.00                          | North       | EM        | Good                 | Good                    | Growing on end of group, asymmetrical form, Ivy growth.                                                                                                                          | 40+                                      | B2                             |
| T700     | Quercus robur - Pedunculate Oak | 10.0       | 4.0              | 4.0 | 4.0 | 4.0 | 400            | 1.00             | 5.00                          | South       | EM        | Good                 | Fair                    | Private tree, sparse canopy, other side of 1m deep ditch.                                                                                                                        | 40+                                      | C2                             |
| T701     | Fraxinus excelsior Common Ash   | 12.0       | 5.0              | 5.0 | 7.0 | 6.0 | 430            | 1.00             | 3.50                          | South       | M         | Fair                 | Fair                    | Ash which bifurcates at 2m. Deadwood, ivy and fungi present.                                                                                                                     | 20-30                                    | B2                             |
| T702     | Fraxinus excelsior Common Ash   | 12.0       | 6.0              | 6.0 | 7.0 | 6.0 | 450            | 1.00             | 7.00                          | South       | M         | Fair                 | Fair                    | Ash with some ivy and fungi.                                                                                                                                                     | 40+                                      | B2                             |
| T703     | Fraxinus excelsior Common Ash   | 10.0       | 4.0              | 3.0 | 4.0 | 4.0 | 350            | 1.00             | 3.00                          | West        | SM        | Good                 | Good                    | Attractive Oak which bifurcates at 2.5m. Fungi present.                                                                                                                          | 20+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)     | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|--------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                    |                  |                               |             |           |                      |                         |                                                                   |                                          |                                |
| T704     | Acer campestre<br>Field Maple         | 12.0       | 7.0              | 6.0 | 6.0 | 7.0 | 900                | 1.00             | 2.50                          | West        | M         | Fair                 | Fair                    | Tree which bifurcates at 2m. Stem occlusions. Large basal cavity. | 20-30                                    | A2                             |
| T705 *   | Corylus avellana<br>Common Hazel      | 6.0        | 2.0              | 2.0 | 2.0 | 2.0 | 140                | 1.0              | 1.0                           | East        | Y         | Good                 | Good                    | Young tree in brambles.                                           | 10+                                      | C2                             |
| T706     | Unidentifiable                        | 10.0       | 4.0              | 2.0 | 3.0 | 3.0 | 300                | 1.00             | 2.50                          | North       | SM        | Poor                 | Good                    | Dead. Remove.                                                     | <10                                      | U                              |
| T707     | Acer campestre<br>Field Maple         | 10.0       | 7.0              | 6.0 | 6.0 | 7.0 | 380 x 2            | 2.00             | 2.50                          | North       | EM        | Fair                 | Fair                    | Tree with north-westerly bias. Deadwood and fungi present.        | 40+                                      | B2                             |
| T708     | Fraxinus excelsior<br>Common Ash      | 12.0       | 7.0              | 4.0 | 3.0 | 3.0 | 150 x 2<br>350 x 3 | 5.00             | 2.00                          | North       | M         | Fair                 | Fair                    | Ash with stem cavity. Deadwood and fungi present.                 | 20-30                                    | B2                             |
| T709     | Crataegus monogyna<br>Common Hawthorn | 10.0       | 3.0              | 3.0 | 4.0 | 3.0 | 250 x 4            | 4.00             | 2.00                          | North       | EM        | Good                 | Good                    | Tree with ivy.                                                    | 20+                                      | C2                             |
| T710     | Quercus robur<br>Pedunculate Oak      | 12.0       | 6.0              | 5.0 | 7.0 | 6.0 | 150 x 2,<br>500    | 3.00             | 3.00                          | North       | EM        | Good                 | Good                    | Attractive Oak with deadwood. Lots of ivy present.                | 40+                                      | B2                             |
| T711     | Acer campestre<br>Field Maple         | 11.0       | 5.0              | 5.0 | 5.0 | 5.0 | 400 x 2            | 2.00             | 1.50                          | North       | EM        | Good                 | Good                    | Tree which bifurcates at 0.5m.                                    | 40+                                      | B2                             |
| T712     | Fraxinus excelsior<br>Common Ash      | 12.0       | 3.0              | 3.0 | 5.0 | 6.0 | 300                | 1.00             | 5.00                          | West        | EM        | Good                 | Good                    | Tree with fungi.                                                  | 40+                                      | B2                             |
| T713     | Acer campestre<br>Field Maple         | 12.0       | 4.0              | 4.0 | 4.0 | 4.0 | 480                | 1.00             | 2.50                          | East        | EM        | Good                 | Good                    | Tree with some deadwood. Fungi present.                           | 40+                                      | B2                             |
| T714     | Fraxinus excelsior<br>Common Ash      | 12.0       | 3.0              | 5.0 | 3.0 | 4.0 | 300                | 1.00             | 8.00                          | North       | SM        | Good                 | Good                    | Tall Ash.                                                         | 20+                                      | B2                             |
| T715     | Crataegus monogyna<br>Common Hawthorn | 11.0       | 3.0              | 3.0 | 3.0 | 3.0 | 150,<br>300 x 2    | 3.00             | 1.00                          | West        | SM        | Good                 | Good                    | Tree with lots of ivy.                                            | 20+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)         | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                           | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                        |                  |                               |             |           |                      |                         |                                                                              |                                          |                                |
| T716     | Acer campestre<br>Field Maple         | 12.0       | 8.0              | 6.0 | 6.0 | 8.0 | 100, 450, 500          | 3.00             | 2.00                          | West        | M         | Good                 | Good                    | Prominent attractive tree with 3 stems. Lots of ivy, fungi.                  | 40+                                      | A2                             |
| T717     | Quercus robur<br>Pedunculate Oak      | 10.0       | 3.0              | 3.0 | 3.0 | 5.0 | 300                    | 1.00             | 3.00                          | West        | SM        | Good                 | Good                    | Tree with lots of ivy.                                                       | 20+                                      | B2                             |
| T718     | Fraxinus excelsior<br>Common Ash      | 10.0       | 3.0              | 5.0 | 5.0 | 3.0 | 280, 350               | 2.00             | 2.00                          | East        | SM        | Fair                 | Fair                    | Twin stemmed tree with basal cavity and fungi.                               | 20+                                      | B2                             |
| T719     | Fraxinus excelsior<br>Common Ash      | 12.0       | 4.0              | 5.0 | 4.0 | 4.0 | 300, 400               | 2.00             | 4.00                          | East        | EM        | Good                 | Good                    | Twin stemmed Ash.                                                            | 40+                                      | B2                             |
| T720     | Fraxinus excelsior<br>Common Ash      | 13.0       | 3.0              | 5.0 | 4.0 | 6.0 | 360                    | 1.00             | 3.00                          | East        | EM        | Good                 | Good                    | Ash which bifurcates at 4m.                                                  | 40+                                      | B2                             |
| T721     | Corylus avellana<br>Common Hazel      | 10.0       | 4.0              | 4.0 | 4.0 | 4.0 | 300                    | 1.00             | 2.00                          | North       | SM        | Good                 | Good                    | Hazel with fungi.                                                            | 20+                                      | B2                             |
| T722     | Corylus avellana<br>Common Hazel      | 12.0       | 4.0              | 4.0 | 4.0 | 4.0 | 350                    | 1.00             | 1.00                          | East        | EM        | Good                 | Good                    | Attractive tree with ivy.                                                    | 40+                                      | B2                             |
| T723     | Fraxinus excelsior<br>Common Ash      | 12.0       | 7.0              | 6.0 | 6.0 | 6.0 | 850                    | 1.00             | 3.00                          | South       | M         | Good                 | Good                    | Attractive tree with deadwood and fungi.                                     | 40+                                      | A2                             |
| T724     | Fraxinus excelsior<br>Common Ash      | 12.0       | 7.0              | 7.0 | 7.0 | 7.0 | 120, 150, 250, 400 x 4 | 7.00             | 0.50                          | South       | M         | Fair                 | Fair                    | Prominent multi-stemmed tree with stem cavity and occlusions. Fungi present. | 40+                                      | A2                             |
| T725     | Crataegus monogyna<br>Common Hawthorn | 8.0        | 3.0              | 3.0 | 3.0 | 3.0 | 100 x2, 250 x 2        | 4.00             | 2.00                          | North       | SM        | Good                 | Good                    | Hawthorn on edge of group.                                                   | 20+                                      | C2                             |
| T726     | Acer campestre<br>Field Maple         | 7.0        | 3.0              | 1.0 | 2.0 | 2.0 | 150                    | 1.00             | 0.50                          | North       | Y         | Good                 | Good                    | Young tree.                                                                  | 10+                                      | C2                             |
| T727     | n/a                                   |            |                  |     |     |     |                        |                  |                               |             |           |                      |                         |                                                                              |                                          |                                |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T728     | Crataegus monogyna<br>Common Hawthorn | 6.0        | 2.0              | 2.0 | 2.0 | 2.0 | 120, 130       | 2.00             | 0.50                          | West        | Y         | Good                 | Good                    | Young tree with ivy.                               | 10+                                      | C2                             |
| T729 *   | Crataegus monogyna<br>Common Hawthorn | 8.0        | 3.0              | 2.0 | 2.0 | 2.0 | 200            | 1.00             | 1.50                          | North       | SM        | Good                 | Good                    | Hawthorn with northerly bias.                      | 20+                                      | C2                             |
| T730     | Corylus avellana<br>Common Hazel      | 9.0        | 2.0              | 2.0 | 2.0 | 2.0 | 160            | 1.00             | 1.00                          | West        | Y         | Good                 | Good                    | Young Hazel with fungi.                            | 20+                                      | C2                             |
| T731 *   | Corylus avellana<br>Common Hazel      | 11.0       | 2.0              | 2.0 | 2.0 | 2.0 | 200            | 1.00             | 9.00                          | North       | SM        | Good                 | Good                    | Tall Hazel with fungi.                             | 20+                                      | C2                             |
| T732     | Corylus avellana<br>Common Hazel      | 9.0        | 3.0              | 2.0 | 3.0 | 2.0 | 180            | 1.00             | 5.00                          | North       | SM        | Good                 | Good                    | Hazel with fungi.                                  | 20+                                      | C2                             |
| T733     | Corylus avellana<br>Common Hazel      | 2.0        | -                | -   | -   | -   | 200            | 1.00             | 1.00                          | West        | SM        | Poor                 | Poor                    | Dead tree, falling west.                           | <10                                      | U                              |
| T734     | n/a                                   |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                    |                                          | C2                             |
| T735     | n/a                                   |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                    |                                          | B2                             |
| T736     | n/a                                   |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                    |                                          | B2                             |
| T737     | n/a                                   |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                    |                                          | B2                             |
| T738     | Corylus avellana<br>Common Hazel      | 8.0        | 2.0              | 2.0 | 3.5 | 2.0 | 200            | 1.00             | 2.00                          | South       | SM        | Good                 | Good                    | Hazel with southerly bias. Fungi present.          | 20+                                      | C2                             |
| T739     | n/a                                   |            |                  |     |     |     |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)              | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|-----------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T740     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T741     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T742     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T743     | Crataegus monogyna<br>Common Hawthorn | 6.0        | 2.0              | 2.0 | 2.0 | 3.0 | 200                         | 1.00             | 0.50                          | West        | SM        | Fair                 | Fair                    | Hawthorn with deadwood.                            | 10+                                      | C2                             |
| T744     | Acer campestre<br>Field Maple         | 13.0       | 7.0              | 7.0 | 7.0 | 7.0 | 160,<br>250,<br>300,<br>600 | 5.00             | 0.50                          | West        | M         | Fair                 | Fair                    | Prominent tree with deadwood. Fungi present.       | 40+                                      | A2                             |
| T745     | Corylus avellana<br>Common Hazel      | 6.0        | 2.0              | 3.0 | 1.0 | 1.0 | 200                         | 1.00             | 0.50                          | East        | SM        | Fair                 | Fair                    | Hazel leaning eastwards. Fung present.             | 20+                                      | C2                             |
| T746     | Corylus avellana<br>Common Hazel      | 6.0        | 1.0              | 2.0 | 1.0 | 1.0 | 200                         | 1.00             | 0.50                          | East        | SM        | Fair                 | Fair                    | Hazel with deadwood. Fungi present.                | 20+                                      | C2                             |
| T747     | Corylus avellana<br>Common Hazel      | 8.0        | 2.0              | 2.0 | 2.0 | 2.0 | 200                         | 1.00             | 2.00                          | North       | SM        | Fair                 | Fair                    | Deadwood.                                          | 20+                                      | C2                             |
| T748     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T749     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T750     | n/a                                   |            |                  |     |     |     |                             |                  |                               |             |           |                      |                         |                                                    |                                          |                                |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no.  | Species                          | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)                      | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|-----------|----------------------------------|------------|------------------|-----|-----|-----|-------------------------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|           |                                  |            | N                | E   | S   | W   |                                     |                  |                               |             |           |                      |                         |                                                                                   |                                          |                                |
| T751      | Acer campestre<br>Field Maple    | 10.0       | -                | -   | -   | -   | 800                                 | -                | 0.25                          | North       | SM        | Poor                 | Poor                    | Dead tree leaning to the north-east.                                              | <10                                      | U                              |
| T752      | Fraxinus excelsior<br>Common Ash | 12.0       | 3.0              | 3.0 | 5.0 | 6.0 | 350,<br>450 x 2                     | 3.0              | 10.00                         | West        | M         | Good                 | Good                    | Ash with fungi.                                                                   | 40+                                      | B2                             |
| T753      | Fraxinus excelsior<br>Common Ash | 13.0       | 4.0              | 4.0 | 4.0 | 4.0 | 400                                 | 1.00             | 8.00                          | East        | M         | Good                 | Good                    | Tall tree with fungi.                                                             | 40+                                      | B2                             |
| T754      | Corylus avellana<br>Common Hazel | 12.0       | 5.0              | 3.0 | 3.0 | 4.0 | 240,<br>270                         | 2.00             | 6.00                          | North       | M         | Good                 | Good                    | Twin stemmed tree with fungi.                                                     | 40+                                      | B2                             |
| T755      | Fraxinus excelsior<br>Common Ash | 13.0       | 7.0              | 7.0 | 5.0 | 5.0 | 150,<br>300 x 3,<br>350 x 2         | 6.00             | 2.00                          | East        | M         | Fair                 | Fair                    | Ash with stem cavity. Deadwood and fungi present.                                 | 20-30                                    | B2                             |
| T756      | Acer campestre<br>Field Maple    | 12.0       | 3.0              | 3.0 | 3.0 | 3.0 | 250,<br>350                         | 2.00             | 2.00                          | East        | M         | Poor                 | Fair                    | Tree which leans towards the east. Fungi present. Lots of ivy-limited inspection. | 40+                                      | B2                             |
| T757      | Acer campestre<br>Field Maple    | 2.0        | -                | -   | -   | -   | 350                                 | 1.00             | -                             | -           | EM        | Poor                 | Poor                    | Dead. Remove.                                                                     | <10                                      | U                              |
| T758<br>* | Acer campestre<br>Field Maple    | 11.0       | 5.0              | 5.0 | 5.0 | 5.0 | 100,<br>150,<br>250 x 3,<br>300 x 2 | 7.00             | 2.00                          | North       | EM        | Good                 | Good                    | Multi-stemmed tree with ivy.                                                      | 40+                                      | B2                             |
| T759      | Acer campestre<br>Field Maple    | 12.0       | 5.0              | 7.0 | 6.0 | 4.0 | 250,<br>400 x 2                     | 3.00             | 6.00                          | West        | M         | Good                 | Good                    | 3 stemmed tree with westerly bias. Fungi present.                                 | 40+                                      | A2                             |
| T760      | Acer campestre<br>Field Maple    | 11.0       | 3.0              | 5.0 | 6.0 | 5.0 | 250,<br>870                         | 2.00             | 6.00                          | South       | M         | Fair                 | Fair                    | Tree with some wood-rot. Lots of ivy-limited inspection.                          | 40+                                      | B2                             |
| T761      | Salix caprea<br>Goat Willow      | 12.0       | 4.0              | 3.0 | 3.0 | 7.0 | 400                                 | 1.00             | 7.00                          | West        | M         | Fair                 | Fair                    | Tree with basal cavity.                                                           | 40+                                      | B2                             |
| T762      | Fraxinus excelsior<br>Common Ash | 12.0       | 7.0              | 8.0 | 7.0 | 4.0 | 300 x 2,<br>350 x 2,<br>400         | 5.00             | 5.00                          | North       | M         | Good                 | Good                    | Multi-stemmed Ash with deadwood. Fungi present.                                   | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |      |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|------|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S    | W   |                |                  |                               |             |           |                      |                         |                                                                  |                                          |                                |
| T763     | Fraxinus excelsior<br>Common Ash      | 13.0       | 7.0              | 7.0 | 5.0  | 7.0 | 450<br>450     | 2.00             | 4.00                          | West        | M         | Good                 | Good                    | Prominent, twin-stemmed Ash.                                     | 20-30                                    | B2                             |
| T764     | Fraxinus excelsior<br>Common Ash      | 10.0       | 5.0              | 5.5 | 4.0  | 3.0 | 270            | 1.00             | 5.00                          | East        | SM        | Good                 | Good                    | Easterly bias.                                                   | 20-30                                    | C2                             |
| T765     | Crataegus monogyna<br>Common Hawthorn | 7.0        | 2.0              | 2.0 | 2.0  | 2.0 | 180            | 1.00             | 2.00                          | South       | SM        | Good                 | Good                    | Semi-mature Hawthorn.                                            | 20+                                      | C2                             |
| T766     | Acer campestre<br>Field Maple         | 10.0       | 4.0              | 4.0 | 4.0  | 4.0 | 300            | 1.00             | 3.00                          | North       | SM        | Fair                 | Fair                    | Bifurcates at 6m, small basal cavity.                            | 20+                                      | C2                             |
| T767     | Fraxinus excelsior<br>Common Ash      | 11.0       | 5.0              | 8.0 | 5.0  | 4.0 | 170<br>280     | 2.00             | 6.00                          | North       | EM        | Fair                 | Fair                    | Twin-stemmed Ash. Dead wood. Fungal Fruiting body on main stems. | >10                                      | U                              |
| T768     | Fraxinus excelsior<br>Common Ash      | 7.0        | 6.0              | 6.0 | 6.0  | 6.0 | 250            | 1.00             | 2.50                          | East        | SM        | Poor                 | Fair                    | Slight lean east. Some stem damage, occluding. Deadwood.         | 20-30                                    | C2                             |
| T769     | Quercus robur<br>Pedunculate Oak      | 12.0       | 6.0              | 7.0 | 6.0  | 6.0 | 450            | 1.00             | 3.50                          | East        | M         | Fair                 | fair                    | Slight easterly bias. Deadwood and stem occlusions.              | 40+                                      | B2                             |
| T770     | Crataegus monogyna<br>Common Hawthorn | 6.0        | 2.0              | 4.0 | 3.0  | 2.0 | 100 x 2<br>150 | 3.00             | 0.50                          | North       | Y         | Good                 | Good                    | Tri-stemmed tree with easterly bias.                             | 10+                                      | C2                             |
| T771     | Fraxinus excelsior<br>Common Ash      | 10.0       | 6.0              | 5.0 | 3.0  | 5.0 | 270            | 1.00             | 6.00                          | North       | SM        | Fair                 | Fair                    | Northerly bias. Some stem damage.                                | 20-30                                    | C2                             |
| T772     | Fraxinus excelsior<br>Common Ash      | 8.0        | 3.0              | 8.0 | 11.0 | 3.0 | 300            | 1.00             | 5.00                          | South       | EM        | Fair                 | Fair                    | Strong southerly bias. Ivy clad limiting inspection.             | 20-30                                    | C2                             |
| T774     | Salix babylonica<br>Weeping Willow    | 6.0        | 5.0              | 4.0 | 4.0  | 4.0 | 100 x 5<br>150 | 6.00             | 0.50                          | East        | SM        | Good                 | Good                    | Multi-stemmed tree within scrub limiting inspection.             | 20+                                      | C2                             |
| T775     | Ulmus procera<br>English Elm          | 10.0       | 2.0              | 3.0 | 2.0  | 2.0 | 170 x 2        | 2.00             | 4.00                          | North       | SM        | Poor                 | Poor                    | Dead. Twin-stemmed.                                              | -                                        | U                              |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                          | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                  |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                                  |                                          |                                |
| T776 #   | Acer campestre<br>Field Maple    | 7.0        | 2.0              | 2.0 | 2.0 | 2.0 | 140            | 1.00             | 1.00                          | West        | Y         | Poor                 | Fair                    | Stem damage and occlusions.                                                      | 10+                                      | C2                             |
| T777     | Populus sp.<br>Poplar            | 14.0       | 4.0              | 4.0 | 4.0 | 4.0 | 620            | 1.00             | 4.00                          | North       | M         | Good                 | Good                    | Mature Poplar.                                                                   | 40+                                      | B2                             |
| T778     | Populus sp.<br>Poplar            | 14.0       | 4.0              | 3.5 | 3.5 | 3.5 | 550            | 1.00             | 4.00                          | South       | M         | Fair                 | Fair                    | Bifurcates at 6m.                                                                | 40+                                      | B2                             |
| T779     | Populus sp.<br>Poplar            | 14.0       | 2.0              | 2.0 | 3.5 | 2.0 | 530            | 1.00             | 3.00                          | West        | M         | Fair                 | Fair                    | Poplar which bifurcates at 5m. Deadwood. Ivy clad limiting inspection.           | 40+                                      | B2                             |
| T780 #   | Fraxinus excelsior<br>Common Ash | 9.0        | 3.0              | 3.0 | 4.0 | 3.0 | 290            | 1.00             | 4.00                          | East        | SM        | Fair                 | Fair                    | Some stem occlusions.                                                            | 20-30                                    | C2                             |
| T781 #   | Populus sp.<br>Poplar            | 12.0       | 2.0              | 2.5 | 2.0 | 2.0 | 300            | 1.00             | 3.00                          | South       | EM        | Fair                 | Fair                    | Early mature Poplar with deadwood.                                               | 40+                                      | B2                             |
| T782     | Fraxinus excelsior<br>Common Ash | 10.0       | 4.0              | 4.0 | 4.0 | 4.0 | 350            | 1                | 3.00                          | West        | EM        | Fair                 | Fair                    | Early-mature Ash.                                                                | 20-30                                    | B2                             |
| T783     | Quercus robur<br>Pedunculate Oak | 12.0       | 7.0              | 7.0 | 7.0 | 7.0 | 1000           | 1                | 3.50                          | North       | M         | Poor                 | Poor                    | Dead.                                                                            | -                                        | U                              |
| T784     | Fraxinus excelsior<br>Common Ash | 9.0        | 4.0              | 4.0 | 4.0 | 4.0 | 250            | 1                | 3.00                          | North       | SM        | Good                 | Good                    | Semi-mature Ash.                                                                 | 20-30                                    | C2                             |
| T785     | Quercus robur<br>Pedunculate Oak | 12.0       | 8.0              | 8.0 | 8.0 | 8.0 | 850            | 1                | 4.00                          | West        | M         | Fair                 | Fair                    | Prominent Oak with wide crown. Ivy clad limiting inspection. Dieback. Poor form. | 20+                                      | B2                             |
| T786     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.0 | 3.0 | 4.0 | 500            | 1                | 2.00                          | North       | M         | Fair                 | Fair                    | Deadwood.                                                                        | 40+                                      | B2                             |
| T787     | Fraxinus excelsior<br>Common Ash | 13.0       | 4.0              | 4.0 | 3.0 | 3.0 | 400            | 1                | 4.00                          | West        | M         | Fair                 | Fair                    | Unremarkable                                                                     | 10+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                          | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                  |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| T788     | Fraxinus excelsior<br>Common Ash | 13.0       | 3.0              | 4.0 | 3.0 | 3.0 | 450            | 1                | 5.00                          | East        | EM        | Good                 | Good                    | Slight bias to East. Ivy clad limiting inspection. | 10+                                      | C2                             |
| T789     | Fraxinus excelsior<br>Common Ash | 13.0       | 4.0              | 4.0 | 4.0 | 4.0 | 270            | 1                | 5.00                          | North       | SM        | Good                 | Good                    | Unremarkable                                       | 10+                                      | C2                             |
| T790     | Populus sp.<br>Poplar            | 12.0       | 4.0              | 3.0 | 3.0 | 3.0 | 400            | 1                | 5.00                          | North       | EM        | Fair                 | Fair                    | Deadwood.                                          | 20+                                      | B2                             |
| T791     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.0 | 3.0 | 4.0 | 500            | 1                | 3.00                          | North       | M         | Good                 | Good                    | Mature Poplar.                                     | 20+                                      | B2                             |
| T792     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.0 | 3.0 | 3.0 | 500            | 1                | 3.00                          | East        | M         | Good                 | Good                    | Prominent Poplar.                                  | 20+                                      | B2                             |
| T793     | Populus sp.<br>Poplar            | 12.0       | 2.0              | 3.0 | 2.0 | 2.0 | 400            | 1                | 3.00                          | West        | EM        | Fair                 | Good                    | Ivy clad.                                          | 20+                                      | B2                             |
| T794     | Quercus robur<br>Pedunculate Oak | 9.0        | 5.0              | 4.0 | 4.0 | 4.0 | 400            | 1                | 3.00                          | West        | EM        | Good                 | Good                    | Early-mature Oak. Good Potential.                  | 40+                                      | A2                             |
| T795     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.0 | 3.0 | 3.0 | 570            | 1                | 2.50                          | West        | EM        | Good                 | Good                    | Early-mature Poplar.                               | 20+                                      | B2                             |
| T796     | Populus sp.<br>Poplar            | 13.0       | 4.0              | 4.0 | 3.0 | 2.0 | 450            | 1                | 4.00                          | West        | M         | God                  | Good                    | Mature Poplar.                                     | 20+                                      | B2                             |
| T797     | Fraxinus excelsior<br>Common Ash | 12.0       | 6.0              | 6.0 | 7.0 | 6.0 | 800            | 1                | 3.00                          | South       | M         | Good                 | Good                    | Prominent Ash. Ivy clad.                           | 20+                                      | B2                             |
| T798     | Quercus robur<br>Pedunculate Oak | 12.0       | 7.0              | 8.0 | 7.0 | 7.0 | 900            | 1                | 4.00                          | North       | M         | Good                 | Good                    | Prominent Oak. Wide crown.                         | 40+                                      | A2                             |
| T799     | Quercus robur<br>Pedunculate Oak | 11.0       | 6.0              | 3.0 | 3.0 | 3.0 | 450            | 1                | 3.00                          | North       | EM        | Fair                 | Good                    | Northerly bias. Sme stem damage.                   | 40+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)      | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|-----|-----|-----|---------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E   | S   | W   |                     |                  |                               |             |           |                      |                         |                                                          |                                          |                                |
| T800     | Fraxinus excelsior<br>Common Ash      | 10.0       | 4.5              | 4.5 | 4.5 | 4.5 | 500                 | 1                | 3.00                          | West        | M         | Good                 | Good                    | Mature Ash.                                              | 40+                                      | B2                             |
| T801     | Populus sp.<br>Poplar                 | 13.0       | 3.0              | 2.0 | 3.0 | 3.0 | 650                 | 1                | 2.00                          | North       | M         | Good                 | Good                    | Prominent Poplar. Ivy clad.                              | 20+                                      | B2                             |
| T802     | Populus sp.<br>Poplar                 | 13.0       | 3.0              | 3.0 | 3.0 | 2.0 | 670                 | 1                | 3.00                          | North       | M         | Good                 | Good                    | Prominent Poplar. Ivy clad.                              | 40+                                      | B2                             |
| T803 #   | Populus sp.<br>Poplar                 | 12.0       | 2.0              | 2.0 | 2.0 | 2.0 | 500                 | 1                | 2.00                          | West        | M         | Fair                 | Fair                    | Slight lean to east.                                     | 40+                                      | B2                             |
| T804 #   | Crataegus monogyna<br>Common Hawthorn | 9.0        | 4.0              | 3.0 | 3.0 | 3.0 | 500                 | 1                | 2.00                          | West        | M         | Fair                 | Fair                    | Some decline. Ivy clad limiting inspection.              | 30+                                      | C2                             |
| T805     | Crataegus monogyna<br>Common Hawthorn | 7.0        | 3.0              | 3.0 | 3.0 | 3.0 | 500                 | 1                | 3.00                          | South       | M         | Fair                 | Fair                    | Some decline. Ivy clad limiting inspection.              | 30+                                      | C2                             |
| T806     | Salix caprea<br>Goat Willow           | 9.0        | 4.0              | 4.0 | 4.0 | 4.0 | 150<br>230x2<br>350 | 4                | 4.00                          | South       | m         | Fair                 | Fair                    | 4-stemmed tree.                                          | 40+                                      | C2                             |
| T807     | Crataegus monogyna<br>Common Hawthorn | 8.0        | 3.0              | 3.0 | 3.0 | 3.0 | 380                 | 1                | 3.00                          | South       | M         | Fair                 | Fair                    | Ivy clad limiting inspection. Growing on wall (through). | 40+                                      | C2                             |
| T808     | Crataegus monogyna<br>Common Hawthorn | 9.0        | 3.0              | 3.0 | 3.0 | 3.0 | 200<br>400          | 2                | 2.50                          | West        | M         | Fair                 | Fair                    | Some decline. Ivy clad limiting inspection.              | 40+                                      | C2                             |
| T809     | Acer campestre<br>Field Maple         | 9.0        | 3.0              | 3.0 | 3.0 | 3.0 | 280                 | 1                | 4.00                          | East        | SM        | Fair                 | Fair                    | Field Maple with basal cavity.                           | 20+                                      | C2                             |
| T810     | Quercus robur<br>Pedunculate Oak      | 11.0       | 7.0              | 7.0 | 7.0 | 7.0 | 800                 | 1                | 3.50                          | North       | M         | Good                 | Good                    | Oak with wide crown.                                     | 40+                                      | A2                             |
| T811     | Quercus robur<br>Pedunculate Oak      | 11.0       | 5.0              | 5.0 | 3.0 | 4.0 | 380                 | 1                | 1.50                          | North       | SM        | Good                 | Good                    | North-easterly bias.                                     | 20+                                      | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                          | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm)      | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------|------------|------------------|-----|-----|-----|---------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                  |            | N                | E   | S   | W   |                     |                  |                               |             |           |                      |                         |                                                            |                                          |                                |
| T812     | Fraxinus excelsior<br>Common Ash | 12.0       | 4.0              | 4.0 | 5.0 | 4.0 | 360                 | 1                | 3.00                          | West        | EM        | Fair                 | Fair                    | Ivy clad and some deadwood.                                | 20-30                                    | B2                             |
| T813     | Acer campestre<br>Field Maple    | 12.0       | 4.0              | 5.0 | 4.0 | 4.0 | 400                 | 1                | 2.00                          | East        | EM        | Fair                 | Fair                    | Ivy clad and some dead wood.                               | 40+                                      | B2                             |
| T814     | Fraxinus excelsior<br>Common Ash | 12.0       | 5.0              | 5.0 | 4.0 | 4.0 | 380                 | 1                | 2.00                          | North       | EM        | Good                 | Good                    | Early-mature Ash.                                          | 20-30                                    | B2                             |
| T815     | Populus sp.<br>Poplar            | 10.0       | 2.0              | 2.0 | 2.0 | 2.0 | 350                 | 1                | 2.00                          | West        | WM        | Fair                 | Fair                    | Some deadwood.                                             | 20+                                      | C2                             |
| T816     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 4.0 | 3.0 | 3.0 | 600                 | 1                | 3.00                          | West        | M         | Good                 | Good                    | Prominent Poplar in scrub limiting inspection.             | 20+                                      | B2                             |
| T817     | Quercus robur<br>Pedunculate Oak | 9.0        | 4.0              | 3.0 | 3.0 | 3.0 | 400                 | 1                | 3.00                          | East        | EM        | Good                 | Good                    | Bifurcates at 2m.                                          | 40+                                      | B2                             |
| T818     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.0 | 3.0 | 3.0 | 500                 | 1                | 2.00                          | West        | M         | Good                 | Good                    | Prominent, mature Poplar.                                  | 20+                                      | B2                             |
| T819     | Populus sp.<br>Poplar            | 13.0       | 3.0              | 3.5 | 3.0 | 3.0 | 460                 | 1                | 2.00                          | West        | M         | Good                 | Good                    | Prominent, mature Poplar.                                  | 20+                                      | B2                             |
| T820     | Quercus robur<br>Pedunculate Oak | 11.0       | 7.0              | 7.0 | 7.0 | 6.0 | 450                 | 1                | 2.00                          | West        | EM        | Good                 | Good                    | Oak with wide crown. Set within scrub limiting inspection. | 40+                                      | A2                             |
| T821     | Fraxinus excelsior<br>Common Ash | 10.0       | 3.0              | 4.0 | 3.0 | 3.0 | 400                 | 1                | 2.00                          | North       | EM        | God                  | Good                    | Early mature Ash.                                          | 40+                                      | B2                             |
| T822     | Populus sp.<br>Poplar            | 11.0       | 3.0              | 3.0 | 3.0 | 3.0 | 420                 | 1                | 2.00                          | West        | M         | Fair                 | Fair                    | Mature Poplar.                                             | 40+                                      | B2                             |
| T823     | Acer campestre<br>Field Maple    | 8.0        | 4.0              | 4.0 | 4.0 | 4.0 | 150<br>200x2<br>400 | 4                | 1.00                          | West        | M         | Fair                 | Poor                    | Overrun with Ivy limiting inspection.                      | 10+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                               | Height (m) | Crown spread (m) |      |     |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------|------------|------------------|------|-----|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                       |            | N                | E    | S   | W    |                |                  |                               |             |           |                      |                         |                                                                            |                                          |                                |
| T824     | Quercus robur<br>Pedunculate Oak      | 9.0        | 6.0              | 6.0  | 6.0 | 6.0  | 350            | 1                | 3.00                          | South       | SM        | Good                 | Good                    | Bifurcates at 2m.                                                          | 20+                                      | B2                             |
| T825     | Fraxinus excelsior<br>Common Ash      | 7.0        | 3.0              | 3.0  | 3.0 | 3.0  | 280            | 1                | 0.50                          | North       | SM        | Fair                 | Fair                    | Semi-mature Ash.                                                           | 20+                                      | C2                             |
| T826     | Fraxinus excelsior<br>Common Ash      | 11.0       | 3.0              | 3.0  | 3.0 | 3.0  | 150<br>320     | 2                | 0.50                          | West        | EM        | Fair                 | Fair                    | Stem occlusios and deadwood.                                               | 40+                                      | B2                             |
| T827     | Populus sp.<br>Poplar                 | 13.0       | 4.0              | 4.0  | 4.0 | 4.0  | 500            | 1                | 1.00                          | West        | M         | Good                 | Good                    | Mature Poplar.                                                             | 40+                                      | B2                             |
| T828     | Populus sp.<br>Poplar                 | 13.0       | 3.0              | 3.0  | 3.0 | 3.0  | 200<br>400     | 2                | 5.00                          | South       | M         | Good                 | God                     | Prominent Poplar in scrub limiting inspection.                             | 40+                                      | B2                             |
| T829     | Quercus robur<br>Pedunculate Oak      | 10.0       | 4.0              | 4.0  | 4.0 | 4.0  | 450            | 1                | 4.00                          | West        | EM        | Good                 | Good                    | Early mature Oak.                                                          | 40+                                      | B2                             |
| T830     | Fraxinus excelsior<br>Common Ash      | 9.0        | 4.0              | 3.0  | 3.0 | 3.0  | 350            | 1                | 3.00                          | North       | SM        | Good                 | Good                    | Semi-mature Ash.                                                           | 20-30                                    | C2                             |
| T831     | Crataegus monogyna<br>Common Hawthorn | 8.0        | 3.0              | 3.0  | 3.0 | 3.0  | 100<br>160x2   | 3                | 0.50                          | North       | M         | Fair                 | Fair                    | Mature Hawthorn.                                                           | 40+                                      | C2                             |
| T832     | Quercus robur                         | 12.0       | 5.0              | 6.0  | 6.0 | 7.0  | 0.50           | 1.00             | 2.00                          | N           | EM        | Good                 | Good                    | Maiden Oak, some ivy. Good potential.                                      | + 40                                     | A2                             |
| T833     | Quercus robur                         | 14.0       | 4.0              | 4.0  | 4.0 | 3.0  | 0.80           | 1.00             | 1.50                          | N           | M         | Fair                 | Good                    | Fine Oak, lost leader high in canopy. Ivy clad. Habitat value.             | + 30                                     | A3                             |
| T834     | 2 Populus x canadensis                | +20        | 9.0              | 10.0 | 9.0 | 10.0 | 0.6<br>x2      | 2.00             | 5.00                          | N           | EM        | Good                 | Good                    | Two adjacent Poplar, skyline presence. Both twin-stem from 0.6m. Vigorous. | + 30                                     | B2                             |
| T835     | Fraxinus excelsior                    | 14.0       | 6.0              | 4.0  | 5.0 | 5.0  | 0.40           | 1.00             | 3.00                          | N           | EM        | Good                 | Fair                    | Ivy clad, good bud development.                                            | + 20                                     | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                            | Height (m) | Crown spread (m) |     |      |      | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------------------------------|------------|------------------|-----|------|------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                    |            | N                | E   | S    | W    |                |                  |                               |             |           |                      |                         |                                                             |                                          |                                |
| T836     | Acer campestre                                                     | 7.0        | 5.0              | 4.0 | 3.0  | 5.0  | ave 0.25       | 6.00             | 2.00                          | W           | M         | Good                 | Good                    | Multi-stem Maple. Ivy clad. Bias to north.                  | + 20                                     | B2                             |
| T837     | Douglas Fir<br>Pseudotsuga menziesii                               | 15.0       | 4.0              | 4.0 | 4.0  | 4.0  | est 0.5        | 1.00             | 5.00                          | -           | M         | Good                 | Good                    | Ivy clad, unable to access. Fine *** at ground level.       | + 40                                     | A2                             |
| T838 #   | Pinus sylvestris, Pseudotsuga menziesii<br>Scots Pine, Douglas Fir | Est 0.3    | 3.0              | 3.0 | 3.0  | 3.0  | est 0.3        | 1.00             | +4                            | -           | EM        | Good                 | Good                    | Unplotted, unable to access. Ivy clad.                      | + 30                                     | B2                             |
| T839     | Douglas Fir<br>Pseudotsuga menziesii                               | 12.0       | 2.0              | 2.0 | 2.0  | 2.0  | 0.20           | 1.00             | +6                            | -           | Y         | Fair                 | Fair                    | Etiolated, unremarkable.                                    | + 10                                     | C2                             |
| T840     | Pinus sylvestris                                                   | 15.0       | 6.0              | 4.0 | 4.0  | 3.0  | 0.45           | 1.00             | 3.00                          | E           | M         | Good                 | Good                    | Fine Pine. Good vigour. Dead ivy on stem.                   | + 40                                     | A2                             |
| T841     | Douglas Fir<br>Pseudotsuga menziesii                               | 16.0       | 5.0              | 3.0 | 1.0  | 1.0  | 0.60           | 1.00             | +5                            | E           | M         | Poor                 | Good                    | Fallen/propped to northern Pine. Fell.                      | <5                                       | U                              |
| T842     | Douglas Fir<br>Pseudotsuga menziesii                               | 14.0       | 3.0              | 3.0 | 4.0  | 3.0  | 0.35           | 1.00             | +5                            | -           | EM        | Good                 | Good                    | Good Fir, good potential.                                   | + 30                                     | B2                             |
| T843 #   | Pinus sylvestris                                                   | 15.0       | 3.0              | 3.0 | 3.0  | 3.0  | est 0.4        | 1.00             | +8                            | -           | EM        | Good                 | Good                    | Etiolated, high canopy.                                     | + 30                                     | B2                             |
| T844     | Fraxinus excelsior                                                 | 11.0       | 7.0              | 6.0 | 4.0  | 4.0  | 0.35           | 1.00             | 2.00                          | E           | EM        | Good                 | Good                    | Good vigour, ivy clad. Slight north-east bias crown.        | + 10                                     | B2                             |
| T845 #   | Populus sp.                                                        | +20        | 10.0             | 8.0 | 10.0 | 10.0 | est 0.9        | 1.00             | +5                            | -           | M         | Good                 | Good                    | Large, hybrid Poplar, dense ivy cover. Unable to access.    | + 30                                     | B2                             |
| T846     | Populus sp.                                                        | 17.0       | 10.0             | 9.0 | 10.0 | 5.0  | ave 0.25       | 4.00             | +8                            | E           | EM        | Fair                 | Good                    | Multi-stem from ground level, ivy clad. Weak forked unions. | + 20                                     | B2                             |
| T847     | 2 Salix caprea                                                     | 10.0       | 8.0              | 5.0 | 3.0  | 5.0  | 0.3 x2         | 2.00             | +3                            | N           | EM        | Fair                 | Fair/Good               | Twin-stem or two close trees. Bias to north.                | + 10                                     | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                               | Height (m) | Crown spread (m) |     |      |     | Stem dia. (mm)    | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                   | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------|------------|------------------|-----|------|-----|-------------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                       |            | N                | E   | S    | W   |                   |                  |                               |             |           |                      |                         |                                                                                      |                                          |                                |
| T848     | Quercus robur                                                         | 10.0       | 6.0              | 8.0 | 6.0  | 3.0 | 0.4<br>0.2<br>0.3 | 3.00             | 3.00                          | E           | EM        | Good/Fair            | Good                    | Tri-stem Oak, bias to east.                                                          | + 30                                     | B2                             |
| T849     | 2 Betula pendula                                                      | 7.0        | 1.0              | 3.0 | 1.0  | 1.0 | 0.20              | 1.00             | +3                            | E           | Y         | Good/Fair            | Good                    | Immature Birch.                                                                      | + 20                                     | C2                             |
| T850     | Corylus avellana                                                      | 5.0        | 3.0              | 4.0 | 3.0  | 3.0 | ave<br>0.01       | +10              | 1.00                          | E           | M         | Good                 | Good                    | Hazel coppice.                                                                       | + 30                                     | B3                             |
| T851     | Acer campestre                                                        | 7.0        | 5.0              | 6.0 | 6.0  | 7.0 | 0.6<br>0.3<br>0.2 | 3.00             | 1.00                          | E           | M         | Good                 | Good                    | Fine, mature Maple. Some ivy. Contact wood.                                          | + 40                                     | A2                             |
| T852     | Fagus sylvatica                                                       | 12.0       | 5.0              | 5.0 | 6.0  | 7.0 | 0.60              | 1.00             | 4.00                          | -           | EM        | Good                 | Good                    | Bifurcates at 2m, westerly bias.                                                     | + 40                                     | A2                             |
| T853     | Quercus robur                                                         | 10.0       | 2.0              | 4.0 | 6.0  | 5.0 | 0.25              | 1.00             | 2.00                          | S           | EM        | Good                 | Fair/Good               | Lacking some vigour. Bias to south.                                                  | + 30                                     | B2                             |
| T854     | Quercus robur                                                         | 10.0       | 4.0              | 4.0 | 4.0  | 4.0 | 0.25              | 1.00             | +4                            | -           | Y         | Fair                 | Fair                    | Suppressed, etiolated.                                                               | + 20                                     | C2                             |
| T855     | Ilex aquifolium                                                       | 9.0        | 4.0              | 3.0 | 3.0  | 3.0 | 0.4<br>0.4        | 2.00             | 2.00                          | S           | M         | Good                 | Good                    | Fine, aged Holly. Twin-stem from 0.5m.                                               | + 30                                     | A1/2                           |
| T856     | 2 Quercus robur                                                       | 12.0       | 8.0              | 2.0 | 9.0  | 9.0 | 0.4<br>0.7        | 2.00             | 2.00                          | W           | M         | Good                 | Good                    | Pair of close trees, or single tree. Bias to west. Ivy clad. Good value nonetheless. | + 40                                     | A2                             |
| T857     | Quercus robur, Crataegus monogyna<br>Pedunculate Oak, Common Hawthorn | 6.0        | 3.0              | 3.0 | 3.0  | 3.0 | 0.30              | 2.00             | -                             | -           | -         | -                    | -                       | Dead standing stems x2.                                                              | -                                        | U                              |
| T858     | Quercus robur                                                         | 16.0       | 10.0             | 6.0 | 11.0 | 5.0 | 0.70              | 1.00             | 2.00                          | S           | M         | Good                 | Good                    | Fine, maiden Oak. Ivy clad. Some dead wood.                                          | + 40                                     | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                    | Height (m) | Crown spread (m) |     |     |     | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------|------------|------------------|-----|-----|-----|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                            |            | N                | E   | S   | W   |                |                  |                               |             |           |                      |                         |                                                                  |                                          |                                |
| T859     | Fraxinus excelsior                         | 8.0        | 4.0              | 2.0 | 6.0 | 6.0 | 0.40           | 1.00             | 3.00                          | S           | EM        | Poor                 | Poor                    | 80% dead canopy.                                                 | <5                                       | U                              |
| T860     | Fraxinus excelsior                         | 16.0       | 3.0              | 7.0 | 6.0 | 7.0 | 0.4<br>0.35    | 2.00             | 4.00                          | N           | EM        | Fair                 | Fair/Good               | Twin-stem Ash, few snags. Ivy. Bias to north.                    | + 10                                     | B2                             |
| T861     | Quercus robur                              | 17.0       | 3.0              | 4.0 | 9.0 | 5.0 | 0.55           | 1.00             | 3.00                          | S           | EM        | Good                 | Good                    | Good potential, bias to South. Some dead wood.                   | + 40                                     | A2                             |
| T862     | Fraxinus excelsior                         | 14.0       | 8.0              | 6.0 | 4.0 | 2.0 | 0.35<br>x2     | 2.00             | 5.00                          | N           | EM        | Good                 | Fair                    | Twin-stem from ground level, bias to north. Ivy clad.            | + 20                                     | B2                             |
| T863     | Fraxinus excelsior                         | 16.0       | 8.0              | 9.0 | 5.0 | 4.0 | 0.5<br>0.35    | 2.00             | 3.00                          | E           | EM        | Good                 | Fair                    | Twin-stem from ground level, bias to north. Ivy clad, few snags. | + 20                                     | B2                             |
| T864     | Fraxinus excelsior                         | 9.0        | 5.0              | 4.0 | 5.0 | 4.0 | Ave .2         | 4.00             | 1.00                          | n/a         | EM        | Good                 | Fair                    | Cluster of four stems, predominantly ash.                        | + 20                                     | B2                             |
| T865     | Populus nigra 'Italica'<br>Lombardy Poplar | 18.0       | 3.0              | 3.0 | 3.0 | 3.0 | 0.35           | 1.00             | +5                            | -           | EM        | Good                 | Good/Fair               | Erect, skyline presence.                                         | + 20                                     | B2                             |
| T866     | Salix caprea                               | 6.0        | 5.0              | 5.0 | 2.0 | 5.0 | est<br>0.4     | 1.00             | 1.00                          | N           | M         | Fair/Poor            | Good                    | Lapsed or heavy northern bias.                                   | + 10                                     | C2                             |
| T867     | Populus nigra 'Italica'<br>Lombardy Poplar | 18.0       | 3.0              | 3.0 | 3.0 | 3.0 | ave<br>0.4     | 1.00             | +5                            | -           | EM        | Fair/Poor            | Good                    | Erect, skyline presence.                                         | + 20                                     | B2                             |
| T868     | 2 Fraxinus excelsior                       | 12.0       | 4.0              | 4.0 | 4.0 | 4.0 | 0.20           | 1.00             | 3.00                          | -           | Y         | Good                 | Good                    | Young Ash pair.                                                  | + 20                                     | C2                             |
| T869     | Populus nigra 'Italica'<br>Lombardy Poplar | 18.0       | 3.0              | 3.0 | 3.0 | 3.0 | ave<br>0.4     | 1.00             | +5                            | -           | EM        | Fair/Poor            | Good                    | Erect, skyline presence.                                         | + 20                                     | B2                             |
| T870     | Acer campestre                             | 9.0        | 4.0              | 5.0 | 3.0 | 3.0 | 0.3<br>x2      | 2.00             | 3.00                          | N           | M         | Good                 | Good                    | Maple on edge of copse.                                          | + 30                                     | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                          | Height (m) | Crown spread (m) |          |          |          | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------------|------------|------------------|----------|----------|----------|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                  |            | N                | E        | S        | W        |                |                  |                               |             |           |                      |                         |                                                                                                          |                                          |                                |
| T871     | Populus nigra 'Italica'<br>Lombardy Poplar       | +20        | 4.0              | 4.0      | 4.0      | 4.0      | 0.40           | 1.00             | +6                            | -           | M         | Good                 | Good                    | Erect, skyline presence.                                                                                 | + 20                                     | B2                             |
| T872     | Fraxinus excelsior                               | 8.0        | 4.0              | 4.0      | 3.0      | 4.0      | 0.3<br>0.4     | 2.00             | 1.50                          | -           | Y         | Fair                 | Good                    | Twin-stem, bark wounds.                                                                                  | + 10                                     | C2                             |
| T873     | Douglas Fir<br># Pseudotsuga menziesii           | ave<br>20  | ave<br>4         | ave<br>4 | ave<br>4 | ave<br>4 | ave<br>0.4     | 1.00             | ave<br>+5                     | -           | EM        | Good/Fair            | Good/Fair               | Series of individual Fir within linear copse. Even aged/scale, some with leader issues. Fine collection. | + 40                                     | A1/2                           |
| T874     | 2 Larix decidua                                  | 10.0       | 4.0              | 4.0      | 4.0      | 4.0      | 0.30           | 1.00             | 3.00                          | E           | EM        | Good/Fair            | Good                    | Pair of close Larch.                                                                                     | + 20                                     | B2                             |
| T875     | Fraxinus excelsior                               | 10.0       | 5.0              | 5.0      | 5.0      | 4.0      | 0.25           | 1.00             | 2.00                          | N           | EM        | Good/Fair            | Good                    | Bifurcates at 2m, elephant ear union.                                                                    | + 10                                     | C2                             |
| T876     | Crataegus monogyna                               | 4.0        | 2.0              | 2.0      | 2.0      | 2.0      | ave<br>0.15    | 1.00             | 1.00                          | -           | M         | Fair                 | Good                    | Low, stubby thorn.                                                                                       | + 20                                     | C3                             |
| T877     | Chamaecyparis lawsoniana (var)<br>Lawson Cypress | 8.0        | see plan         |          |          |          | est<br>0.2     | var              | 0.00                          | -           | EM        | Good                 | Good                    | Ornamental conifer on edge of copse.                                                                     | + 20                                     | C2                             |
| G1       | Quercus robur -<br>Pedunculate Oak               | 12.0       | as shown.        |          |          |          | 410-470        | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Two young Oaks.                                                                                          | 20-40                                    | B2                             |
| G2       | Quercus robur -<br>Pedunculate Oak               | 13.0       | as shown.        |          |          |          | 300-480        | -                | -                             | -           | SM-EM     | Fair                 | Fair                    | Smaller of two trees has been topped by utility company.                                                 | 20-40                                    | B2                             |
| G3       | Quercus robur -<br>Pedunculate Oak               | 12.0       | as shown.        |          |          |          | 260-320        | -                | -                             | -           | SM-SM     | Good                 | Good                    | Cohesive pair of oak on field boundary.                                                                  | 40+                                      | A2                             |
| G4       | Quercus robur -<br>Pedunculate Oak               | 13.0       | as shown.        |          |          |          | 400-450        | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Two oak stems growing closely on field boundary.                                                         | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                              | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                      | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                      |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                         |                                          |                                |
| G5       | Betula pubescens - Downy Birch                                                                                                       | 16.0       | as shown.        |   |   |   | 400-450        | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Located adjacent road within field boundary vegetation.                                 | 20-40                                    | B2                             |
| G6       | Betula pubescens - Downy Birch                                                                                                       | 16.0       | as shown.        |   |   |   | 300-450        | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Located adjacent road within field boundary vegetation.                                 | 20-40                                    | B2                             |
| G7       | Betula pubescens - Downy Birch                                                                                                       | 16.0       | as shown.        |   |   |   | 300-500        | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Located adjacent road within field boundary vegetation.                                 | 20-40                                    | B2                             |
| G8       | Betula pubescens - Downy Birch                                                                                                       | 15.0       | as shown.        |   |   |   | 250-400        | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Dead birch present. Located adjacent road within field boundary vegetation.             | 20-40                                    | B2                             |
| G9       | Betula pendula - Silver Birch<br>Ilex aquifolium - Common Holly<br>Quercus robur - Pedunculate Oak                                   | 12.0       | as shown.        |   |   |   | 150-200        | -                | -                             | -           | SM-SM     | Fair                 | Fair                    | Located within field boundary vegetation.                                               | 20-40                                    | B2                             |
| G10      | Betula pubescens - Downy Birch<br>Salix cinerea - Grey Willow                                                                        | 15.0       | as shown.        |   |   |   | 100-350        | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Tree belt outside field boundary fence. Predominantly birch. Fallen trees present.      | 20-40                                    | B2                             |
| G11      | Betula pubescens - Downy Birch<br>Quercus robur - Pedunculate Oak                                                                    | 15.0       | as shown.        |   |   |   | 300-500        | -                | -                             | -           | EM-M      | Fair                 | Good                    | Tree belt adjacent road within field boundary vegetation. Outside field boundary fence. | 40+                                      | A2                             |
| G12      | Prunus sp. - Prunus sp.                                                                                                              | 8.0        | as shown.        |   |   |   | 100-130        | -                | -                             | -           | Y-Y       | Fair                 | Fair                    | Cluster of stems growing adjacent gate.                                                 | 20-40                                    | C2                             |
| G13      | Fraxinus excelsior - Common Ash<br>Quercus robur - Pedunculate Oak<br>Salix cinerea - Grey Willow<br>Corylus avellana - Common Hazel | 10.0       | as shown.        |   |   |   | 50-300         | -                | -                             | -           | Y-SM      | Fair                 | Good                    |                                                                                         | 20-40                                    | B2                             |
| G14      | Salix cinerea - Grey Willow                                                                                                          | 12.0       | as shown.        |   |   |   | 200-350        | -                | -                             | -           | SM-M      | Poor                 | Good                    | Fallen stems within group growing within shallow ditch.                                 | 10-20                                    | C2                             |
| G15      | Salix cinerea - Grey Willow                                                                                                          | 8.0        | as shown.        |   |   |   | 400-450        | -                | -                             | -           | EM-M      | Poor                 | Good                    | Fallen stems within group growing within shallow ditch.                                 | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                     | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                             |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                           |                                          |                                |
| G16      | Populus nigra 'Italica' - Lombardy Poplar                                                                                                                                   | 19.0       | as shown.        |   |   |   | 300-350        | -                | -                             | -           | SM-SM     | Fair                 | Good                    | Fallen stems within group growing within shallow ditch.                                                                                                   | 20-40                                    | B2                             |
| G17      | Fraxinus excelsior - Common Ash Quercus robur - Pedunculate Oak                                                                                                             | 12.0       | as shown.        |   |   |   | 150-200        | -                | -                             | -           | Y-SM      | Fair                 | Good                    |                                                                                                                                                           | 20-40                                    | B2                             |
| G18      | Acer campestre - Field Maple Fraxinus excelsior - Common Ash                                                                                                                | 15.0       | as shown.        |   |   |   | 250-350        | -                | -                             | -           | SM-M      | Fair                 | Good                    | Growing adjacent ditch.                                                                                                                                   | 20-40                                    | B2                             |
| G19      | Fraxinus excelsior - Common Ash Acer campestre - Field Maple Populus nigra 'Italica' - Lombardy Poplar Quercus robur - Pedunculate Oak Crataegus monogyna - Common Hawthorn | 15.0       | as shown.        |   |   |   | 100-350        | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Mixed field boundary group.                                                                                                                               | 20-40                                    | B2                             |
| G20      | Fraxinus excelsior - Common Ash Acer campestre - Field Maple Populus nigra 'Italica' - Lombardy Poplar Quercus robur - Pedunculate Oak Crataegus monogyna - Common Hawthorn | 16.0       | as shown.        |   |   |   | 100-350        | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Tree belt on field boundary comprising mixed broadleaved species. Poplar occur in intermittent clumps. Collective worth greater than individuals present. | 40+                                      | A2                             |
| G21      | Salix cinerea - Grey Willow                                                                                                                                                 | 8.0        | as shown.        |   |   |   | 200-250        | -                | -                             | -           | SM-SM     | Fair                 | Fair                    |                                                                                                                                                           | 10-20                                    | C2                             |
| G22      | Salix cinerea - Grey Willow Betula pubescens - Downy Birch Salix caprea - Goat Willow                                                                                       | 12.0       | as shown.        |   |   |   | 100-250        | -                | -                             | -           | SM-SM     | Fair                 | Fair                    | Collective worth greater than individuals present.                                                                                                        | 20-40                                    | B2                             |
| G23      | Salix cinerea - Grey Willow                                                                                                                                                 | 10.0       | as shown.        |   |   |   | 100-150        | -                | -                             | -           | SM-SM     | Poor                 | Fair                    | Collapsing stems present.                                                                                                                                 | 10-20                                    | C2                             |
| G24      | Alnus glutinosa - Common Alder Fraxinus excelsior - Common Ash                                                                                                              | 13.0       | as shown.        |   |   |   | 100-250        | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Belt of predominantly alder. Bramble encroachment.                                                                                                        | 20-40                                    | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                                                              | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                                                                      |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                               |                                          |                                |
| G25      | Fraxinus excelsior -<br>Common Ash Populus nigra 'Italica' -<br>Lombardy Poplar Quercus robur -<br>Pedunculate Oak Corylus avellana -<br>Common Hazel Betula pendula -<br>Silver Birch Salix caprea -<br>Goat Willow | 18.0       | as shown.        |   |   |   | 100-350        | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Collective worth greater than individuals present.                                                            | 40+                                      | A2                             |
| G26      | Salix cinerea -<br>Grey Willow                                                                                                                                                                                       | 9.0        | as shown.        |   |   |   | 200-350        | -                | -                             | -           | EM-M      | Poor                 | Good                    | Located adjacent road within field boundary vegetation.                                                       | 10-20                                    | C2                             |
| G27      | Quercus robur -<br>Pedunculate Oak                                                                                                                                                                                   | 11.0       | as shown.        |   |   |   | 400-450        | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Located adjacent road within field boundary vegetation.<br>Collective worth greater than individuals present. | 40+                                      | A2                             |
| G28      | Acer campestre -<br>Field Maple Fraxinus excelsior -<br>Common Ash Sorbus aria -<br>Coast Redwood                                                                                                                    | 10.0       | as shown.        |   |   |   | 150-300        | -                | -                             | -           | SM-EM     | Good                 | Good                    |                                                                                                               | 20-40                                    | B2                             |
| G29      | Quercus robur -<br>Pedunculate Oak                                                                                                                                                                                   | 8.0        | as shown.        |   |   |   | 150-150        | -                | -                             | -           | Y-Y       | Fair                 | Good                    |                                                                                                               | 10-20                                    | C2                             |
| G30      | Fraxinus excelsior -<br>Common Ash                                                                                                                                                                                   | 12.0       | as shown.        |   |   |   | 180-200        | -                | -                             | -           | SM-SM     | Fair                 | Good                    | Growing within field boundary vegetation.                                                                     | 20-40                                    | B2                             |
| G31      | Acer campestre -<br>Field Maple                                                                                                                                                                                      | 10.0       | as shown.        |   |   |   | 250-350        | -                | -                             | -           | EM-M      | Fair                 | Good                    |                                                                                                               | 20-40                                    | B2                             |
| G32      | Crataegus monogyna -<br>Common Hawthorn                                                                                                                                                                              | 8.0        | as shown.        |   |   |   | 150-200        | -                | -                             | -           | EM-M      | Fair                 | Good                    | Mature hawthorn hedgerow section.                                                                             | 10-20                                    | C2                             |
| G33      | Fraxinus excelsior -<br>Common Ash Quercus robur -<br>Pedunculate Oak Acer campestre -<br>Field Maple Crataegus monogyna -<br>Common Hawthorn                                                                        | 20.0       | as shown.        |   |   |   | 100-500        | -                | -                             | -           | SM-M      | Fair                 | Good                    | Woodland block of predominantly ash. Bramble encroachment.                                                    | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                              | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                      |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                          |                                          |                                |
| G34      | Alnus glutinosa -<br>Common Alder Salix sp. -<br>Weeping Willow Quercus robur -<br>Pedunculate Oak                                                   | 13.0       | as shown.        |   |   |   | 100-200        | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Bramble encroachment.                                                                                                                                                                    | 20-40                                    | B2                             |
| G35      | Alnus glutinosa -<br>Common Alder Populus nigra 'Italica' -<br>Lombarby Poplar Fraxinus excelsior -<br>Common Ash Quercus robur -<br>Pedunculate Oak | 16.0       | as shown.        |   |   |   | 100-350        | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Tree belt on field boundary comprising mixed broadleaved species. Poplar occur in intermittent clumps. Collective worth greater than individuals present.                                | 40+                                      | A2                             |
| G36      | Salix caprea -<br>Goat Willow                                                                                                                        | 7.0        | as shown.        |   |   |   | 180-200        | -                | -                             | -           | Y-SM      | Fair                 | Good                    |                                                                                                                                                                                          | 10-20                                    | C2                             |
| G40      | Thuja plicata<br>Western Red Cedar                                                                                                                   | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | MA        | Fair                 | Good                    | Formed of stems ave 0.20Ø, offers some screening and evergreen interest, little else.                                                                                                    | + 20                                     | C2                             |
| G41      | Acer campestre, Crataegus monogyna, Prunus sp.<br>Field Maple, Common Hawthorn, Prunus                                                               | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Poor                    | Grown-out remnant hedge between road and ditch. Ivy clad, partially moribund. Field Maple of some possible potential noted.                                                              | + 20                                     | C2                             |
| G42      | Corylus avellana, Fraxinus excelsior, Salix caprea, Salix cinerea, Sambucus nigra<br>Common hazel, Common Ash, Goat Willow, Grey Willow, Elder       | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Mixed species at entrance to site. Fairly well formed, early mature individual tree within group. Tree guards noted with underplanting of mixed success.                                 | + 25                                     | B2                             |
| G43      | Fraxinus excelsior<br>Common Ash                                                                                                                     | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Ash poles, multi-trunked and typically vigorous. To road edge and understory formed of Dogrose, Blackthorn and dense bramble.                                                            | + 20                                     | C2                             |
| G44      | Ilex aquifolium, Quercus robur, Prunus spinosa, Acer campestre<br>Common Holly, Pedunculate Oak, Blackthorn, Field Maple                             | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Boundary group established with larger climax trees within group. Vegetated to the ground, the group offers screening and definition to Sheerlands Road and enclose to the western plot. | + 25                                     | B2                             |
| G45      | Acer campestre, Prunus spinosa<br>Field Maple, Blackthorn                                                                                            | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Formed of multi-trunked trees vegetated to the ground. Deciduous screening.                                                                                                              | + 25                                     | B2                             |
| G46      | Fraxinus excelsior<br>Common Ash                                                                                                                     | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Typically vigorous multi-trunked trees.                                                                                                                                                  | + 15                                     | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                   | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                              | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                           |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                 |                                          |                                |
| G47      | Acer campestre, Crataegus monogyna<br>Field Maple, Common Hawthorn                                                        | 6.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Poor                    | Trees stunted and clad with bramble.                                                                                                                                                            | + 15                                     | C2                             |
| G48      | Fraxinus excelsior, Quercus robur, Ilex aquifolium<br>Common Ash, Pedunculate Oak, Common Holly                           | 12.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Ash climax with mid-story Oak and Holly.                                                                                                                                                        | + 15                                     | B2                             |
| G49      | Acer campestre<br>Field Maple                                                                                             | 2.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Hedge/group bounding the field edge and growing under large climax Oak trees.                                                                                                                   | + 15                                     | C2                             |
| G50      | Quercus robur, Corylus avellana, Ilex aquifolium<br>Pedunculate Oak, Common Hazel, Common Holly                           | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Large, well formed Oak bounding the access track. Dead wood noted and Ivy cloaking the lower crown of a number of the trees. Located on either side of boundary ditch. High in skyline amenity. | + 40                                     | A2                             |
| G51      | Quercus robur, Fraxinus excelsior, Acer campestre<br>Pedunculate Oak, Common Ash, Field Maple                             | >18        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Group on boundary bank on the site side of the ditch. This forms a strong backdrop and adds enclosure to the northern boundary of the site.                                                     | + 35                                     | A1                             |
| G52      | Salix fragilis<br>Crack Willow                                                                                            | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Poor                    | Group established in a wet dell at bend of road. Formed of lapsed/regenerating trunks. Vigorous to the tips.                                                                                    | + 10                                     | C2                             |
| G53      | Quercus robur, Corylus avellana, Acer campestre, Fraxinus excelsior<br>English Oak, Common Hazel, Field Maple, Common Ash | 12.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Former field hedgerow. Established on ditch/bund. Mixed species field boundary, Hazel.                                                                                                          | + 35                                     | B3                             |
| G54      | x3 Cupressocyparis x leylandii<br>Leyland Cypress                                                                         | 13.0       | >4m              |   |   |   | 0.4            | 3                | -                             | -           | M         | Fair                 | Fair                    | Three closely established trunks.                                                                                                                                                               | + 15                                     | C2                             |
| G55      | n/a                                                                                                                       |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                 |                                          |                                |
| G56      | Fraxinus excelsior, Quercus robur, Acer campestre, Prunus spinosa<br>Common Ash, Pedunculate Oak, Field Maple, Blackthorn | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Large, well formed climax Oak, Ash with a lower/mid story of Field Maple.                                                                                                                       | + 20                                     | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                      | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                         | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                              |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                            |                                          |                                |
| G57      | Fraxinus excelsior, Acer campestre, Corylus avellana, Prunus spinosa<br>Common Ash, Field Maple, Common Hazel, Blackthorn    | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Gappy hedge with large climax tree. Hazel coppice.                                                                                                                         | + 15                                     | B2                             |
| G58      | n/a                                                                                                                          |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                                                                                                                            |                                          |                                |
| G59      | Cupressocyparis x leylandii<br>Leyland Cypress                                                                               | 18.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Line of leylandii bounding waterbody.                                                                                                                                      | + 15                                     | C2                             |
| G60      | Alnus glutinosa, Salix sp., Betula pendula<br>Common Alder, Willow, Silver Birch                                             | 7.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Within area of dense vegetation.                                                                                                                                           | + 15                                     | C2                             |
| G61      | Prunus spinosa, Quercus robur, Acer campestre, Corylus avellana<br>Blackthorn, Pedunculate Oak, Field Maple, Common Hazel    | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Remnant hedge.                                                                                                                                                             | + 15                                     | C2                             |
| G62      | Quercus robur<br>Pedunculate Oak                                                                                             | 18.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Trees located on field's edge and edge of Maria Way Industrial Estate. Large, well formed Oak. Blackthorn forms the understory to the south-west.                          | + 45                                     | A1                             |
| G63      | Quercus robur, Fraxinus excelsior<br>Pedunculate Oak, Common Ash                                                             | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Good                 | Good                    | Semi-mature tree line with potential.                                                                                                                                      | + 30                                     | B2                             |
| G64      | Fraxinus excelsior, Quercus robur, Salix caprea, Ligustrum sp.<br>Common Ash, Pedunculate Oak, Goat Willow, Privet           | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Trees established on a low bund, likely dating back to the construction of the light industrial area. The boles have been damaged by grazing in some instances. Dead wood. | + 15                                     | C2                             |
| G65      | Corylus avellana, Fraxinus excelsior, Crataegus monogyna, Sambucus nigra<br>Common Hazel, Common Ash, Common Hawthorn, Elder | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | At field edge, beside stable. Mixed condition, scrubby multi-trunked trees and vigorous Ash.                                                                               | + 15                                     | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                 | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                         |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                  |                                          |                                |
| G66      | Acer campestre, Acer saccharinum, Fraxinus excelsior, Fagus sylvatica<br>Field Maple, Silver Maple, Common Ash, Common Beech            | 11.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Good                 | Good                    | Well formed Oaks in grassland with ornamental species noted. In rear garden.                                                                     | + 35                                     | A2                             |
| G67      | Fraxinus excelsior, Ulmus procera, Crataegus monogyna<br>Common Ash, English Elm, Common Hawthorn                                       | 11.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Larger, leaning Elm. Ash vigorous, in mixed remnant hedge.                                                                                       | + 15                                     | C2                             |
| G68      | Acer platanoides - Norway Maple                                                                                                         | 12.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Scrappy formed multi-stemmed field maples. Ivy cloaked stems. Included bark amongst basal stems, inspection limited by dense vegetation and Ivy. | 10-20                                    | C2                             |
| G69      | Corylus avellana - Common Hazel<br>Fraxinus excelsior - Common Ash                                                                      | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-OM     | Poor                 | Fair                    | Linear group mainly comprising hazel coppice stands in late mature age stage. Several have basal decay. Scrappy form, limited stature.           | 10-20                                    | C2                             |
| G70      | Salix cinerea - Grey Willow<br>Quercus robur - Pedunculate Oak<br>Crataegus monogyna - Common Hawthorn                                  | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Fair                    |                                                                                                                                                  | 20-40                                    | B2                             |
| G71      | Betula pendula - Silver Birch<br>Salix cinerea - Grey Willow<br>Fraxinus excelsior - Common Ash<br>Crataegus monogyna - Common Hawthorn | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | SM-SM     | Poor                 | Fair                    |                                                                                                                                                  | 10-20                                    | C2                             |
| G72      | Fraxinus excelsior - Common Ash<br>Quercus robur - Pedunculate Oak                                                                      | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-M      | Fair                 | Fair                    |                                                                                                                                                  | 20-40                                    | B2                             |
| G73      | Fraxinus excelsior - Common Ash                                                                                                         | 13.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-SM     | Fair                 | Fair                    |                                                                                                                                                  | 10-20                                    | C2                             |
| G74      | Salix cinerea - Grey Willow                                                                                                             | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Poor                 | Good                    | Cluster of stems growing adjacent ditch.                                                                                                         | 10-20                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                                      | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                                              |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                          |                                          |                                |
| G75      | Salix cinerea - Grey Willow Quercus robur - Pedunculate Oak                                                                                                                                  | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Poor                 | Good                    |                                                                                                          | 10-20                                    | C2                             |
| G76      | Fraxinus excelsior - Common Ash                                                                                                                                                              | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Fair                 | Fair                    |                                                                                                          | 10-20                                    | C2                             |
| G77      | Quercus robur - Pedunculate Oak Fagus sylvatica - Common Beech                                                                                                                               | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    |                                                                                                          | 20-40                                    | B2                             |
| G78      | Quercus robur - Pedunculate Oak                                                                                                                                                              | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-M      | Fair                 | Fair                    |                                                                                                          | 40+                                      | A2                             |
| G79      | Quercus robur - Pedunculate Oak                                                                                                                                                              | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-M      | Fair                 | Fair                    |                                                                                                          | 40+                                      | A2                             |
| G80      | Fraxinus excelsior - Common Ash Pseudotsuga menziesii - Douglas fir Populus x canadensis - Hybrid Black Poplar Pinus sylvestris - Scots Pine Ulmus sp. - Elm Quercus robur - Pedunculate Oak | 18.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-M      | Fair                 | Good                    |                                                                                                          | 40+                                      | A2                             |
| G81      | Pinus sylvestris - Scots Pine                                                                                                                                                                | 18.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M-M       | Fair                 | Good                    | Good collective worth.                                                                                   | 40+                                      | A2                             |
| G82      | Pinus sylvestris - Scots Pine Acer campestre - Field Maple Quercus robur - Pedunculate Oak                                                                                                   | 16.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-EM     | Fair                 | Good                    | Good collective worth.                                                                                   | 40+                                      | A2                             |
| G83      | Fraxinus excelsior - Common Ash Quercus robur - Pedunculate Oak Populus canescens - Balsam poplar                                                                                            | 16.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Mature, aged woodland, various higher canopy, midstory and groundflora qualities. Good collective worth. | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                     | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|---------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                             |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                   |                                          |                                |
| G84      | Quercus robur - Pedunculate Oak                                                                                                                                             | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    |                                                                                                   | 40+                                      | A2                             |
| G85      | Quercus robur - Pedunculate Oak                                                                                                                                             | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    |                                                                                                   | 40+                                      | A2                             |
| G86      | Quercus robur - Pedunculate Oak Fraxinus excelsior - Common Ash                                                                                                             | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    |                                                                                                   | 40+                                      | A2                             |
| G87      | Quercus robur - Pedunculate Oak Pinus sylvestris - Scots Pine                                                                                                               | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | EM-M      | Fair                 | Fair                    |                                                                                                   | 40+                                      | A2                             |
| G88      | Alnus glutinosa - Common Alder Populus nigra 'Italica' - Lombardy Poplar Fraxinus excelsior - Common Ash Quercus robur - Pedunculate Oak                                    | 16.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    |                                                                                                   | 20-40                                    | B2                             |
| G89      | Quercus robur - Pedunculate Oak                                                                                                                                             | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Fair                    | Collective worth greater than individuals present.                                                | 20-40                                    | A2                             |
| G90      | Acer campestre - Field Maple Quercus robur - Pedunculate Oak Populus nigra 'Italica' - Lombardy Poplar Crataegus monogyna - Common Hawthorn Corylus avellana - Common Hazel | 13.0       | Ave 0.3          |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Thicket understory, individual Poplar and Ash with skyline presence. Few spruce and patchy areas. | 20-40                                    | B2                             |
| G91      | Quercus robur - Pedunculate Oak Fraxinus excelsior - Common Ash Acer campestre - Field Maple Crataegus monogyna - Common Hawthorn                                           | 14.0       | Ave 0.5          |   |   |   | -              | -                | -                             | -           | SM-M      | Good                 | Good                    | Good collective worth. Mixed copse, some fine Ash and Oak.                                        | 40+                                      | A2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                    | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                            |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                   |                                          |                                |
| G92      | Fraxinus excelsior - Common Ash                                                                                                                                            | 14.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Fair                    |                                                                                                                                                                                   | 20-40                                    | B2                             |
| G93      | Quercus robur - Pedunculate Oak<br>Fraxinus excelsior - Common Ash<br>Ilex aquifolium - Common Holly                                                                       | 15.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-M      | Fair                 | Fair                    | Good collective worth.                                                                                                                                                            | 40+                                      | A2                             |
| G94      | Quercus robur - Pedunculate Oak<br>Fraxinus excelsior - Common Ash<br>Ilex aquifolium - Common Holly                                                                       | 18.0       | as shown.        |   |   |   | -              | -                | -                             | -           | SM-M      | Fair                 | Good                    | Good collective worth.                                                                                                                                                            | 40+                                      | A2                             |
| G95      | Ulmus sp. - Elm<br>Salix caprea - Goat Willow<br>Acer campestre - Field Maple<br>Corylus avellana - Common Hazel                                                           | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Fair                    | rough group comprised of pioneer species trees. Dense bramble understory. Contains several elms, which likely have a limited useful lifetime expectancy due to Dutch elm disease. | 10-20                                    | C2                             |
| G96      | Quercus robur - Pedunculate Oak<br>Salix caprea - Goat Willow<br>Alnus glutinosa - Common Alder                                                                            | 10.0       | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Group of young trees situated around edge of pond. Good vitality. Limited stature.                                                                                                | 20-40                                    | C2                             |
| G97      | Fraxinus excelsior - Common Ash<br>Salix chrysocoma - Goat Willow<br>Crataegus monogyna - Common Hawthorn<br>Quercus robur - Pedunculate Oak<br>Salix caprea - Goat Willow | 8.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Rough group of Pioneer vegetation encircling pond.                                                                                                                                | 20-40                                    | C2                             |
| G98      | Salix cinerea - Grey Willow<br>Quercus robur - Pedunculate Oak                                                                                                             | 6.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Fair                    | Boundary Vegetation, thicket and patchy. Bramble                                                                                                                                  | 20-40                                    | C2                             |
| G99      | Ulex sp. - Gorse<br>Salix cinerea - Grey Willow<br>Quercus robur - Pedunculate Oak<br>Ilex aquifolium - Common Holly                                                       | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Mixed field boundary vegetation.                                                                                                                                                  | 20+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                              | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                      |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G100     | Corylus avellana -<br>Common Hazel Quercus robur -<br>Pedunculate Oak Salix caprea -<br>Goat Willow                                                  | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Young trees on field boundary.                     | 20+                                      | C2                             |
| G101     | Quercus robur -<br>Pedunculate Oak                                                                                                                   | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Young oak trees located on field boundary.         | 20+                                      | C2                             |
| G102     | Corylus avellana -<br>Common Hazel Salix cinerea -<br>Grey Willow Quercus robur -<br>Pedunculate Oak Populus nigra<br>'Italica' -<br>Lombarby Poplar | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Young boundary vegetation beyond fence line.       | 20+                                      | C2                             |
| G103     | Crataegus monogyna -<br>Common Hawthorn Prunus spinosa -<br>Blackthorn Acer campestre -<br>Field Maple                                               | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Young field boundary vegetation beyond fence line. | 20+                                      | C2                             |
| G104     | Ulmus sp. -<br>Elm                                                                                                                                   | 6          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Poor                 | Poor                    | Off-site dead/dying elm.                           | <10                                      | U                              |
| G105     | Corylus avellana -<br>Common Hazel                                                                                                                   | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | SM-SM     | Fair                 | Good                    | Hazel growing adjacent ditch.                      | 15+                                      | C2                             |
| G106     | Acer campestre -<br>Field Maple Prunus spinosa -<br>Blackthorn                                                                                       | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | SM-SM     | Fair                 | Fair                    | Young poor quality trees beneath power lines.      | 10+                                      | C1/2                           |
| G107     | Rubus fruticosus -<br>Bramble Salix caprea -<br>Goat Willow                                                                                          | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Good                 | Good                    | Clump of young willow within mass of bramble       | 15+                                      | C2                             |
| G108     | Quercus robur -<br>Pedunculate Oak Salix sp. -<br>Weeping Willow                                                                                     | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Group of young trees in mass of vegetation.        | 20+                                      | C2                             |
| G109     | Crataegus monogyna -<br>Common Hawthorn Rubus fruticosus -<br>Bramble                                                                                | 2          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Mass of vegetation on ditch bank.                  | 20+                                      | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                            | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|--------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                    |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G110     | Crataegus monogyna -<br>Common Hawthorn<br>Ulmus sp. -<br>Elm<br>Rubus fruticosus -<br>Bramble                     | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Mass of vegetation.                                | 20+                                      | C2                             |
| G111 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G112 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G113 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G114     | Crataegus monogyna -<br>Common Hawthorn                                                                            | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | SM-EM     | Fair                 | Good                    | Area of hawthorn.                                  | 15+                                      | C2                             |
| G115     | Crataegus monogyna -<br>Common Hawthorn<br>Rubus fruticosus -<br>Bramble                                           | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Mass of bramble with small number of hawthorn.     | 15+                                      | C1/2                           |
| G116     | Corylus avellana -<br>Common Hazel<br>Ilex aquifolium -<br>Common Holly<br>Crataegus monogyna -<br>Common Hawthorn | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Mass of vegetation on ditch bank.                  | 20+                                      | C2                             |
| G117     | Crataegus monogyna -<br>Common Hawthorn                                                                            | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | SM-SM     | Fair                 | Good                    | Small sporadic hawthorn.                           | 15+                                      | C1                             |
| G118 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G119 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |
| G120 n/a |                                                                                                                    |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                    |                                          |                                |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                          | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                            | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                  |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G121     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G122     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G123     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G124     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G125     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G126     | n/a                                                                                                              |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                               |                                          |                                |
| G127     | Quercus robur - Pedunculate Oak, Fraxinus excelsior - Common Ash                                                 | 10.0       | as shown.        |   |   |   | 200-1000       | -                | -                             | -           | Y-EM      | Good                 | Good                    | Small group of closely spaced stems, some Ash, remove Ash and retain Oak.     | 40+                                      | B2                             |
| G128     | Acer campestre - Field Maple, Quercus robur - Pedunculate Oak, Fraxinus excelsior - Common Ash, Tilia sp. - Lime | 15.0       | as shown.        |   |   |   | 200-1000       | -                | -                             | -           | Y-EM      | Good                 | Good                    | Important roadside group of trees, high amenity value, good screening effect. | 40+                                      | B2                             |
| G129     | Fraxinus excelsior - Common Ash, Crataegus monogyna - Common Hawthorn                                            | 9.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Understory of young/semi-mature trees and shrubs.                             | 20+                                      | C2                             |
| G130     | Quercus robur - Pedunculate Oak Buxus Sp. - Box Sp, Rubus fruticosus - Bramble                                   | 5.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y         | Good                 | Good                    | Collection of young trees and shrubs in field.                                | 10+                                      | C2                             |
| G131     | Salix caprea, Quercus robur, Fraxinus excelsior Goat Willow, Pedunculate Oak, Common Ash                         | 4.0        | see plan         |   |   |   | up to 0.2      | var              | -                             | -           | M         | Good                 | Good                    | Patchy vegetation along ditch, including multi-stem Willow.                   | + 30                                     | B2/3                           |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                       | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                               |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                             |                                          |                                |
| G132     | Salix caprea<br>Goat Willow                                                                                                                                   | 8.0        | see plan         |   |   |   | up to 0.2      | var              | 0.00                          | -           | M         | Good                 | Fair                    | Various multi-stem Willow, some lapsed stems.                                                                                                               | + 20                                     | C2/3                           |
| G133     | Populus sp. (var)<br>Poplar sp.                                                                                                                               | +20        | see plan         |   |   |   | ave 0.4        | var              | -                             | -           | M         | Poor                 | Good                    | Cluster of close Poplar or series of multi-stem. Recent and past major failures at stem. Unviable as long term trees, coppice or pollard.                   | <10                                      | U                              |
| G134     | Populus sp.<br>Poplar sp.                                                                                                                                     | 2.0        | see plan         |   |   |   | <0.1           | var              | 0.00                          | -           | Y         | Good                 | Good                    | Regenerating stumps of former Poplar group.                                                                                                                 | + 20                                     | C2                             |
| G135     | Cupressocyparis x leylandii<br>Leyland Cypress                                                                                                                | +10        | see plan         |   |   |   | ave 0.5        | 1.00             | 1.00                          | -           | M         | Good                 | Good/Fair               | Linear conifer group.                                                                                                                                       | + 20                                     | C2                             |
| H1       | Quercus robur, Ulmus procera, Crataegus monogyna, Prunus spinosa, Corylus avellana<br>Pedunculate Oak, English Elm, Common Hawthorn, Blackthorn, Common Hazel | 3.5-4      | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Strongly defines the road. Mixed species mature hedge established at foot of ditch and running over the bark bund. Burrowing noted in bund. Overhead cable. | + 25                                     | B1                             |
| H2       | Rhododendron, Crataegus monogyna<br>Rhododendron, Common Hawthorn                                                                                             | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Scrappy, mixed species hedge much congested with bramble. Dense screen.                                                                                     | + 20                                     | C2                             |
| H3       | Acer campestre, Ulmus procera, Prunus spinosa<br>Field Maple, Elm, Blackthorn                                                                                 | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Established atop boundary bund adjacent ditch. Screening. Occasional moribund stems/trunks likely Dutch elm Disease.                                        | + 25                                     | B1                             |
| H4       | Ulmus procera, Crataegus monogyna, Fraxinus excelsior, Quercus robur<br>English Elm, Common Hawthorn, Common Ash, Pedunculate Oak                             | 3.5-4      | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Elm rich hedge defining road comprises mature trunks and moribund wood likely Dutch Elm Disease. Effectively defines the road corridor.                     | + 25                                     | B2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                               | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                          | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                                       |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                             |                                          |                                |
| H5       | Acer campestre, Ulmus procera, Crataegus monogyna, Corylus avellana<br>Field Maple, English Elm, Common Hawthorn, Common Hazel                                                        | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Optimum height likely defined by overhead cable. Bounds and defines the road corridor.                                                                      | + 15                                     | C1                             |
| H6       | Crataegus monogyna, Prunus spinosa, Sorbus torminalis, Fraxinus excelsior, Acer campestre<br>Common Hawthorn, Blackthorn, Wild Service tree, Common Ash, Field Maple                  | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Small, gappy sections to field boundary between larger climax trees. Occasional larger ash and field maple.                                                 | + 15                                     | C1                             |
| H7       | Crataegus monogyna, Acer campestre, Sambucus nigra, Fraxinus excelsior, Quercus robur, Prunus spinosa<br>Common Hawthorn, Field Maple, Elder, Common Ash, Pedunculate Oak, Blackthorn | 4.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Hawthorn rich forming an effective dense agricultural hedge. Screens the equestrian track and field. Occasional large specimens noted within the hedgeline. | + 15                                     | C2                             |
| H8       | Corylus avellana, Prunus spinosa, Crataegus monogyna<br>Common Hazel, Blackthorn, Common Hawthorn                                                                                     | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Hedge, formed of Hazel coppice with sections of Blackthorn. Runs along ditch.                                                                               | + 25                                     | B1                             |
| H9       | Prunus spinosa<br>Blackthorn                                                                                                                                                          | 1.8        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Hedge bounding wooded area and Hogwood House property.                                                                                                      | + 15                                     | C2                             |
| H10      | Crataegus monogyna, Corylus avellana, Prunus spinosa<br>Common Hawthorn, Common Hazel, Blackthorn                                                                                     | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | EM        | Poor                 | Poor                    | Scrappy hedge. Recently planted but not maintained.                                                                                                         | + 10                                     | C3                             |
| H11      | Corylus avellana, Crataegus monogyna<br>Common Hazel, Common Hawthorn                                                                                                                 | 6.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Offers fair screen.                                                                                                                                         | + 15                                     | C2                             |
| H12      | Ulmus procera, Crataegus monogyna<br>English Elm, Common Hawthorn                                                                                                                     | 3.5        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Poor                    | Dense thorn hedge, unkept, partly over-run by bramble.                                                                                                      | + 15                                     | C2                             |
| H13      | Fagus sylvatica -<br>Common Beech                                                                                                                                                     | 2.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Good                 | Good                    | Young beech hedge. Good vitality.                                                                                                                           | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                   | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                               | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|---------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                           |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                  |                                          |                                |
| H14      | Fagus sylvatica - Common Beech                                                                                            | 2.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Good                 | Good                    | Young beech hedge within Hogwood house boundary. Parallel to ditch.              | 20-40                                    | C2                             |
| H15      | Prunus spinosa - Blackthorn                                                                                               | 2          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | predominately blackthorn hedge at border between pond and field.                 | 20-40                                    | C2                             |
| H16      | Ulmus sp. - Elm<br>Crataegus monogyna - Common Hawthorn<br>Corylus avellana - Common Hazel<br>Prunus spinosa - Blackthorn | 4.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Good                 | Fair                    | rough hedge, includes dense bramble. Outgrown trees in places, flailed at edges. | 20-40                                    | C2                             |
| H17      | Salix fragilis - Crack Willow                                                                                             | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Poor                 | Fair                    | Poor quality young willow, multiple stem fractures.                              | 10-20                                    | C2                             |
| H18      | Salix fragilis - Crack Willow                                                                                             | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-Y       | Fair                 | Fair                    | Poor quality young willow.                                                       | 10-20                                    | C2                             |
| H19      | Crataegus monogyna - Common Hawthorn<br>Quercus robur - Pedunculate Oak                                                   | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Predominantly hawthorn hedgerow section.                                         | 20-40                                    | C2/3                           |
| H20      | Crataegus monogyna - Common Hawthorn                                                                                      | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Hawthorn hedgerow section.                                                       | 20-40                                    | C2/3                           |
| H21      | Crataegus monogyna - Common Hawthorn<br>Rosa canina - Dog Rose                                                            | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Hawthorn hedgerow section.                                                       | 20-40                                    | C2/3                           |
| H22      | Salix cinerea - Goat Willow                                                                                               | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Willow hedgerow section.                                                         | 20-40                                    | C2                             |
| H23      | Crataegus monogyna - Common Hawthorn<br>Salix caprea - Goat Willow                                                        | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Occasionally flailed hedgerow section.                                           | 20-40                                    | C2                             |
| H24      | Crataegus monogyna - Common Hawthorn<br>Salix caprea - Goat Willow<br>Quercus robur - Pedunculate Oak                     | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Occasionally flailed hedgerow section.                                           | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                       | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                 | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                               |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                    |                                          |                                |
| H25      | Crataegus monogyna -<br>Common Hawthorn Fraxinus excelsior -<br>Common Ash Acer campestre -<br>Field Maple Quercus robur -<br>Pedunculate Oak | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Occasionally failed mixed hedgerow section.                                        | 20-40                                    | C2/3                           |
| H26      | Carpinus betulus -<br>Hornbeam Prunus spinosa -<br>Blackthorn                                                                                 | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Occasionally failed hedgerow section.                                              | 20-40                                    | C2                             |
| H27      | Carpinus betulus -<br>Hornbeam Crataegus monogyna -<br>Common Hawthorn                                                                        | 6          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Off site hedge section.                                                            | 20-40                                    | C2                             |
| H28      | Carpinus betulus -<br>Hornbeam Crataegus monogyna -<br>Common Hawthorn Acer campestre -<br>Field Maple Corylus avellana -<br>Common Hazel     | 2.5        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Young hedge section.                                                               | 20-40                                    | C2                             |
| H29      | Acer campestre -<br>Field Maple Crataegus monogyna -<br>Common Hawthorn Prunus spinosa -<br>Blackthorn                                        | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Gappy hedgerow.                                                                    | 20-40                                    | C2                             |
| H30      | Salix sp. -<br>Weeping Willow Betula sp. -<br>Birch sp.                                                                                       | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Poor                 | Fair                    | Mass of predominantly young willow around water body.<br>Collapsed willow present. | 10+                                      | C1/2                           |
| H31      | Crataegus monogyna -<br>Common Hawthorn                                                                                                       | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Hedgerow section.                                                                  | 20-40                                    | C2                             |
| H32      | Ulex europaeus -<br>Gorse                                                                                                                     | 1.5        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Clumps of gorse.                                                                   | 10+                                      | C2                             |
| H33      | Crataegus monogyna -<br>Common Hawthorn Salix cinerea -<br>Grey Willow Fraxinus excelsior -<br>Common Ash                                     | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Hedgerow section.                                                                  | 20-40                                    | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                          | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                  |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                          |                                          |                                |
| H34      | Ulex europaeus - Gorse                                                                                                           | 1.5        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Clumps of gorse.                                                         | 10+                                      | C2                             |
| H35      | Ulex europaeus - Gorse                                                                                                           | 2          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Clumps of gorse.                                                         | 10+                                      | C2                             |
| H36      | Ulex europaeus - Gorse                                                                                                           | 1          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Clumps of gorse.                                                         | 10+                                      | C2                             |
| H37      | Crataegus monogyna - Common Hawthorn                                                                                             | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Hedgerow section.                                                        | 20-40                                    | C2                             |
| H38      | Crataegus monogyna - Common Hawthorn<br>Acer campestre - Field Maple                                                             | 5          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Hedgerow section.                                                        | 20-40                                    | C2                             |
| H39      | Crataegus monogyna - Common Hawthorn<br>Rubus fruticosus - Bramble                                                               | 2.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Hedgerow section.                                                        | 20-40                                    | C2/3                           |
| H40      | Crataegus monogyna - Common Hawthorn                                                                                             | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Hedgerow section.                                                        | 20-40                                    | C2                             |
| H41      | Crataegus monogyna - Common Hawthorn<br>Acer campestre - Field Maple<br>Ulmus sp. - Elm<br>Fraxinus excelsior - Common Ash       | 6          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Hedgerow separated from site by ditch.                                   | 20-40                                    | C2                             |
| H42      | Crataegus monogyna - Common Hawthorn<br>Prunus spinosa - Blackthorn<br>Rosa canina - Dog Rose<br>Fraxinus excelsior - Common Ash | 5.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Fair                 | Good                    | Hedgerow on field boundary.                                              | 20-40                                    | C2/3                           |
| H43      | Ulmus sp. - Elm                                                                                                                  | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair-Poor            | Fair-Poor               | Hedgerow section comprising predominantly elm. Dead/dying trees present. | <10, 10+                                 | C1/U                           |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                              | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                       | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|----------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|--------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                      |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                          |                                          |                                |
| H44      | Ulmus sp. - Elm                                                                                                      | 4.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair-Poor            | Fair-Poor               | Hedgerow section comprising predominantly elm. Dead/dying trees present. | <10, 10+                                 | C1/U                           |
| H45      | Ulmus sp. - Elm<br>Crataegus monogyna - Common Hawthorn<br>Rubus fruticosus - Bramble                                | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair-Poor            | Fair-Poor               | Hedgerow section. Dead/dying trees present.                              | <10, 10+                                 | C1/U                           |
| H46      | Prunus spinosa - Blackthorn<br>Crataegus monogyna - Common Hawthorn<br>Rubus fruticosus - Bramble                    | 3          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Hedgerow section on edge of woodland block.                              | 20-40                                    | C2/3                           |
| H47      | Crataegus monogyna - Common Hawthorn<br>Prunus spinosa - Blackthorn<br>Rubus fruticosus - Bramble<br>Ulmus sp. - Elm | 2          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Untidy hedgerow section.                                                 | 20-40                                    | C2                             |
| H48      | Crataegus monogyna - Common Hawthorn<br>Acer campestre - Field Maple                                                 | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-EM      | Good                 | Good                    | Hedgerow section, patchy.                                                | 20-40                                    | C2                             |
| H49      | n/a                                                                                                                  |            |                  |   |   |   |                |                  |                               |             |           |                      |                         |                                                                          |                                          |                                |
| H50      | Crataegus monogyna - Common Hawthorn<br>Acer campestre - Field Maple                                                 | 4          | as shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Good                 | Good                    | Hedgerow section. Side failed.                                           | 20-40                                    | C2                             |
| H51      | Fraxinus excelsior - Common Ash<br>Quercus robur - Pedunculate Oak<br>Rubus fruticosus - Bramble                     | 3.0        | as shown.        |   |   |   | -              | -                | -                             | -           | Y         | Good                 | Good                    | Line of shrubs and hedge thicket in field.                               | 10+                                      | C2                             |
| H52      | Chamaecyparis lawsoniana 'variegata' Lawson Cypress                                                                  | 8.0        | see plan         |   |   |   | est 0.2        | -                | -                             | -           | EM        | Good                 | Good                    | Topped, effective screen.                                                | + 20                                     | C2                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                                                               | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                   | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                                                                       |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                      |                                          |                                |
| W1       | Quercus robur, Betula pendula, Ilex aquifolium, Acer campestre, Fraxinus excelsior<br>Pedunculate Oak, Silver Birch, Common Holly, Field Maple, Common Ash                                                            | >22        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Woodland with a fairly open character. Large well formed mature Oak and early mature Birch in the more open areas.                                                                                                   | + 45                                     | A1                             |
| W2       | Quercus robur<br>Pedunculate Oak                                                                                                                                                                                      | >18        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Good                 | Good                    | Large, well formed climax Oak. High in skyline amenity.                                                                                                                                                              | + 40                                     | A1                             |
| W3       | Quercus robur, Crataegus monogyna, Pseudotsuga menziesii<br>Pedunculate Oak, Common Hawthorn, Douglas Fir                                                                                                             | 16.0       | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Large, fine Oak with Douglas Fir.                                                                                                                                                                                    | + 20                                     | B2                             |
| W4       | Quercus robur, Pinus sylvestris, Poplar sp., Salix sp.<br>Pedunculate Oak, Scots Pine, Poplar, Willow                                                                                                                 | >19        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Mixed quality woodland with mainly well formed Oak and occasional Pine with leaning Poplar and lapsed Willow.                                                                                                        | + 35                                     | B2                             |
| W5       | Pseudotsuga menziesii, Pinus sylvestris, Larix sp., Acer campestre<br>Douglas Fir, Scots Pine, Larch, Field Maple                                                                                                     | >19        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Scots Pine and Douglas Fir dominate this narrow woodland stand. Many are cloaked by Ivy to the mid-crown. Larch is in poor structural condition.                                                                     | + 35                                     | A2/3                           |
| W6       | Fraxinus excelsior, Populus sp., Quercus robur, Betula pendula, Corylus avellana, Crataegus monogyna, Acer campestre<br>Common Ash, Poplar, Pedunculate Oak, Silver Birch, Common Hazel, Common Hawthorn, Field Maple | >19        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Poor                    | Upper canopy dominated by large Poplar. These are typically drawn but visible from some distance forming a significant green massing and backdrop to the site. Mid-story and field edge comprise Hazel and Hawthorn. | + 25                                     | A2/3                           |
| W7       | Quercus robur, Fraxinus excelsior, Corylus avellana, Ilex aquifolium<br>Pedunculate Oak, Common Ash, Common Hazel, Common Holly                                                                                       | >18        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Good                    | Large climax Oak form the south-western boundary. Woodland is open in character with central core of early mature etiolated Ash boles and birch.                                                                     | + 40                                     | A1                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

# Tree Survey Schedule

**Site** Hogwood / Finchampstead  
**Project schedule ref:** JSL2891\_754  
**Drawing reference:** JSL2891\_701 to 718  
**Survey date:** Dec 2017 / Jan 2018 / Jun 2019/ April 2021/Jan 2022/ Aug2023 (P11,12&13) / Feb 2024 (P4/5 & Sports Hub)

**Surveyor:** Various  
**Status:** For Information  
**Revision:** C (issue date March 2024)



| Ref. no. | Species                                                                                                                                                                                                                | Height (m) | Crown spread (m) |   |   |   | Stem dia. (mm) | Stem no. at 1.5m | Height of crown clearance (m) | Dir/ height | Age class | Structural condition | Physiological condition | General observations<br>Management recommendations                                                                                                                                                                                                        | Estimated remaining contribution (years) | Tree Quality Category (BS5837) |
|----------|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------|------------------|---|---|---|----------------|------------------|-------------------------------|-------------|-----------|----------------------|-------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------|--------------------------------|
|          |                                                                                                                                                                                                                        |            | N                | E | S | W |                |                  |                               |             |           |                      |                         |                                                                                                                                                                                                                                                           |                                          |                                |
| W8       | Quercus robur, Fraxinus excelsior, Salix sp., Acer campestre<br>Pedunculate Oak, Common Ash, Willow, Field Maple                                                                                                       | >18        | as shown.        |   |   |   | -              | -                | -                             | -           | M         | Fair                 | Fair                    | Mixed native species.                                                                                                                                                                                                                                     | + 40                                     | A1                             |
| W9       | Quercus robur - Pedunculate Oak, Fagus sylvatica - Common Beech, Corylus avellana - Common Hazel, Ilex aquifolium - Common Holly                                                                                       | 15.0       | as shown.        |   |   |   | 200-1200       | -                | -                             | -           | Y-OM      | Good                 | Good                    | Well established mature woodland with some large open grown Oak and Beech. Wire fenceline marks a boundary to south and west. -0.5 deep ditch between road and fenceline on west side. Majority of substantial root growth likely to be towards the east. | 40+                                      | A2                             |
| W10      | Pseudotsuga; Douglas Firs - Norway spruce Larix decidua - European Larch Fraxinus excelsior - Common Ash Quercus robur - Pedunculate Oak                                                                               | 17.0       | Ave 0.6          |   |   |   | -              | -                | -                             | -           | SM-M      | Fair                 | Good                    | Mixed linear copse, with distinct east/west variance. West, more aged mixed and native, east planted including strong theme of Douglas Fir. Mixed understory. Douglas Fir providing consistent skyline feature.                                           | 40+                                      | A2/3                           |
| W11      | Acer campestre - Field Maple Fraxinus excelsior - Common Ash Quercus robur - Pedunculate Oak Prunus avium - Wild Cherry Crataegus monogyna - Common Hawthorn, Corylus avellana- Common Hazel, Hedera helix- Common Ivy | 10.0       | As shown.        |   |   |   | -              | -                | -                             | -           | Y-SM      | Fair                 | Good                    | Aged wooded copse, linear form. Ditches on east and west boundaries. Ash coppice dominant. Few aged maidens. Even aged Ash, some multi-stem. Few thorn and Maple. Few Butchers Broom, open stand.                                                         | 20-40                                    | A2/3                           |
| W11a     | Crataegus monogyna, Acer campestre<br>Common Hawthorn, Field Maple                                                                                                                                                     | 8.0        | see plan         |   |   |   | ave 0.2        | -                | -                             | -           | M         | Good/Fair            | Good/Far                | Thorn thicket and individuals.                                                                                                                                                                                                                            | + 20                                     | B3                             |

Note: This survey is based on a brief visual inspection from the ground.  
It is not intended as a full arboricultural inspection.  
# - Indicates estimated tree. \* - Indicates off site tree.

## Appendix E

### Example Tree Protection Barriers (BS5837:2012 Fig 2 & 3)

Figure 2 Default specification for protective barrier



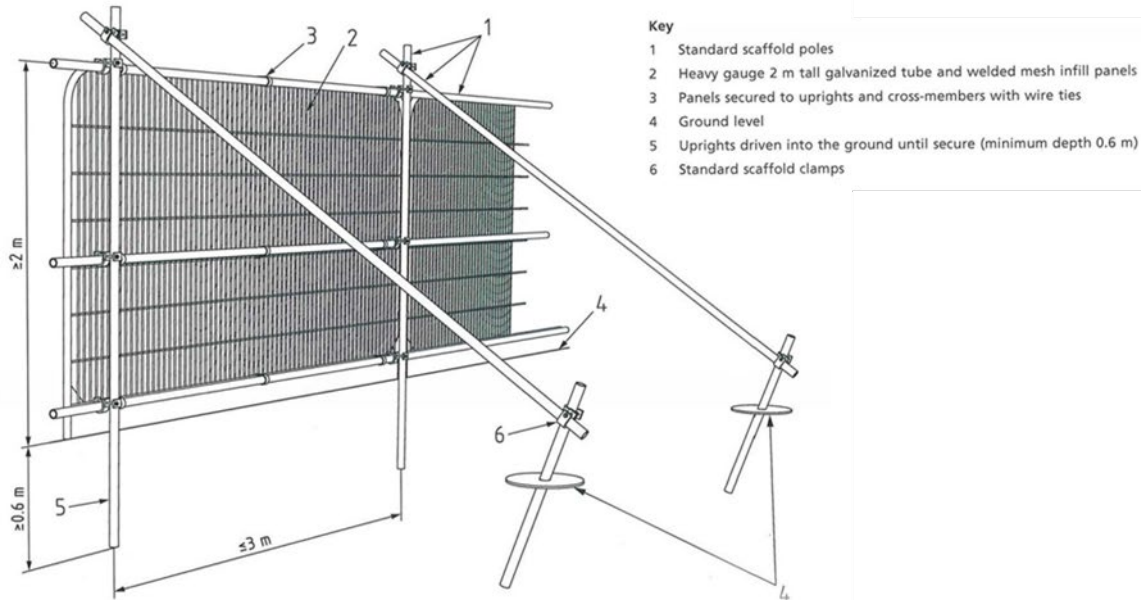


Figure 3 Examples of above-ground stabilizing systems

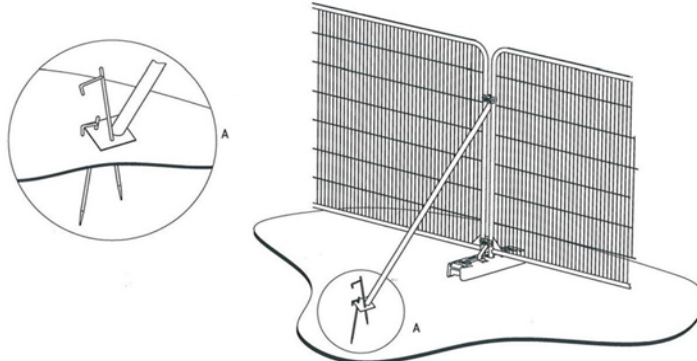

a) Stabilizer strut with base plate secured with ground pins

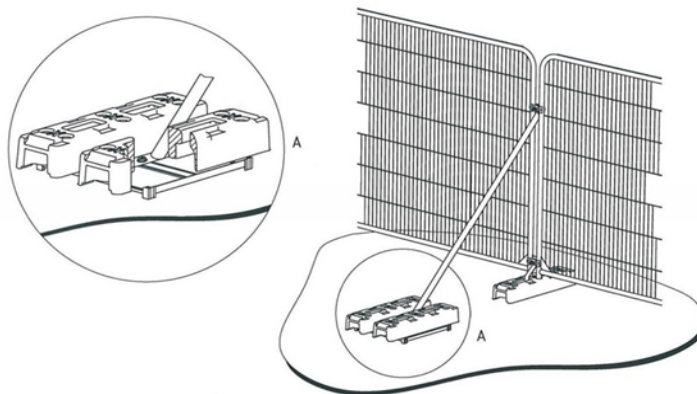

b) Stabilizer strut mounted on block tray

## Appendix F

### Construction Exclusion Zone (CEZ) Signage



## Appendix G

### Arboricultural Glossary

**Age-class** - A general classification of the tree into either - young, semi-mature, early mature, mature, over-mature, or veteran.

**Apical Bud/Shoot** – The apical bud, also known as the leading shoot, is responsible for shoot extension and is dominant.

**Apical Dominance** – A singular, leading shoot remains dominant.

**Arboreal** - In connection with, or in relation to, trees.

**Arboriculturalist** – Person who has, through relevant education, training and experience, gained recognised qualifications and expertise in the field of trees in relation to construction.

**Arboricultural Implications Assessment (AIA)** – Study, undertaken by an arboriculturalist, to identify, evaluate and possibly mitigate the extent of direct and indirect impacts on existing trees that may arise as a result of the implementation of any site layout proposal.

**Arboricultural Method Statement (AMS)** – Methodology for the implementation of any aspect of development that has the potential to result in the loss of or damage to a tree. Note The AMS is likely to include details of an on-site tree protection monitoring regime.

**Asymmetric crown**- Crowns that have a morphological bias in a particular direction. This can give the tree an aesthetically unfavourable appearance, but can also subject the tree to uneven wind- loading forces and potentially result in failure.

**Basal** – Referring to the bottom part of a tree's stem.

**Basifugal mortality** – A natural process seen in trees in an advanced life stage whereby the trees extremities die back and the inner crown expresses new growth, in order to conserve energy reserves.

**Bifurcated** - A growth characteristic, where two stems of similar size grow from the same point. Can create an inherent weakness.

**Branch union/junction** - The point at which a branch joins a larger stem. Can be a point of weakness, especially in certain species.

**Brown Rot**- Decay caused by certain species of fungus which results in the affected wood becoming brittle and liable to suddenly 'break out', especially if in key structural areas.

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

---

**Buttress flares** – Extensions of the basal stem of a tree that provide additional structural support. See reaction wood.

**Bifurcated**- A growth characteristic, where two or more stems of similar size grow from the same point. Can create an inherent weakness.

1 **Cable braces** – Cable braces used to support the crown of a tree, reduce impacts caused by wind- throw oscillation.

**Canker** – A clearly defined area of dead and sunken or malformed bark, caused by bacteria or fungi. Can have a bearing on structural integrity of infected limb(s) depending on size and location.

**Central leader**- See apical dominance.

**Chalara ash dieback**- A disease affecting ash trees caused by the fungus *Hymenoscyphus fraxineus*. Usually fatal, the disease causes leaf loss and crown dieback in infected trees. It was first confirmed in Britain in 2012.

**Chlorosis**- yellowing of leaves which can be caused by a range of factors, often an indicator of nutrient deficiency.

**Compaction** - The compressing & hardening of soil around tree root systems, due to vehicular/pedestrian use etc. Loss of pore space between soil granules limits water movement and gaseous exchange, and inhibits root growth.

**Companion shelter**- Shelter provided by neighbouring trees in groups to one another, factors such as wind throw are reduced due to supporting branches and interlocking root systems. Removing individual trees on the peripheries of such groups can expose neighbouring trees to environmental factors they have not previously been subjected to and can lead to individual failure.

**Competent person** – Person who has training and experience relevant to the matter being addressed and an understanding of the requirements of the particular task being approached

Note 1 A competent person understands the hazards and the methods to be implemented to eliminate or reduce the risks that can arise. For example, when on site, a competent person is able to recognise at all times whether it is safe to proceed.

Note 2 A competent person is able to advise on the best means by which the recommendations of this British Standard may be implemented.

**Condition** – Assessment based on a visual and professional view giving consideration to many factors such as tree health, structural integrity and suitability of its position.

**Conservation dead- wooding**- Removal of deadwood using 'coronet cuts' that mimic the way a branch would naturally break off, maximising deadwood habitat availability for invertebrates.

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

---

**Coppice** - The method of managing trees by cutting the stems at between 1.0 inch and 1.0 foot from the ground level on a regular cycle, the cut stumps of the trees or shrubs are allowed to re-grow many new stems.

**Crown spread** - Gives distances between extreme limits of the crown and the stem, usually along the four compass points. Helps to show crown symmetry.

**Crown Reduction** – The removal of branch ends to reduce the extreme limits of a trees branch spread and height.

**Crown Thin** – The removal of selected branches within the crown to thin the internal branch structure.

**D.B.H.** - 'Diameter at Breast Height', an industry standard to gauge tree stem size and development. Within arboriculture, breast height is taken to be 1.5m above ground level.

**Dieback** - The reduction in crown vigour and extension growth progressing to death of distal parts; often associated with decline.

**Epicormic growth** - New growth from dormant buds that can often form tenuous attachments. Although some species readily form such shoots, it can be an indication of stress.

**Form** - A general assessment of the shape and position of the tree within its environment.

**Hanger** – Term used to describe a branch that has become detached and is being supported by other branches. Can be a hazard to persons and property below.

**Hazard Beam** – After the loss of a distal part, a limb concentrates growth upwards creating adverse end weights that can render the limb susceptible to failure. .

**Included bark** – Growth characteristic usually caused when two or more stems/branches growing in close proximity 'fuse' together entrapping the bark from when the parts were separate in the middle, creating a structural weakness.

**Invertebrate tower** – Pollarding of a (usually dead) tree to a safe height that leaves part of the main stem as a deadwood habitat for invertebrate species.

**Occlusion/Occluded** – Normally used to describe the overgrowth of a wound. Also, immovable foreign objects in contact with a tree part can become encased or 'occluded' by the tree as it grows incrementally.

**Pathogen** - An agent that causes disease, especially a living microorganism such as a bacterium or fungus.

**Phototropic growth** – Growth responding to a light stimulus i.e. the sun. This can influence the form of a tree, particularly where other factors e.g. buildings or other trees, affect the amount/ direction light is received.

## TREE SURVEY AND ARBORICULTURAL IMPACT ASSESSMENT

---

**Pollard** – The removal and subsequent regular re-removal of the crown of a tree above animal browsing height. Can be an effective method of controlling the size of trees in urban areas. This is ideally begun in the trees early stages and maintained throughout its life.

**Reaction wood** - Essentially additional wood laid down by the tree to compensate for structural defects such as cavities.

**Rhizosphere** - The rhizosphere is the narrow region of soil that is directly influenced by root secretions and associated soil microorganisms. In particular, mycorrhizal fungi form a symbiotic relationship with trees and assist in the assimilation of phosphates essential to the trees health.

**Ring barking/Girdling** – the removal of bark around the entire circumference of a stem or branch, causing the death of all distal parts.

**Root Protection Area (RPA)** – Layout design tool indicating the area surrounding a tree that contains sufficient rooting volume to ensure the survival of the tree, shown in plan form in m<sup>2</sup>.

**Scaffold limbs** - The main structural branches within the crown.

**Tree protection plan** – scale drawing prepared by an arboriculturalist showing the finalised layout proposals, tree retention and tree and landscape protection measures detailed within the arboricultural method statement (AMS), which can be shown graphically.

**U.L.E** – ‘Useful Life Expectancy’ is an estimate based on currently known factors of the possible remaining life of the tree as an asset. AKA ‘Estimated remaining contribution’.

**Veteran tree** – Tree that, by recognised criteria, shows features of biological, cultural or aesthetic value that are characteristic of, but not exclusive to, individuals surviving beyond the typical age range for the species concerned.

**Vigour** - A general classification, as to the present and future potential growth and development of a tree. A comment regarding the health status of the tree specific to its species.

**White Rot** - A type of decay caused by certain species of fungi which results in the affected wood becoming flexible with little compressive strength.